

Evidence of the Highways Dilapidation

34 Hillingdon Road,
Whitefield, Manchester,
M45 7QN

Condition 3 of Application Number: 68736/FUL
April 2023



Photo 1

02/04/2023 | 17:52

Photo showing Hillingdon Road from the point of the right side of the road viewing from the same side where the property in the enquiry is.

Notes:

- Dropped down curb majority of the way through apart from further down where the white slabs appear on the path in front of the drive.
- Water source pavement cover with new tarmac around it.
- Small dints and cracks along side of the path before the drive of where No.34 starts.

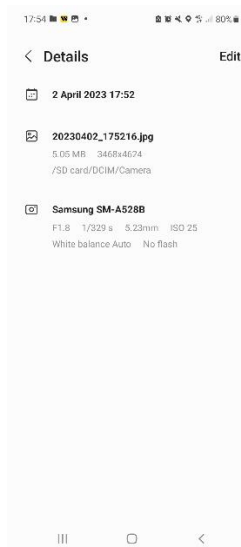




Photo 2

02/04/2023 | 17:52

A larger overview of the road, giving a better insight to the area with the property in question included.

Notes:

- Shows a chipped curb where the white squares are located.
- Near the bottom of the photo, it shows evident cracks in the road leading further into the road.
- The right bottom side of the photo shows dips in the path.



Photo 3

02/04/2023 | 17:52

A close up image of the front of the property's drive/path.

Notes:

- The image is showing exactly how many white concrete slabs there are, which is 9.
- Next to the first two out of three slabs on the left side there is a square of a different colour of tarmac which is covering a slight dip in the path.
- White discolouration right next to the curb.

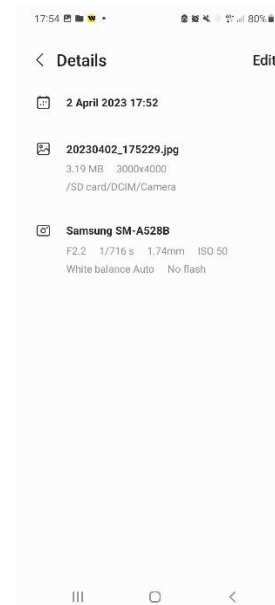




Photo 4

02/04/2023 | 17:52

The photo has been taken from the opposite traffic side to the ones listed above.

- The photo shows existing cracks and small dints to the pavement on the left hand side.
- The curb is dropped and raised where the white slabs are further up the path.
- The left side, at the bottom of the image, it shows existing cracks on the road where the tarmac and stone meets the curb.

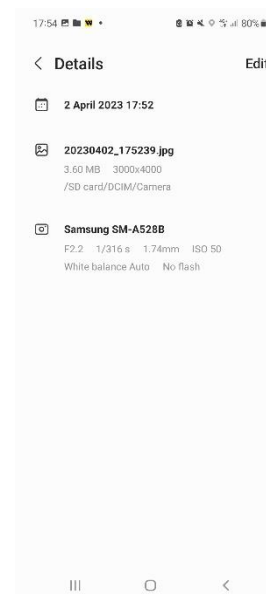


Photo 5

02/04/2023 | 17:52

The image is showing the opposite side of the road, facing out from No.34, it is zoomed out and shows a bigger image of the road condition.

- The image shows significant cracks and uneven pavement.
- Next to the curb on the left side, there is cracks lining through the road adjacent to the curb.
- Overall the pavement appears uneven and has a lot of loose tarmac residue on top of it.



Plan showing location of where the photos were taken:

