

ARBORICULTURAL STATEMENT
ON
A PROPOSED DEVELOPMENT
AT
EARL STREET, PRESTWICH, M25 1GQ

ON BEHALF OF
DREAM HOMES CONSTRUCTION

Author: T. Baron

Our Ref: CW/9803-AS

Date: 19 April 2021

Copyright © 2021 Cheshire Woodlands Limited. All rights reserved

CONTENTS

- 1.** Summary
- 2.** Terms of Reference
- 3.** Introduction
- 4.** The Application Site
- 5.** Statutory Protection
- 6.** Survey Methodology
- 7.** The Trees
- 8.** Arboricultural Implications
- 9.** Conclusions
- 10.** Recommendations

APPENDICES

- 1.** Tree Survey Schedule CW/9803-SS-1
- 2.** Tree Protection Plan CW/9803-P-TP
- 3.** Guidance Note – Visual Prominence and Retention Values
- 4.** Guidance Note - Statutory Controls
- 5.** Glossary of Terms

1. SUMMARY

- 1.1.** Planning approval is sought for demolition of existing structures and erection of thirty-six residential units and associated works at Earl Street in Prestwich.
- 1.1.** Trees on and adjacent to the site have been assessed and the arboricultural impacts of the development proposal evaluated in accordance with current best practice.
- 1.2.** Several trees will be removed to accommodate the development and replaced with new landscaping more in keeping with the proposed residential context.
- 1.3.** Details for protection of the retained trees during demolition and construction are included with this statement as a tree protection plan and arboricultural method statement.
- 1.4.** Pruning of some of the retained trees complies with current best practice and will not harm their health or visual quality.

2. TERMS OF REFERENCE

2.1. Instruction

2.1.1. Cheshire Woodlands is instructed by Dream Homes Construction to:

- Survey and prepare a schedule of trees to comply with the general requirements of BS5837¹
- Annotate a topographical survey drawing and produce a tree survey plan
- Appraise a development proposal in relation to trees and produce an arboricultural statement and tree protection plan

2.2. Limitations

2.2.1. This statement and associated documents are the copyright of Cheshire Woodlands Limited and there should be no transfer of rights to any third party without express written consent.

2.2.2. The purpose of the assessment is to collect data to inform the design of a development proposal in relation to trees.

2.2.3. Trees are assessed in sufficient detail to inform the current project and appraisal of their structural condition is of a preliminary nature.

2.2.4. Trees are assessed from ground level without invasive investigation and are viewed from within the site or from areas with public access. Assessment may be restricted where site conditions limit access or where trees are wholly or partially off-site or obscured by vegetation. The disclosure of hidden defects cannot be expected.

2.2.5. Whilst the Tree Survey Schedule at Appendix 1 (the Schedule) is not a tree safety inspection record, the surveyor may record obvious defects when they are observed and considered to be potentially significant to safety.

2.2.6. Data in the Schedule are time limited to one year, after which they should be reviewed.

¹ British Standard 5837:2012 *Trees in relation to design, demolition and construction – Recommendations*

- 2.2.7.** The potential effects of trees on load-bearing soils beneath existing and proposed structures have not been considered and no soil samples have been taken.

3. INTRODUCTION

- 3.1.** I am Tom Baron, arboricultural surveyor with Cheshire Woodlands Limited and my areas of expertise are arboriculture and forestry.
- 3.2.** This assessment evaluates the effects of a development proposal on trees.
- 3.3.** The development comprises removal of existing structures and erection of thirty-six dwellings and associated works, as shown on the Tree Protection Plan at Appendix 2 (the Drawing).
- 3.4.** The following documents have been considered in my evaluation:
- Topographical survey drawing - RBS-19-1577-001
 - Proposed site plan - 14,347 Earl Street
 - Tree Survey Plan – CW/9803-P-TS
 - Preliminary Tree Survey Schedule – CW/9803-SS
- 3.5.** The comparative values of trees are considered broadly in line with the guidance of BS5837, and their removal, retention, protection and management are informed by this evaluation.
- 3.6.** Technical terms used in this Statement are included in the Glossary of Terms.
- 3.7.** This Statement provides sufficient supporting information to enable the local planning authority (LPA) to determine the planning application insofar as it relates to trees.

4. THE APPLICATION SITE

- 4.1.** The site is a 0.4 hectare level vacant plot on the site of a former children's' nursery. It comprises structures and mounded spoil with trees to the northern and southern boundaries. The site is bounded by a railway line to the north, residential properties to the east and south, and Earl Street to the west.
- 4.2.** The British Geological Survey - Geology of Britain Viewer² identifies the underlying soils as 'Hummocky (moundy) Glacial Deposits, Devensian - Sand and Gravel'. Sands and Gravels are accumulations of rock fragments and mineral grains derived from the weathering and erosion of hard rocks by glacial and river action. Trees growing on free-draining sandy soils have a tendency to develop deep and diffuse rooting, are usually less reliant on roots growing within the upper horizons and are less sensitive to changes to the upper soils than trees growing on cohesive clay or alluvial soils.

5. STATUTORY PROTECTION

- 5.1.** An online search of Bury Council's interactive mapping facility³ confirmed that:
- Trees on and adjacent to the site are protected by Bury Council's Tree Preservation Orders (TPO) No. 352 – Land East of Earl Street, Prestwich (2020) and No. 347 – Land Adjacent to the Northern Boundary of 3 Whittaker Close, Prestwich (2019). Both TPOs are referenced in the 'comments' column of the Schedule; and
 - The site is not in a conservation area
- 5.2.** Trees on the site are subject to the provisions of The Forestry Act⁴. There is an outstanding Forestry Commission re-stocking notice, which requires the centre of the site to be re-planted, or the stumps left to re-grow. An objection to the notice has been lodged and is still to be determined.

² [Geology of Britain viewer](#)

³ [Bury Council Mapping](#)

⁴ *The Forestry Act 1967* (as amended)

- 5.3.** See Appendix 4 for further guidance on the statutory protection of trees, hedgerows and wildlife.

6. SURVEY METHODOLOGY

- 6.1.** I surveyed the trees on 24 July 2020 and my data are set out in the Schedule) and on the Drawing.
- 6.2.** I measured stem diameters and canopy spreads using a tape and tree heights using a tape and clinometer. Where dimensions are estimated this is identified in the Schedule.
- 6.3.** I assessed the trees for 'visual prominence' and broadly categorised them in accordance with Table 1 of BS5837. See Appendix 3 for further guidance.
- 6.4.** During the survey, I carried out a brief assessment for obvious signs of wildlife habitat in trees and hedges on the site. Any wildlife habitats of potential significance identified during the survey will be described in the 'comments' column of the Schedule. See Appendix 4 for further guidance.
- 6.5.** The topographical survey overlaid with the proposed site plan is the base for the Drawing.
- 6.6.** Below-ground arboricultural constraints are represented on the Drawing as Root Protection Areas (RPA), calculated in accordance with section 4.6 and Table D.1 of BS5837.
- 6.7.** Potential direct obstruction of sunlight by trees is represented on the Drawing as illustrative shadow patterns, plotted in accordance with section 5.2.2 (Note 1) of BS5837. These indicate the trees' shadow patterns through the main part of the day.

7. THE TREES

- 7.1.** I assessed twelve individual trees (T1 to T12), seven tree groups (G1 to G7) and one area of trees (A1).
- 7.2.** T5, T6, T8, G2 and G3 are off-site. T1 to T4, T7, T9 to T12, G1, G4 to G7 and A1 are within the site or on the boundaries.
- 7.3.** T9, T12 and G2 are 'high quality' A category trees. T1, T4, T5, T7, T8 and G7 are 'moderate quality' B category. T6, T10, T11, G1, G3, G5, G6 and A1 are 'low quality' C category. T2, T3 and G4 are 'unsuitable' U category.
- 7.4.** T1, T7, T9, T11, T12, G2 and G6 are protected by TPO.

8. ARBORICULTURAL IMPLICATIONS

8.1. BS5837 recommends that trees be evaluated and categorised as set out in Table 1, which also provides a summary of the impact of the development proposal on trees.

8.2. Table 1

	To be retained and protected	To be removed for development	To be removed for other reasons
Category A High quality with life expectancy of at least 40 years	Group G2	Trees T9 and T12	None
Category B Moderate quality with life expectancy of at least 20 years	Trees T1, T5 and T8	Trees T4 and T7, and group G7	None
Category C Low quality with life expectancy of at least 10 years, or small young trees	Trees T6, T10 and T11, and groups G1, G3 and G5	Group G6 and area A1	None
Category U Cannot be retained in the context of the current land-use for longer than 10 years	None	None	Trees T2 and T3, and group G4
Hedges and Shrubs	None	None	None

8.3. Trees to be removed

8.3.1. Removal of T2, T3 and G4 is recommended as appropriate arboricultural management, irrespective of the development.

8.3.2. T4, T7, T9, T12, G6, G7 and A1 will be removed to accommodate the development.

8.4. Trees to be retained

8.4.1. T1, T5, T6, T8, T10, T11, G1, G2, G3 and G5 will be retained and details for their protection during demolition and construction are included on the Drawing. The protection methodology comprises:

- Erection of tree protection barriers to create construction exclusion zones;
- Supervised removal of existing structures with the RPAs of T1 and G2;
- Installation of temporary ground protection to provide construction access within the RPAs of T1, T8 and G2; and
- The use of specially-engineered foundations and installation of new permanent hard surfaces within the RPAs of G2.

8.4.2. The residual engineering and drainage details can be resolved by the imposition of suitably worded planning conditions.

8.5. Pruning

8.5.1. T1, T11 and G2 will be pruned to provide working space and enhance their spatial relationship with the new houses and gardens. The proposed pruning works are in accordance with BS3998⁵.

8.6. Mitigation

8.6.1. The arboricultural mitigation will comprise the provision of new trees and landscaping – as shown illustratively on the proposed site plan - with details to be resolved by planning condition.

⁵ British Standard BS3998:2010 *Tree work - Recommendations*

9. CONCLUSIONS

- 9.1.** Removal of the 'unsuitable' U category trees T2, T3 and G4 is recommended as appropriate arboricultural management irrespective of the development.
- 9.2.** The 'high', 'moderate' and 'low quality' trees T4, T7, T9, T12, G6, G7 and A1 will be removed to accommodate the development and replaced with new trees and landscaping better suited to the proposed residential context.
- 9.3.** The 'high', 'moderate' and 'low quality' trees T1, T5, T6, T8, T10, T11, G1, G2, G3 and G5 will be retained, and details for their protection during demolition and construction are included on the Drawing.
- 9.4.** Pruning of T1, T11 and G2 accords with BS3998 and will not materially harm their health or visual quality.
- 9.5.** The residual engineering, drainage and landscaping details can be resolved by planning condition.

10. RECOMMENDATIONS

- 10.1.** No tree pruning or removal work should be carried out until the requisite consents have been obtained from the LPA, either in respect of the TPOs or as part of a detailed planning permission.
- 10.2.** All tree pruning and removal work should be implemented in accordance with the management recommendations in the Schedule and in compliance with BS3998.
- 10.3.** Statutory protection of wildlife should be considered in the planning and implementation of the tree pruning and removal works.
- 10.4.** All retained trees should be protected during demolition and construction in accordance with the Tree Protection Plan and Arboricultural Method Statement at Appendix 2.

- 10.5.** The existing structures identified by blue dashed-lines on the Drawing should be carefully dismantled under the supervision of a competent arboriculturist. The existing foundations should be retained.
- 10.6.** The areas of ground identified by blue diagonal-hatching on the Drawing should be covered by 'temporary ground protection' for the duration of the demolition and construction works.
- 10.7.** The specially-engineered foundations identified by green block-hatching on the Drawing should be installed to an engineer-designed construction specification and method statement to be agreed with the LPA and in accordance with section 7.5 of BS5837.
- 10.8.** The new permanent hard surfaces identified by orange cross-hatching on the Drawing should be installed to an engineer-designed construction specification and method statement to be agreed with the LPA and in accordance with section 7.4 of BS5837.
- 10.9.** New underground services should be installed in accordance with a scheme of work to be agreed with the LPA and in accordance with BS5837 and NJUG Volume 4⁶.
- 10.10.** Landscaping should be implemented in accordance with a scheme of work to be agreed with the LPA and in accordance with the Arboricultural Method Statement on the Drawing.
- 10.11.** Foundation design should take into consideration the juxtaposition of existing and proposed trees and the nature of the load-bearing soil.

⁶ NJUG Volume 4. 2007. *NJUG Guidelines for the Planning, Installation and Maintenance of Utility Apparatus in Proximity to Trees*. National Joint Utilities Group

APPENDIX 1

TREE SURVEY SCHEDULE

PROJECT: EARL STREET, PRESTWICH, M25 1GQ
CLIENT: DREAM HOMES CONSTRUCTION LIMITED
REF: CW/9803-SS-1
REVISIONS: 22 APRIL 2021

SURVEYED BY: T. BARON
DATE: 24 JULY 2020
PAGE: 1

No.	Species	Age Range	Height (m)	Crown Spread (m)	Stem Dia. (mm)	Vitality	Comments	Management	Visual	Retention Value Existing	Retention Value Proposed	BS5837 RPA Radius (m)
T1	Sycamore	EM	15	12	500	N	- Located on site boundary - Epicormic shoots to base - Overhanging building on northeast side with 3m vertical branch clearance - Relatively poor relationship with adjacent dwellings T1 of Bury Council's Tree Preservation Order (TPO) 352 – Land east of Earl Street, Prestwich (2020)	- Retain and protect during development - Prune on east side to reduce lateral spread by up to 2m	2	B	B	6.0

Data in this schedule are time limited and subject to limitations described elsewhere.

HEADINGS & ABBREVIATIONS

Age Range Y = young SM = semi-mature EM = early-mature M = mature PM = post-mature V = veteran
Stem Dia Stem diameter (measured in accordance with Figure C.1 of BS5837: 2012) (MS = multi-stemmed EST = estimated)
Crown Spread Maximum crown spread (EST = estimated)
Vitality A measure of physiological condition. N = normal range for the species and age R = reduced, P = poor, MD = moribund, D = dead
Visual (Visual Prominence) Broad indication of prominence in the landscape (1 = low up to 4 = very high) (G = contributes to a wider group)
Retention Category Existing Broadly in accordance with Table 1 of BS5837: 2012 (considers the merits of the tree or group in the context of the existing land-use)
Retention Category Proposed Broadly in accordance with Table 1 of BS5837: 2012 (considers the merits of the tree or group in the context of a development proposal)
BS5837 RPA Radius Calculated in accordance with Table D.1 of BS5837: 2012
Common Plant names Only common names are used in this schedule. For scientific names refer to Mitchell, A. 2001. *Collins Field Guide – Trees of Britain & Northern Europe*. Harper Collins, London. pp. 420.

Copyright © 2021 Cheshire Woodlands Limited. All rights reserved

TREE SURVEY SCHEDULE

PROJECT: EARL STREET, PRESTWICH, M25 1GQ
CLIENT: DREAM HOMES CONSTRUCTION LIMITED
REF: CW/9803-SS-1

SURVEYED BY: T. BARON
DATE: 24 JULY 2020
PAGE: 2

No.	Species	Age Range	Height (m)	Crown Spread (m)	Stem Dia. (mm)	Vitality	Comments	Management	Visual	Retention Value Existing	Retention Value Proposed	BS5837 RPA Radius (m)
T2	Ash	SM	12	6	175	N	- Leaning to northeast with a split at the lower stem - Not suited to long-term retention	- Fell to ground level - Grub out/grind stump to a depth of 0.3m	1	U	U	N/A
T3	Hawthorn	M	7	6	200 (MS)	P	Multi-stemmed tree with cavities and wounds to stems	- Fell to ground level - Grub out/grind stump to a depth of 0.3m	1	U	U	N/A

TREE SURVEY SCHEDULE

PROJECT: EARL STREET, PRESTWICH, M25 1GQ
CLIENT: DREAM HOMES CONSTRUCTION LIMITED
REF: CW/9803-SS-1

SURVEYED BY: T. BARON
DATE: 24 JULY 2020
PAGE: 3

No.	Species	Age Range	Height (m)	Crown Spread (m)	Stem Dia. (mm)	Vitality	Comments	Management	Visual	Retention Value Existing	Retention Value Proposed	BS583 7 RPA Radius (m)
T4	Ash	SM	14	6	200	N	Base of stem restricted by dense vegetation	- Fell to ground level - Grub out/grind stump to a depth of 0.3m	2	B	U	N/A
T5	Cherry	EM	15 (EST)	12 (EST)	500 (MS, EST)	R	- Off-site and not assessed in detail - Sparse crown and signs of decline	Protect during development	2	B	B	6.0 (EST)
T6	Goat willow	SM	12	10	300 (MS, EST)	N	- Off-site and not assessed in detail - Appears to have multiple stems - Crown on south side overhanging ancillary building with branches in contact	Protect during development	2	C	C	3.6 (EST)
T7	Sycamore	EM	15	15	475	N	- Co-dominant stems at 5m with included-bark unions of stems and branches - Ground clearance into the site at 2m which could be raised to 6-7m by removal of sub-lateral branches and epicormic shoots - Telecommunication wires running through crown on east side 3m vertical clearance above existing ancillary building T7 of Bury Council's Tree Preservation Order (TPO) 352 – Land east of Earl Street, Prestwich (2020)	- Fell to ground level - Grub out/grind stump to a depth of 0.3m	2	B	U	N/A
T8	Sycamore	EM	17 (EST)	11 (EST)	600 (EST)	N	- Off-site tree which forks at 4m - Included-bark unions of stems and branches - Pruned in past to clear adjacent building and telecommunication wires	Protect during development	3	B	B	7.2 (EST)

TREE SURVEY SCHEDULE

PROJECT: EARL STREET, PRESTWICH, M25 1GQ
CLIENT: DREAM HOMES CONSTRUCTION LIMITED
REF: CW/9803-SS-1

SURVEYED BY: T. BARON
DATE: 24 JULY 2020
PAGE: 4

No.	Species	Age Range	Height (m)	Crown Spread (m)	Stem Dia. (mm)	Vitality	Comments	Management	Visual	Retention Value Existing	Retention Value Proposed	BS5837 RPA Radius (m)
T9	Beech	M	20	21	1100	R	- Chain-link fence ingrown to stem, which is leaning to the southeast - Ground clearance over access down to 3m which could be raised to 6m by removal of low sub-lateral branches - Reduced vitality on the west side of the crown with dead branches of up to 50mm dia., perhaps a result of damage when the access was constructed T1 of Bury Council's Tree Preservation Order (TPO) 347 – On land adjacent to the northern boundary of 3 Whittaker Close, Prestwich (2019)	- Fell to ground level - Grub out/grind stump to a depth of 0.3m	3	A	U	N/A
T10	Beech	Y	3	3	75	N		Retain and protect during development	1	C	C	0.9
T11	Sycamore	EM	15	10 (EST)	400	N	- Pruned in past to remove low branches - Dead branches and dead stubs within crown T2 of Bury Council's Tree Preservation Order (TPO) 347 – On land adjacent to the northern boundary of 3 Whittaker Close, Prestwich (2019)	- Retain and protect during development - Prune on north side to reduce lateral spread by up to 2m	2	C	C	4.8
T12	Sycamore	EM	16	18 (EST)	650	N	- Stem forks at 5m - Large wound from ground level to 2.5m on west side with good adaptive growth - Crown bias to east - Birds nest in crown - Dead branches overhanging edge of the access T3 of Bury Council's Tree Preservation Order (TPO) 347 – On land adjacent to the northern boundary of 3 Whittaker Close, Prestwich (2019)	- Fell to ground level - Grub out/grind stump to a depth of 0.3m	3	A	U	N/A
G1	Leyland cypress	SM	≤5	≤5	≤200 (EST)	N	Two off-site stems providing boundary screening	Protect during development	2	C	C	≤2.4 (EST)

TREE SURVEY SCHEDULE

PROJECT: EARL STREET, PRESTWICH, M25 1GQ
CLIENT: DREAM HOMES CONSTRUCTION LIMITED
REF: CW/9803-SS-1

SURVEYED BY: T. BARON
DATE: 24 JULY 2020
PAGE: 5

No.	Species	Age Range	Height (m)	Crown Spread (m)	Stem Dia. (mm)	Vitality	Comments	Management	Visual	Retention Value Existing	Retention Value Proposed	BS583 7 RPA Radius (m)
G2	Norway maple Horse chestnut Wild service tree Cherry Ash Sycamore	Y-M	≤20	≤18	≤1200	N-D	- Off-site trees on adjacent railway line, with restricted access and limited inspections - Overhanging into the site by up to 8m, with branches in contact with ancillary buildings - Ground clearance down to ground level in places and could be raised to achieve 4-5m by removal of lateral and sub-lateral branches of larger trees, and hard pruning in young ones - Would benefit from management - Included-bark unions of stems, which require monitoring - Ivy to stems of most of the mature trees Trees T2 to T6 of Bury Council's Tree Preservation Order (TPO) 352 – Land east of Earl Street, Prestwich (2020)	- Protect during development - Prune on south side to reduce lateral spread by up to 2m and provide 4m ground clearance	3	A	A	≤14.0
G3	Sycamore Ivy Apple	Y-SM	≤6	≤4	≤150 (EST)	N	- Off-site and not assessed in detail - Overhanging site on west side by up to 2m	- Protect during development - Prune back to boundary	2	C	C	≤1.8 (EST)
G4	Elder Hawthorn	EM	≤4	≤5	≤175 (MS)	R & P	Poor quality group suppressed by adjacent larger tree	- Remove for development - Grub out/grind stumps to a depth of 0.3m	1	U	U	N/A
G5	Hawthorn Elder Sycamore	M	≤6	≤4	≤150 (MS)	N & P	Stem defects on all trees with poor health of the hawthorn	Retain and protect during development	1	C/U	C	≤1.8
G6	2 Norway maple	SM/EM	≤14	≤10	≤300	N	- Overall small and bias crowns due to suppression from adjacent mature trees - Epicormic shoots to bases of stems - Branches overhanging and in contact with building to south Trees T4 and T5 of Bury Council's Tree Preservation Order (TPO) 347 – On land adjacent to the northern boundary of 3 Whittaker Close, Prestwich (2019)	- Remove for development - Grub out/grind stumps to a depth of 0.3m	1	C	U	N/A
G7	2 Sycamore	EM	≤15 (EST)	≤12 (EST)	≤500 (EST)	N	- Appear to be off-site - Access restricted leading to a limited assessment - Overhanging into the site over main building with branches in contact	- Remove for development - Grub out/grind stumps to a depth of 0.3m	2	B	U	N/A

TREE SURVEY SCHEDULE

PROJECT: EARL STREET, PRESTWICH, M25 1GQ
CLIENT: DREAM HOMES CONSTRUCTION LIMITED
REF: CW/9803-SS-1

SURVEYED BY: T. BARON
DATE: 24 JULY 2020

PAGE: 6

No.	Species	Age Range	Height (m)	Crown Spread (m)	Stem Dia. (mm)	Vitality	Comments	Management	Visual	Retention Value Existing	Retention Value Proposed	BS5837 RPA Radius (m)
A1	Goat willow Sycamore Elder Norway maple Mixed shrubs	Y	≤4	≤4	N/A	N	- A mixture of natural regeneration and growth from stumps of felled trees - Waste material piled on ground	- Remove for development - Grub out/grind stumps to a depth of 0.3m	1	C	U	N/A

APPENDIX 2

ARBORICULTURAL METHOD STATEMENT

From commencement of the development, the following methodology shall be implemented in the manner and sequence described below

SEQUENCE OF WORKS

1. Pre-commencement site meeting
2. Tree removal and pruning
3. Erection of 'tree protection barriers' and installation of 'temporary ground protection'
4. Demolition
5. Main construction phase
6. Removal of 'tree protection barriers' and 'temporary ground protection'
7. Landscaping works including construction of new hard surfacing and erection of fencing

1. PRE-COMMENCEMENT SITE MEETING

To outline working methods in relation to trees, a site meeting of the following shall take place prior to commencement of any demolition or construction activity:

- Client
- Structural engineer
- Demolition contractor
- Main contractor
- Site agent
- Project arboriculturist

Before the site meeting, existing incoming services and drainage shall be accurately located both on site and on a copy of this drawing

2. TREE REMOVAL AND PRUNING

- a. All tree removal and pruning work shall be implemented in accordance with Tree Survey Schedule CW/9803-SS-1 and this drawing
- b. All reasonable care shall be taken to avoid damage to retained trees
- c. All tree stumps within any area designated as a 'tree protection area' or otherwise protected on this drawing shall be removed by mechanical stump grinder and shall not be excavated in their entirety by mechanical excavator
- d. All tree removal and pruning works shall be carried out in compliance with BS3998

3. ERECTION OF TREE PROTECTION BARRIERS AND INSTALLATION OF TEMPORARY GROUND PROTECTION

- a. The main contractor shall erect 'tree protection barriers' and install 'temporary ground protection' as detailed on this drawing
- b. The 'project arboriculturist' shall inspect installation of the 'tree protection barriers' and 'temporary ground protection' prior to commencement of any demolition or construction works, site preparation, excavation or delivery of plant and materials

4. DEMOLITION

- a. Prior to commencing work on site, the demolition contractor shall produce a method statement, which will set out working methods in relation to the protection of retained trees
- b. The areas of existing unsurfaced ground identified by blue diagonal-hatching on this drawing shall be covered by 'temporary ground protection' for the duration of the demolition and main construction phases
- c. The structure identified by blue dash-lines to the northwest corner of the site shall be demolished under supervision from the 'project arboriculturist'. The foundations of the structure shall be retained to protect the underlying roots and soils
- d. Plant and machinery shall be of a size and design appropriate to operation within the constraints imposed by adjacent trees
- e. No fires shall be lit within 20m of any tree
- f. Plant and equipment shall be neither stored nor refueled within 10m of any area designated as a 'tree protection area' or otherwise protected on this drawing
- g. There shall be no excavation within 300mm of a 'tree protection barrier'
- h. The integrity of the 'tree protection barriers' and 'temporary ground protection' shall be maintained for the duration of the demolition operations
- i. Any damage occurring to 'tree protection barriers' or 'temporary ground protection' during demolition operations shall be reported to the 'project arboriculturist' and immediately made good by the main contractor

5. MAIN CONSTRUCTION PHASE

- a. There shall be no storage of construction equipment, plant or materials within any area designated as a 'tree protection area' or otherwise protected on this drawing
- b. The building sections identified by light-green block-hatching on this drawing shall be built to an engineer-designed specification, in accordance with section 7.5 of BS5837 and to be agreed by the LPA
- c. No fires shall be lit within 20m of any retained tree or hedge
- d. The site agent shall supervise all deliveries by self-loading crane, with vehicles positioned in such a manner that retained trees and hedges are not at undue risk of damage
- e. There shall be no excavation within 300mm of a 'tree protection barrier'
- f. There shall be no new excavation for the installation, renewal or repair of underground services within any area designated as a 'tree protection area' or otherwise protected on this drawing
- g. The integrity of the 'tree protection barriers' and 'temporary ground protection' shall be maintained for the duration of the main construction phase
- h. Any damage occurring to 'tree protection barriers' or 'temporary ground protection' during the main construction phase shall be reported to the project arboriculturist and immediately made good by the main contractor
- i. Site drainage and washings from concrete and mortar mixings shall be directed away from all 'tree protection areas'
- j. The 'project arboriculturist' shall visit the site monthly to assess the integrity of the tree protection
- k. The 'project arboriculturist' shall complete a report to be sent to the site owner and main contractor following each visit. In this regard, the site owner will instruct the 'project arboriculturist' prior to any works commencing on site

6. REMOVAL OF TREE PROTECTION BARRIERS AND TEMPORARY GROUND PROTECTION

'Tree protection barriers' and 'temporary ground protection' shall be removed only on completion of construction works and in compliance with all relevant planning conditions

7. LANDSCAPING WORKS INCLUDING CONSTRUCTION OF NEW HARD SURFACING AND ERECTION OF FENCING

- a. Landscaping works shall be implemented in accordance with a scheme approved by the LPA
- b. There shall be no rotovation of ground within any area designated as a 'tree protection area' or otherwise protected on this drawing
- c. Sandy topsoil may be spread within the 'tree protection areas' to a depth of not more than 150mm to facilitate the establishment of new vegetation. No other addition of soil or other material shall be carried out within any area designated as a 'tree protection area' or otherwise protected on this drawing without prior consultation with the Local Planning Authority
- d. No hard landscaping works or excavation for cables or any other service shall be carried out within the 'tree protection area' without the prior written consent of the LPA. All such excavations shall be carried out in accordance with the guidance set out in National Joint Utilities Group Guidelines for the Planning, Installation and Maintenance of Utility Apparatus in Proximity to Trees (Volume 4 2007)
- e. The areas of new hard surfacing identified by orange cross-hatching on this drawing shall be constructed over the existing ground without excavation other than the removal, by hand, using hand tools, under the supervision of the 'project arboriculturist' of either (i) surface vegetation and minor (<100mm high) surface irregularities or loose soil to a depth of not more than 100mm or (ii) existing hardstanding and sub-base aggregate layer, without excavation of the underlying soils. Any excavation of ground within the orange cross-hatched areas shall be carried out in accordance with section 7.2 of BS58378.
- f. The new surfacing in the orange cross-hatched areas shall be constructed using the 'Cellweb' 3-dimensional cellular confinement system (or equivalent)
- g. All aggregates used in the construction shall be no-fines, crushed gritstone or sandstone. **Limestone shall not be used**
- h. The wearing surface shall be of a material agreed with the LPA. The construction shall be to an engineer designed specification and method statement agreed with the LPA, and in compliance with section 7.4 of BS5837. The specification shall include details of existing and proposed ground levels, depth of construction and final surface levels
- i. Edge restraints shall be constructed from pressure treated timber boards secured to timber posts, or other means to be agreed with the LPA. In the installation of edge restraints, there shall be no excavation of ground other than as described at a. above.
- j. Final surface levels adjacent to the 'reduced dig' sections of hard surfacing shall be dictated by final surface levels of the 'reduced-dig' section, and not vice-versa
- k. Sections of new boundary fence that extend into the 'root protection area' of any retained tree will be constructed during the landscaping works
- l. The alignment of the sections of boundary fence that extend into the 'root protection area' of any retained tree shall be marked out on the ground by the 'project arboriculturist'. New boundary fences shall be located so as to avoid unnecessary removal of trees and minimize pruning of trees and excavation of ground within 'root protection areas'
- m. Any pruning needed to accommodate new fences shall be the minimum required to install the new fences and shall be carried out in accordance with BS3998
- n. In the installation of the new fences there shall be no raising or lowering of existing ground other than to accommodate post-holes and foundations
- o. Post-holes and foundations shall be excavated by hand, using hand tools. All roots greater than 25mm diameter shall be retained with post-holes or foundations re-located if roots greater than 25mm diameter are encountered. Clumps of smaller roots (including fibrous roots) shall also be retained and worked around
- p. No fixing shall be made to any retained tree

TREE PROTECTION SPECIFICATION

Tree Protection Areas shall:-

1. Be secured prior to commencement of any demolition or construction works, delivery of site accommodation or materials and shall remain intact for the duration of the demolition and construction works
2. Preclude all demolition and construction activity with the exception of specified arboricultural works and such works as have been agreed by all parties and to be carried out under supervision
3. Be protected by 'tree protection barriers' and other measures as specified on this drawing
4. Preclude the storage or tipping of all materials and substances. Toxic substances such as fuels, oils, additives and cement shall not be stored within 5m of any area designated as a 'tree protection area' or otherwise protected on this drawing
5. Any incursion into 'tree protection areas' must be by prior arrangement, following consultation with the Local Planning Authority



Tree Protection Barriers

1. The tree protection barriers shall comprise 2.4m high, 1.2m wide, 18mm thick exterior grade softwood plywood boards (or oriental strand board)
2. A timber framework shall be constructed comprising 3m long by 100mm by 100mm timber posts, concreted into 600mm deep, 200mm diameter augured holes at maximum 3.6m centres. Two horizontal cross rails, 100 x 50mm shall be securely fixed to each upright at 0.5m and 1.9m above ground level
3. The fencing boards shall butt together and be securely fixed to the timber framework
4. No fixing shall be made to any tree and all reasonable care shall be taken to avoid damage to tree roots when locating posts
5. An A3 warning sign reading as per figure 1 shall be fixed to every 10m of 'tree protection barrier'
6. The 'project arboriculturist' shall direct erection of the 'tree protection barriers'

Temporary Ground Protection

The areas of ground identified for 'temporary ground protection' on this drawing shall be covered by side-butting scaffold boards on top of a 100mm deep layer of wood chippings laid over a geotextile membrane, or supported on scaffold board bearers, which shall be fixed at 1m centres (pedestrian access only)

Fig 1

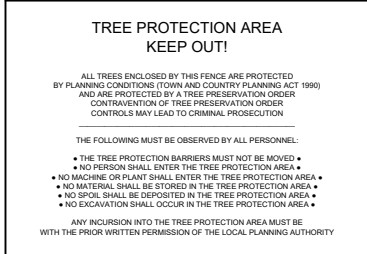

TREE PROTECTION PLAN	
CHESHIRE WOODLANDS ARBORICULTURAL CONSULTANCY	
9 LOWE STREET MACCLESFIELD CHESHIRE SK11 7NJ	T. +44(0)1625 669668 E. admin@cheshire-woodlands.co.uk W. www.cheshire-woodlands.co.uk
CLIENT	DREAM HOMES CONSTRUCTION LIMITED
PROJECT	EARL STREET PRESTWICH M25 1GQ
JOB REF	CW/9803-P-TP
DATE	19 APRIL 2021
SCALE	1:200 at A1
SITE BOUNDARY PROPOSED DWELLINGS, HARD SURFACES AND LANDSCAPING (Drawing 14,347 East Street) SUPERVISED DEMOLITION OF STRUCTURE INDIVIDUAL TREE TO BE RETAINED GROUP OF TREES TO BE RETAINED TREE, GROUP OR AREA TO BE REMOVED TREE PROTECTED BY TPO STEM POSITION APPROXIMATED BS 5837 RETENTION VALUE BS5837 ROOT PROTECTION AREA RADIUS BS5837 SHADOW PATTERN BS5837 CATEGORY 'A' TREES BS5837 CATEGORY 'B' TREES BS5837 CATEGORY 'C' TREES BS5837 CATEGORY 'U' TREES PROPOSED ENGINEER-DESIGNED STRUCTURE (BS5837) TEMPORARY GROUND PROTECTION (EXISTING UNSURFACED GROUND) (BS5837) PROPOSED ENGINEER-DESIGNED HARD SURFACE (BS5837) TREE PROTECTION AREA TREE PROTECTION BARRIER (BS5837)	

APPENDIX 3

Guidance Note - Visual Prominence and Tree Categorisation

Visual Prominence

A broad indication of visual contribution to the landscape. The evaluation considers:

- location
- public views
- landscape function
- tree size
- growth potential
- useful life expectancy

Visual prominence values are classified as follows:

- (1)** Low - visual contribution restricted to the site
- (2)** Moderate - visual contribution to the site and immediate surroundings
- (3)** High - visual contribution to the site, immediate surroundings and neighbourhood, estate or locale
- (4)** Very high - visual contribution to a conurbation, or trees of exceptional landscape value

Groups of trees are assessed as a single unit.

Tree Categorisation

Broadly in accordance with section 4.5 and Table 1 of British Standard 5837:2012 Trees in relation to design, demolition and construction – Recommendations.

Trees or groups of trees are evaluated twice. Firstly, they are assessed and categorised in the pre-development context to provide a broad valuation of all of their attributes and their contribution to the amenity of the area. Secondly, they are similarly assessed and categorised in the context of a development proposal. The evaluations consider:

- useful life expectancy
- visual prominence (see above)
- landscape function
- numbers of other trees and their maturity (continuity for landscape, amenity, habitat)
- wildlife habitats (including continuity)
- safety
- conflicts with the built environment or other land-use
- cultural, historical or other value

Groups of trees are assessed and categorised as a single unit.

Pre-Development assessment

The tree or group of trees is assessed and placed into one of the following categories (A, B, C or U)

The valuation considers the benefits and disbenefits of retaining the tree or group of trees in the pre-development context

Any specific issues are noted in the tree survey schedule

(A) High quality - Trees the retention of which is most desirable and that have an estimated useful life expectancy of at least 40 years

Wholly appropriate and without significant conflict

(B) Moderate quality - Trees the retention of which is desirable and that have an estimated useful life expectancy of at least 20 years

Appropriate but not of highest value

(C) Low quality - Trees that could be retained and have an estimated useful life expectancy of at least 10 years

Ill-suited but could be retained with moderate conflicts

Trees of no particular merit

(U) Trees unsuitable for retention

Could not reasonably be retained for longer than 10 years

Post-Development assessment

The tree or group of trees is assessed and placed in one of the following categories (A, B, C or U)

The valuation considers the benefits and disbenefits of retaining the tree or group of trees in the context of a development proposal

Any specific issues are noted in the tree survey schedule.

(A) High quality - Trees the retention of which is most desirable and that have an estimated useful life expectancy of at least 40 years

Wholly appropriate and without significant conflict

(B) Moderate quality - Trees the retention of which is desirable and that have an estimated useful life expectancy of at least 20 years

Appropriate but not of highest value and/or having only minor conflicts

(C) Low quality - Trees which could be retained and have an estimated useful life expectancy of at least 10 years

Ill-suited but could be retained with moderate conflicts

Trees of no particular merit

(U) Trees for removal

Would need to be removed to accommodate the development proposal, or could not reasonably be retained for longer than 10 years

APPENDIX 4

Guidance note - Statutory Controls

Trees and Hedges

Subject to specified exceptions, an application must be made to the local planning authority [LPA] to carry out work on or remove trees that are protected by a tree preservation order [TPO]¹

Six weeks' notice must be given to the LPA of intention to carry out work on or remove trees within a conservation area and not protected by a TPO¹

LPA consent may be required to carry out work on or remove trees, shrubs and hedges that are affected by planning conditions

LPA consent may be required for the removal of hedgerows²

Your Council's planning department will advise whether or not any of the above controls apply to your trees, shrubs and hedges

Subject to specified exemptions, a licence may be required for the felling of growing trees³

Your nearest Forestry Commission or Natural Resources Wales office will advise whether you require a felling licence

Wildlife

¹ <https://www.gov.uk/guidance/tree-preservation-orders-and-trees-in-conservation-areas>

² <https://www.gov.uk/guidance/countryside-hedgerows-regulation-and-management>

³ <https://www.gov.uk/guidance/tree-felling-licence-when-you-need-to-apply>

Nesting birds and all species of bat are afforded statutory protection.⁴ It is an offence to:

- disturb a nesting bird
- disturb a roosting bat or damage, destroy or block access to a bat roost
- intentionally kill, injure or take a bat
- sell, hire, barter or exchange a bat, dead or alive
- be in possession or control of a bat or anything derived from a bat

Your local Wildlife Trust or your Council's Ecologist will provide guidance on statutory controls relating to wildlife.

⁴ <https://www.gov.uk/topic/planning-development/protected-sites-species>

APPENDIX 5

GLOSSARY OF ARBORICULTURAL TERMS

Abscission. The shedding of a leaf or other short-lived part of a woody plant, involving the formation of a corky layer across its base; in some tree species twigs can be shed in this way

Abiotic. Pertaining to non-living agents; e.g. environmental factors

Absorptive roots. Non-woody, short-lived roots, generally having a diameter of less than one millimetre, the primary function of which is uptake of water and nutrients

Access facilitation pruning. One off tree pruning operation, the nature and effects of which are without significant adverse impact on tree physiology or amenity value, which is directly necessary to provide access for operations on site

Adaptive growth. In tree biomechanics, the process whereby the rate of wood formation in the cambial zone, as well as wood quality, responds to gravity and other forces acting on the cambium. This helps to maintain a uniform distribution of mechanical stress

Adaptive roots. The adaptive growth of existing roots; or the production of new roots in response to damage, decay or altered mechanical loading

Adventitious shoots. Shoots that develop other than from apical, axillary or dormant buds; see also 'epicormic'

Anchorage. The system whereby a tree is fixed within the soil, involving cohesion between roots and soil and the development of a branched system of roots which withstands wind and gravitational forces transmitted from the aerial parts of the tree

Ancient tree. A tree that has passed beyond maturity and is old, or aged, in comparison with other trees of the same species. An ancient tree is one that has all or most of the following characteristics: a) biological, aesthetic or cultural interest, because of its great age; b) a growth stage that is described as ancient or post-mature; c) a chronological age that is old relative to others of the same species

Arboricultural Method Statement. Methodology for the implementation of any aspect of development that is within the root protection area, or has the potential to result in loss of or damage to a tree to be retained

Arboriculturist. Person who has, through relevant education, training and experience, gained expertise in the field of trees in relation to construction

Architecture. In a tree, a term describing the pattern of branching of the crown or root system

Axial. Aligned along the axis of the stem, branch or root

Axil. The place where a bud is borne between a leaf and its parent shoot

Bacteria. Microscopic single-celled organisms, many species of which break down dead organic matter, and some of which cause diseases in other organisms

Bark. A term usually applied to all the tissues of a woody plant lying outside the vascular cambium, thus including the phloem, cortex and periderm; occasionally applied only to the periderm or the phellem

Bark expansion crack. The pattern of axial strips of bark on smooth-barked trees that have grown faster than the adjacent bark. A growth response to stretching of the bark by expansion of the underlying xylem

Basidiomycotina (Basidiomycetes). One of the major taxonomic groups of fungi; their spores are borne on microscopic peg-like structures (basidia), which in many types are in turn borne on or within conspicuous fruit bodies, such as brackets or toadstools. Most of the principal decay fungi in standing trees are basidiomycetes

Bolling. A term sometimes used to describe pollard heads

Bottle-butt. A broadening of the stem base and buttresses of a tree, in excess of normal and sometimes denoting a growth response to weakening in that region, especially due to decay involving selective delignification

Bracing. The use of rods or cables to restrain the movement between parts of a tree

Branch:

- **Primary.** A **first order branch** arising from a stem
- **Lateral.** A **second order branch**, subordinate to a primary branch or stem and bearing sub-lateral branches
- **Sub-lateral.** A **third order branch**, subordinate to a lateral or primary branch, or stem and usually bearing only twigs

Branch bark ridge. The raised arc of bark tissues that forms within the acute angle between a branch and its parent stem

Branch-collar. A visible swelling formed at the base of a branch whose diameter growth has been disproportionately slow compared to that of the parent stem; a term sometimes applied also to the pattern of growth of the cells of the parent stem around the branch base

Brown-rot. A type of wood decay in which cellulose is degraded, while lignin is only modified

Buckling. An irreversible deformation of a structure subjected to a bending load

Buttress zone. The region at the base of a tree where the major lateral roots join the stem, with buttress-like formations on the upper side of the junctions

Canker. A persistent lesion formed by the death of bark and cambium due to colonisation by fungi or bacteria

Canopy species. Tree species that mature to form a closed woodland canopy

Cellulose. A carbohydrate consisting of glucose molecules joined end-to-end, so as to form long filaments; a principal constituent of plant cell walls

Chlorosis. The loss of green pigment from plant tissues, caused by mineral deficiency. Chlorotic (adj.)

Compartmentalisation. The confinement of disease, decay or other dysfunction within an anatomically discrete region of plant tissue, due to passive and/or active defences operating at the boundaries of the affected region

Competent person. A person who has training and experience relevant to the matter being addressed and an understanding of the requirements of the task being approached.

Compression fork. An acute angled fork that is mechanically optimised for the growth pressure that two or more adjacent stems exert on each other

Compression strength. The ability of a material or structure to resist failure when subjected to compressive loading; measurable in trees with special drilling devices

Compressive loading. Mechanical loading which exerts a positive pressure; the opposite to tensile loading

Condition. An indication of the physiological condition of the tree. Where the term 'condition' is used in a report, it should not be taken as an indication of the stability of the tree

Construction. Site based operations with the potential to affect existing trees

Construction exclusion zone. Area based on the Root Protection Area from which access is prohibited for the duration of the project

Crown/Canopy. The main foliage bearing section of the tree

Crown lifting. The removal of limbs and small branches to a specified height above ground level

Crown thinning. The removal of a proportion of secondary branch growth throughout the crown to produce an even density of foliage around a well-balanced branch structure

Crown reduction/shaping. A specified reduction in crown size whilst preserving, as far as possible, the natural tree shape

Crown reduction/thinning. Reduction of the canopy volume by thinning to remove dominant branches whilst preserving, as far as possible the natural tree shape

Deadwood. Dead branch wood

Decurrent. In trees, a system of branching in which the crown is borne on a number of major widely-spreading limbs of similar size (cf. excurrent). In fungi with toadstools as fruit bodies, the description of gills which run some distance down the stem, rather than terminating abruptly

Decay. (of organic tissue) decomposition by fungi or bacteria

Defect. In relation to tree hazards, any feature of a tree which detracts from the uniform distribution of mechanical stress, or which makes the tree mechanically unsuited to its environment

Delamination. The separation of wood layers along their length, visible as longitudinal splitting

Desire-line footpath. A footpath that has been created by regular use rather than by design and construction

Dieback. The death of parts of a woody plant, starting at shoot-tips or root-tips

Disease. A malfunction in or destruction of tissues within a living organism, usually excluding mechanical damage; in trees, usually caused by pathogenic micro-organisms

Distal. In the direction away from the main body of a tree or subject organism (cf. proximal)

Dominance. In trees, the tendency for a leading shoot to grow faster or more vigorously than the lateral shoots; also the tendency of a tree to maintain a taller crown than its neighbours

Dormant bud. An axial bud which does not develop into a shoot until after the formation of two or more annual wood increments; many such buds persist through the life of a tree and develop only if stimulated to do so

Dysfunction. In woody tissues, the loss of physiological function, especially water conduction, in sapwood

DBH (Diameter at Breast Height). Stem diameter measured at a height of 1.5 metres (UK) or the nearest measurable point. Where measurement at a height of 1.5 metres is not possible, another height may be specified

Deadwood. Branch or stem wood bearing no live tissues. Retention of deadwood provides valuable habitat for a wide range of species and seldom represents a threat to the health of the tree. Removal of deadwood can result in the ingress of decay to otherwise sound tissues and climbing operations to access deadwood can cause significant damage to a tree. Removal of deadwood is generally recommended only where it represents an unacceptable level of hazard

Early-wood. The wood laid down around the time of the main flush of shoot growth in the early part of the growing season

Endophytes. Micro-organisms that live inside plant tissues without causing overt disease, but in some cases capable of causing disease if the tissues become physiologically stressed, for example by lack of moisture

Engineer-designed hard surfacing. Hard surfacing constructed within the 'Root protection area' of a tree, which will be designed by a structural or geotechnical engineer in collaboration with an arboriculturist as set out in clause 7.4 of British Standard BS5837:2012. The purpose being to minimise the effects of the construction on the health of the tree.

Epicormic shoot. A shoot having developed from a dormant or adventitious bud and not having developed from a first year shoot

Excrescence. Any abnormal outgrowth on the surface of tree or other organism

Excurrent. In trees, a system of branching in which there is a well-defined central main stem, bearing branches which are limited in their length, diameter and secondary branching (cf. decurrent)

Fastigate. Having upright, often clustered branches

Felling licence. In the UK, a permit to fell trees in excess of a stipulated number of stems or volume of timber

Fibre-buckling. The kinking of wood fibres and failure of other xylem elements when exposed to compressive loading

Field layer. Herbs, ferns, grasses and sedges

First-order branch. A high order branch, usually arising from a stem

Flush-cut. A pruning cut which removes part of the branch bark ridge and or branch-collar

Girdling root. A root which circles and constricts the stem or roots possibly causing death of phloem and/or cambial tissue

Ground layer. Mosses, ivy, lichens and fungi

Guying. A form of artificial support with cables for trees with a temporarily inadequate anchorage

Habit. The overall growth characteristics, shape of the tree and branch structure

Haloing. Removing or pruning trees from around the crown of another (usually mature or post-mature) tree to prevent it becoming suppressed

Hazard beam. An upwardly curved part of a tree in which strong internal stresses may occur without being reduced by adaptive growth; prone to longitudinal splitting

Heartwood/false-heartwood. The dead central wood that has become dysfunctional as part of the aging processes and being distinct from the sapwood

Heave. A term mainly applicable to a shrinkable clay soil which expands due to re-wetting after the felling of a tree which was previously extracting moisture from the deeper layers; also the lifting of pavements and other structures by root diameter expansion; also the lifting of one side of a wind-rocked root-plate

High canopy tree species. Tree species having potential to contribute to the closed canopy of a mature woodland or forest

Incipient failure. In wood tissues, a mechanical failure which results only in deformation or cracking, and not in the fall or detachment of the affected part

Included bark (ingrown bark). Bark of adjacent parts of a tree (usually forks, acutely joined branches or basal flutes) which is in face-to-face contact

Increment borer. A hollow auger, which can be used for the extraction of wood cores for counting or measuring wood increments or for inspecting the condition of the wood

Infection. The establishment of a parasitic micro-organism in the tissues of a tree or other organism

Internode. The part of a stem between two nodes; not to be confused with a length of stem which bear nodes but no branches

Laser Rangefinder. A device that uses a laser beam to measure distance, angle, and height.

Lateral branch: A side branch

Late-wood. The wood laid down after the time of the first main flush of shoot growth. Usually denser than the early-wood

Lever arm. A mechanical term denoting the length of the lever represented by a structure that is free to move at one end, such as a tree or an individual branch

Lesion. Death or abnormal change in tissues, usually associated with disease or trauma

Lignin. The hard, cement-like constituent of wood cells; deposition of lignin within the matrix of cellulose microfibrils in the cell wall is termed Lignification

Lions tailing. A term applied to a branch of a tree that has few if any side-branches except at its end, and is thus liable to snap due to end-loading

Loading. A mechanical term describing the force acting on a structure from a particular source; e.g. the weight of the structure itself or wind pressure

Loam. A soil with roughly equal proportions of sand, silt, and clay

Longitudinal. Along the length (of a stem, root or branch)

Lopping. A term often used to describe the removal of large branches from a tree, but also used to describe other forms of cutting

Marginal browning of leaves. Death of a tissues to the margin or edge of the leaf

Mature Heights (approximate):

- **Low maturing** – less than 8 metres high
- **Moderately high maturing** – 8 – 12 metres high
- **High maturing** – greater than 12 metres high

Microdrill. An electronic rotating steel probe, which when inserted into woody tissue provides a measure of tissue density

Minor deadwood. Deadwood of a diameter less than 25mm and or unlikely to cause significant harm or damage upon impact with a target beneath the tree

Mulch. Material laid down over the rooting area of a tree or other plant to help conserve moisture; a mulch may consist of organic matter or a sheet of plastic or other artificial material

Mycelium. The body of a fungus, consisting of branched filaments (hyphae)

Obvious defects. Defects that are so apparent that most people, whether specialist or not, would recognise them on taking a general, but not necessarily close view of the tree

Occluding tissues. A general term for the roll of wood, cambium and bark that forms around a wound on a woody plant (cf. woundwood)

Occlusion. The process whereby a wound is progressively closed by the formation of new wood and bark around it

Pathogen. A micro-organism which causes disease in another organism

Phloem. Vascular tissue that distributes the products of photosynthesis (sugars) around the plant

Photosynthesis. The process whereby plants use light energy to split hydrogen from water molecules and combine it with carbon dioxide to form carbohydrates that are the basic building block for plant growth. Photosynthetic capacity is the plant's ability to produce carbohydrates

Phytotoxic. Toxic to plants

Pollarding. The removal of the tree canopy, back to the stem or primary branches, usually to a point just outside that of the previous cutting. Pollarding may involve the removal of the entire canopy in one operation, or may be phased over several years. The period of safe retention of trees having been pollarded varies with species and individuals. It is usually necessary to re-pollard on a regular basis, annually in the case of some species

Primary branch. A major branch, generally having a basal diameter greater than 0.25 x stem diameter

Primary root zone. The soil volume most likely to contain roots that are critical to the health and stability of the tree and normally defined by reference BS5837 (2012) Trees in Relation to design, demolition and construction

Priority. Works may be prioritised, 1. = high, 5. = low

Probability. A statistical measure of the likelihood that a particular event might occur

Proximal. In the direction towards from the main body of a tree or other living organism (cf. distal)

Pruning. The removal or cutting back of twigs or branches, sometimes applied to twigs or small branches only, but often used to describe most activities involving the cutting of trees or shrubs

Radial. In the plane or direction of the radius of a circular object such as a tree stem

Rams-horn. In connection with wounds on trees, a roll of occluding tissues which has a spiral structure as seen in cross-section

Rays. Strips of radially elongated parenchyma cells within wood and bark. The functions of rays include food storage, radial translocation and contributing to the strength of wood

Reactive Growth/Reaction Wood. Production of woody tissue in response to altered mechanical loading; often in response to internal defect or decay and associated strength loss (cf. adaptive growth)

Removal of deadwood. Unless otherwise specified, this refers to the removal of all accessible dead, dying and diseased branchwood and broken snags

Removal of major deadwood. The removal of, dead, dying and diseased branchwood above a specified size

Respacing. Selective removal of trees from a group or woodland to provide space and resources for the development of retained trees

Residual wall. The wall of non-decayed wood remaining following decay of internal stem, branch or root tissues

Rhizomorph. A root-like aggregation of fungal hyphae

Rib. A ridge of wood that has usually developed because of locally increased mechanical loading. Often associated with internal cracking in the wood of the stem, branch, or root.

Ring-barking (girdling). The removal of a ring of bark and phloem around the circumference of a stem or branch, normally resulting in an inability to transport photosynthetic assimilates

below the area of damage. Almost inevitably results in the eventual death of the affected stem or branch above the damage

Ripewood. The older central wood of those tree species in which sapwood gradually ages without being converted to heartwood

Root-buttresses. A buttress-like formation at the transition between roots and stems

Root-collar. The transitional area between the stem/s and roots

Root-collar examination. Excavation of surfacing and soils around the root-collar to assess the structural integrity of roots and/or stem

Root protection area (RPA). Layout design tool indicating a national minimum area around a tree deemed to contain sufficient roots and rooting volume to maintain the tree's viability and where the protection of the roots and soil structure is treated as a priority

Root zone. Area of soils containing absorptive roots of the tree/s described. The **Primary** root zone is that which we consider of primary importance to the physiological well-being of the tree

Saprophytic fungi. Fungi that live on dead or decomposing matter (in the tree) as opposed to functional, living tissues

Sapwood. Living xylem tissues

Safety factor. The ratio of the maximum stress that a structural part of a tree can withstand to the maximum stress experienced under normal conditions

Screef. To clear surface vegetation (commonly up to a depth of around 20mm)

Secondary branch. A branch, generally having a basal diameter of less than 0.25 x stem diameter

Selective delignification. A kind of wood decay (white-rot) in which lignin is degraded faster than cellulose

Senescence. The condition or process of deterioration with age.

Service. Any above- or below-ground structure or apparatus required for utility provision e.g. drainage, gas supplies, ground source heat pumps, CCTV and satellite communications

Shedding. In woody plants, the normal abscission, rotting off or sloughing of leaves, floral parts, twigs, fine roots and bark scales

Shoot. The elongating region of a stem or branch

Shrub species. Woody perennial species forming the lowest level of woody plants in a woodland and not normally considered to be trees

Silviculture. The practice of controlling the establishment, growth, composition, health, and quality of forests to meet diverse needs and values

Silvicultural thinning. Removal of selected trees to favour the development of retained specimens to achieve a management objective

Single-up. Removal of stems from a multi-stemmed tree with the aim of developing a tree with a single stem.

Simultaneous white-rot. A kind of wood decay in which lignin and cellulose are degraded at about the same rate

Snag. In woody plants, a portion of a cut or broken stem, branch or root which extends beyond any growing-point or dormant bud; a snag usually tends to die back to the nearest growing point

Soft-rot. A kind of wood decay in which a fungus degrades cellulose within the cell walls, without any general degradation of the wall as a whole

Soil auger. A hand-held steel auger 60mm diameter auger used for extracting soil samples.

Soil horizons. A layer parallel to the soil surface, whose physical characteristics differ from the layers above and beneath:

- O)** Organic matter - Litter layer of plant residues
- A)** Surface soil - Layer of mineral soil with accumulation of organic matter
- B)** Subsoil - This layer accumulates mineral and organic compounds.
- C)** Parent rock - Layer of large unbroken rocks
- R)** Bedrock - Partially weathered bedrock at the base of the soil profile

Soil sample. A sample of soil extracted for the purpose of either field or laboratory testing to determine mineral, chemical or structural composition, and or moisture content and shrinkability.

Sounding hammer. A small plastic or nylon hammer used for assessing the audible signs of decay, cracks and other features in trees

Spores. Propagules of fungi and many other life-forms; most spores are microscopic and dispersed in air or water

Sporophore. The spore bearing structure of fungi

Sprouts. Adventitious shoot growth erupting from beneath the bark

Squirrel damage. Stripping of the bark from stems or branches by squirrels. This can result in the death of branches or even entire trees

Stem/s. Principle above-ground structural component(s) of a tree that supports its branches

Stem taper. The downward tapering of a tree stem out into the flare of the root buttresses

Stress. In plant physiology, a condition under which one or more physiological functions are not operating within their optimum range, for example due to lack of water, inadequate nutrition or extremes of temperature

Stress. In mechanics, the application of a force to an object

Strain. In mechanics, the distortion of an object caused by a stress

Stringy white-rot. The kind of wood decay produced by selective delignification

Storm. A layer of tissue which supports the fruit bodies of some types of fungi, mainly ascomycetes

Structural roots. Roots, generally having a diameter greater than ten millimetres, and contributing significantly to the structural support and stability of the tree

Structure. Manufactured object, such as a building, carriageway, path, wall, service run, and built or excavated earthwork

Subsidence. In relation to soil or structures resting in or on soil, a sinking due to shrinkage when certain types of clay soil dry out, sometimes due to extraction of moisture by tree roots

Subsidence. In relation to branches of trees, a term that can be used to describe a progressive downward bending due to increasing weight

Taper. In stems and branches, the degree of change in girth along a given length

Target canker. A kind of perennial canker, containing concentric rings of dead occluding tissues

Targets. In tree risk assessment (with slight misuse of normal meaning) persons or property or other things of value which might be harmed by mechanical failure of the tree or by objects falling from it

Terminal xylem. The last layers of xylem cells produced at the end of the growing season

Topping. In arboriculture, the removal of the crown of a tree, or of a major proportion of it

Torsional stress. Mechanical stress applied by a twisting force

Translocation. In plant physiology, the movement of water and dissolved materials through the body of the plant

Transpiration. The evaporation of moisture from the surface of a plant, especially via the stomata of leaves; it exerts a suction which draws water up from the roots and through the intervening xylem cells

Tree Protection Plan. Scale drawing, informed by descriptive text where necessary, based upon the finalised proposals, showing trees for retention and illustrating the tree and landscape protection measures

Tree Risk Assessment. An assessment and description of the risks and where appropriate the values associated with a tree or trees. The primary risk being considered is that from falling trees. Other risks, such as damage to infrastructure, interruption of service and building subsidence may also be considered

- Walkover – A general view of the tree population considered in the context of the adjacent land-use to identify trees that present significantly elevated risks
- Drive-by - A general view of the tree population from a moving vehicle and considered in the context of the adjacent land-use to identify trees that present significantly elevated risks
- Individual – the assessment of risks from a single tree considered in the context of the adjacent land-use to identify trees that present significantly elevated risks

Understorey. This layer consists of younger individuals of the dominant trees, together with smaller trees and shrubs which are adapted to grow under lower light conditions

Understorey tree species. Tree species not having potential to attain a size at which they can contribute to the closed high canopy of a woodland

Vascular cambium. Sometimes described simply as 'cambium'. Layer of dividing cells producing xylem (woody) tissue internally and phloem (bark) tissue externally

Vascular dysfunction. Dysfunction of water conducting cells

Vascular wilt. A type of plant disease in which water-conducting cells become dysfunctional

Vessels. Water-conducting cells in plants, usually wide and long for hydraulic efficiency; generally not present in coniferous trees

Veteran tree. A tree that has the physical characteristics of an ancient tree but is not ancient in years, compared with others of the same species

Vigour. The expression of carbohydrate expenditure to growth (in trees)

Vitality. A measure of physiological condition. N = within normal range for species and age, R = reduced from the normal range for the species and age, P = poor

Volunteer trees. Trees arising from natural colonisation rather than having been planted

Weeping lesion. Exudations from a lesion in plant tissue

Wet flush. Where water from underground flows out onto the surface to create an area of saturated ground, rather than a well-defined channel

White-rot. A range of kinds of wood decay in which lignin, usually together with cellulose and other wood constituents, is degraded

Wind exposure. The degree to which a tree or other object is exposed to wind, both in terms of duration and velocity

Wind pressure. The force exerted by a wind on a particular object

Windthrow. The blowing over of a tree at its roots

Wound dressing. A general term for sealants and other materials used to cover wounds in the hope of protecting them against desiccation and infection; only of proven value against fresh wound parasites

Woundwood. Wood with atypical anatomical features, formed in the vicinity of a wound

Xylem. Secondary xylem; the main structurally supporting and water-conducting element of trees (refined definition specific to this case)