

Truss 50



Truss 51



Truss 52



Truss 53



Truss 54



Truss 56



Truss 57




Truss 58




Appendix E



Appendix E - Masonry West Elevation.



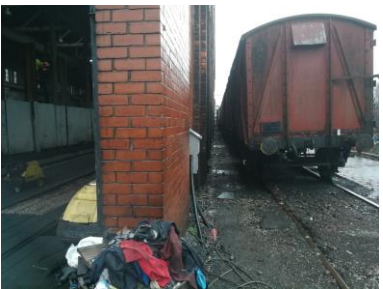



Appendix E - Masonry East Elevation.




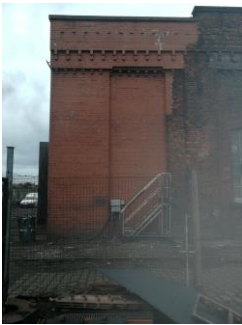


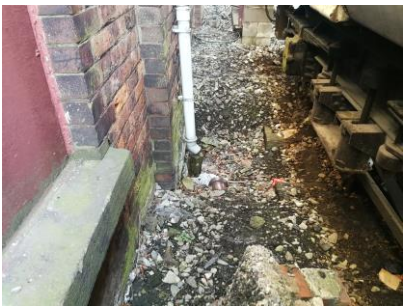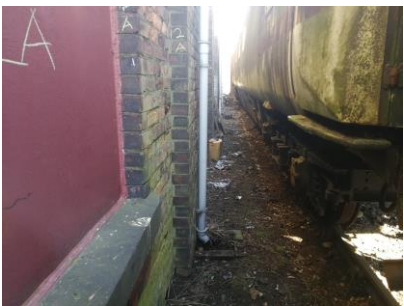

Appendix E - Masonry Internal Elevations

East Elevations

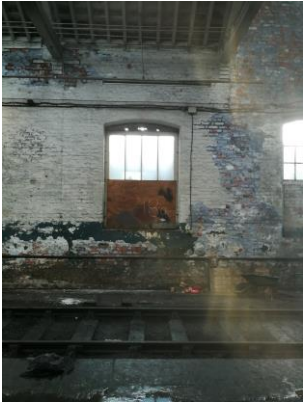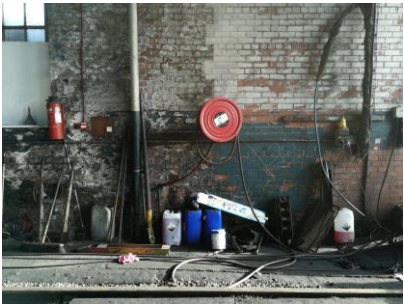

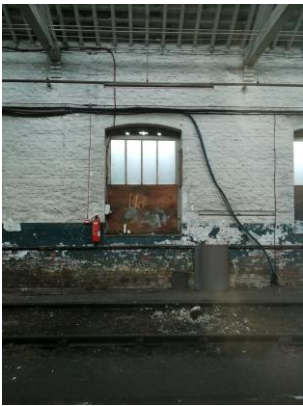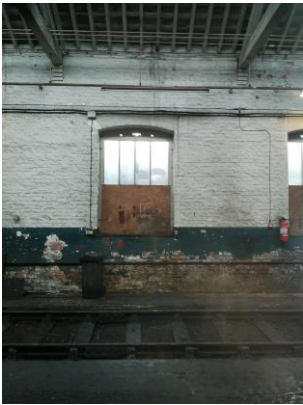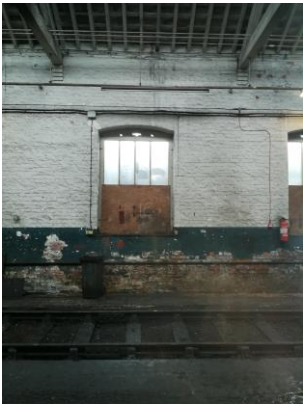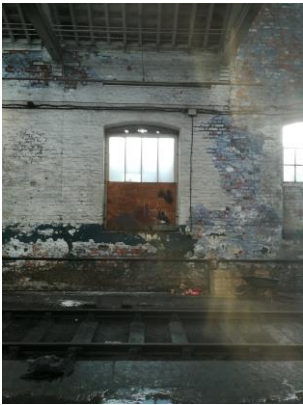


West Elevation.






Appendix F


Columns Head Details

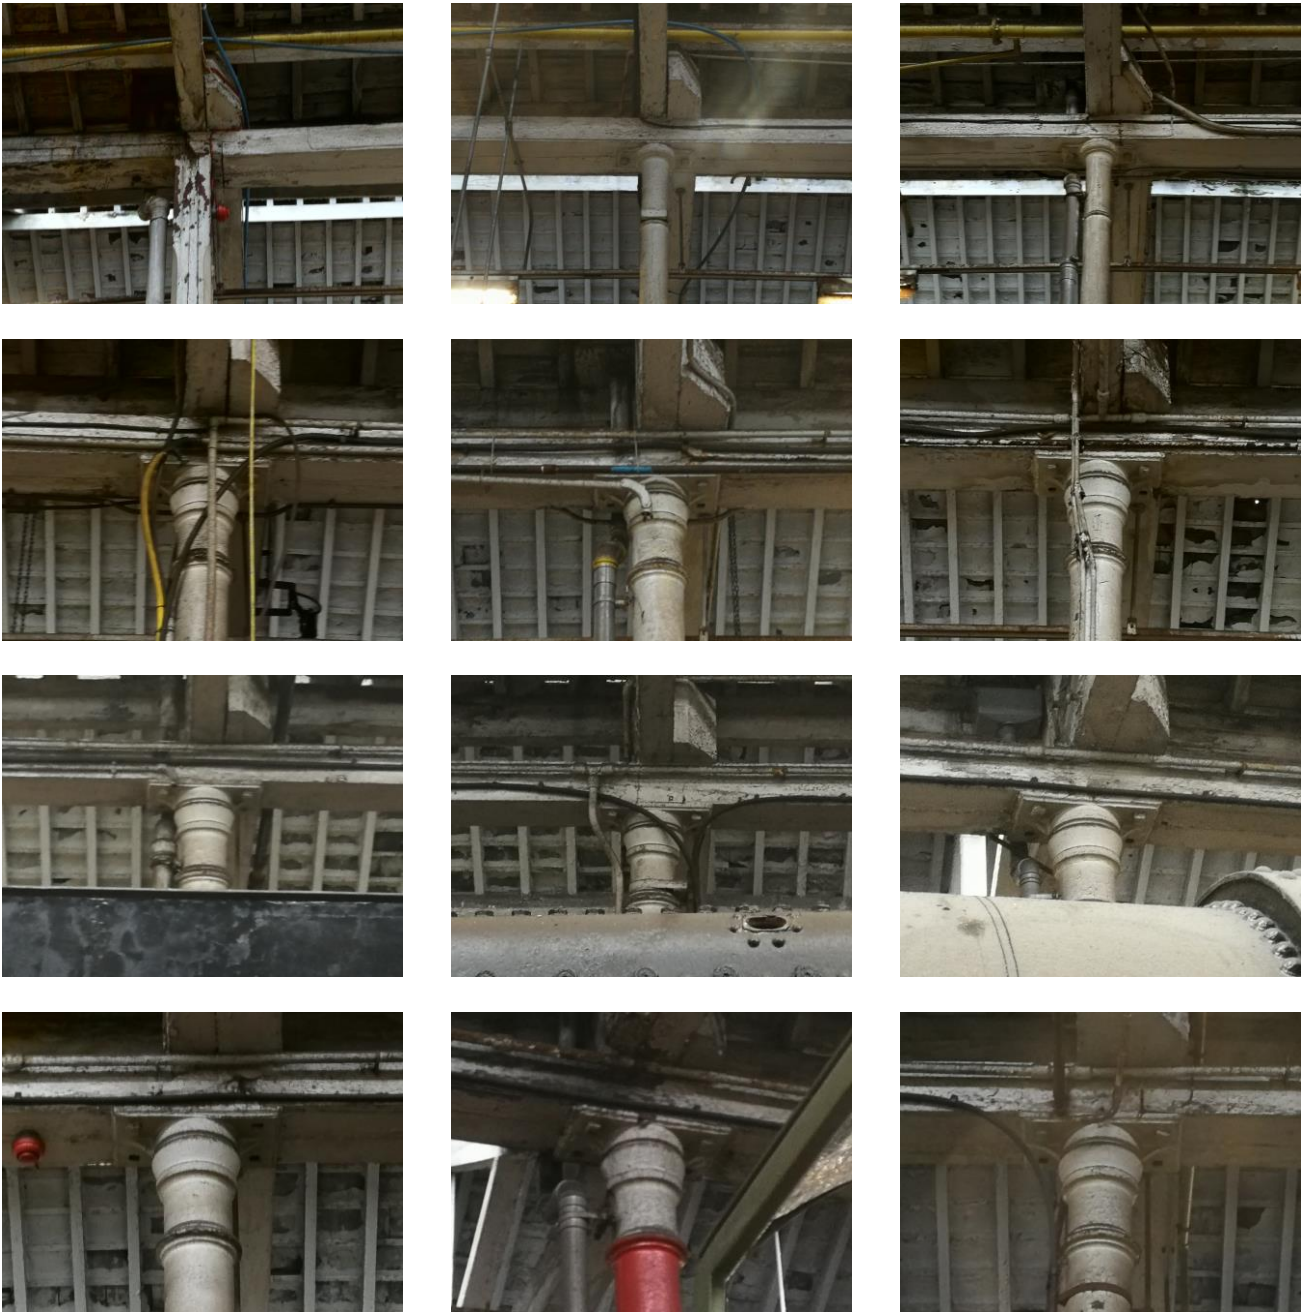



Slabs - North West and South West Quadrants

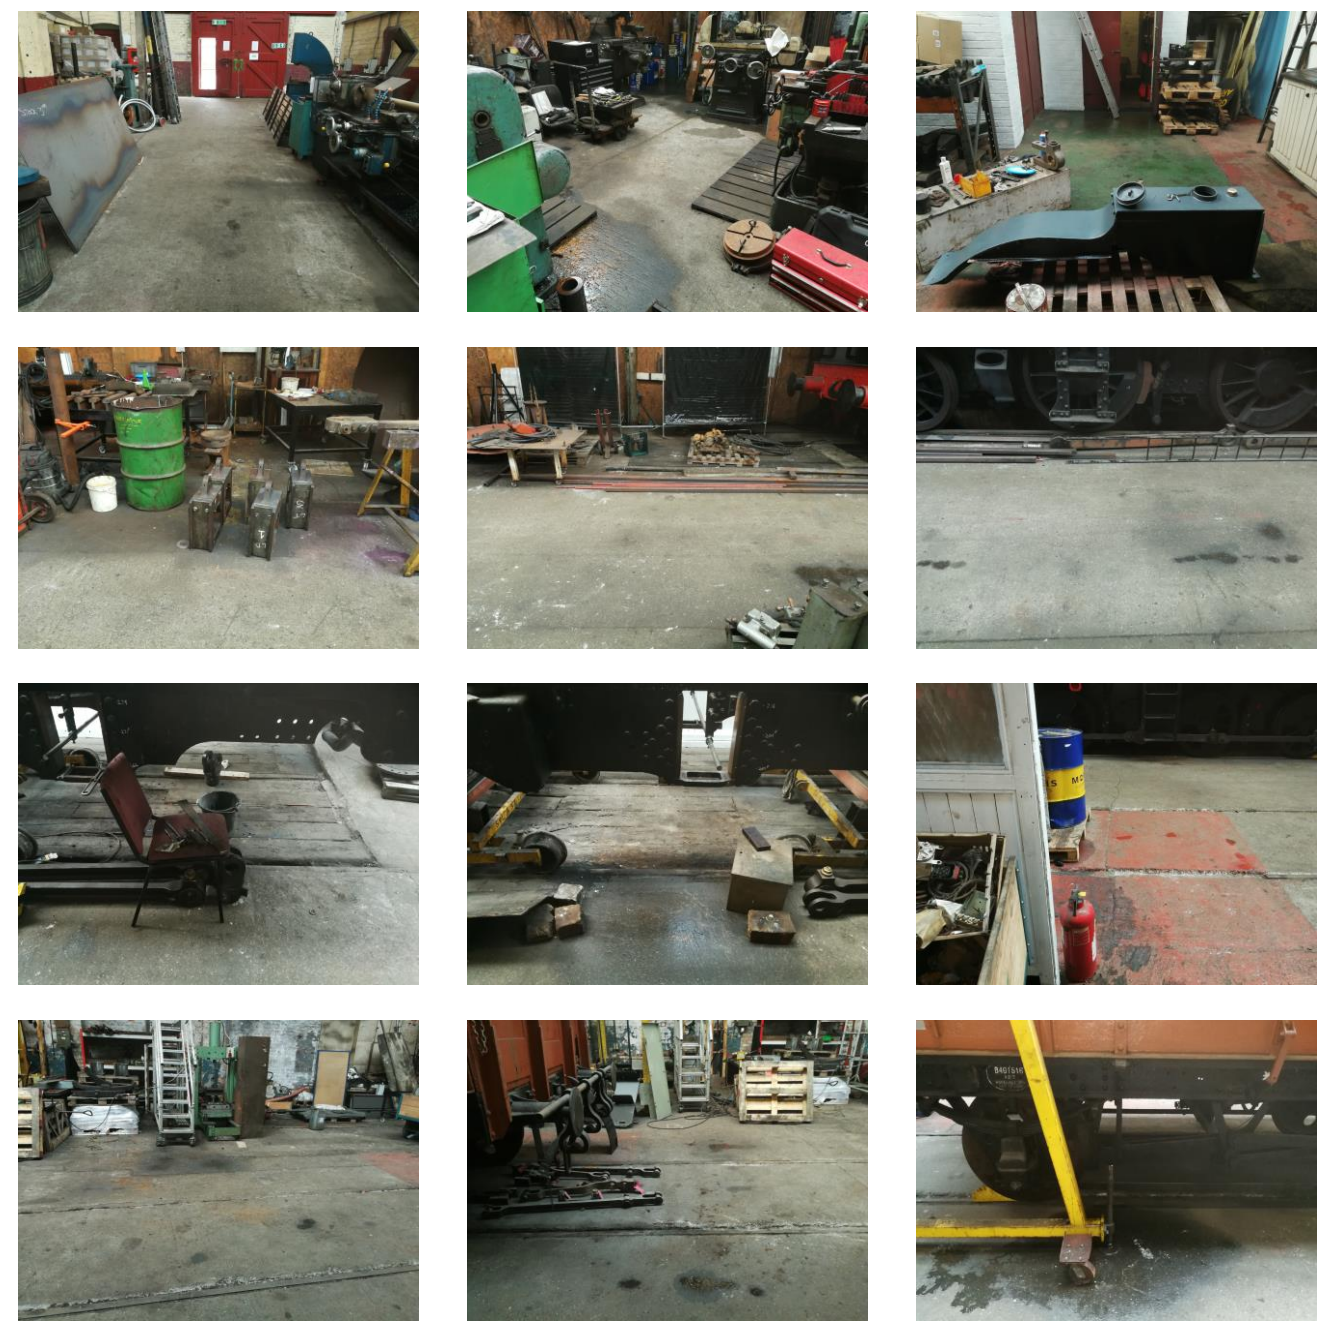

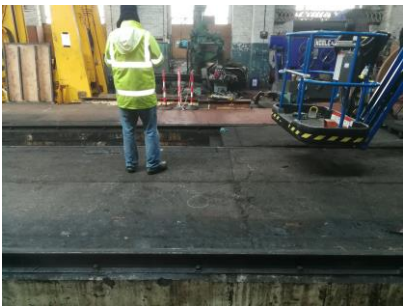



Pits




Appendix G



Gantry Crane

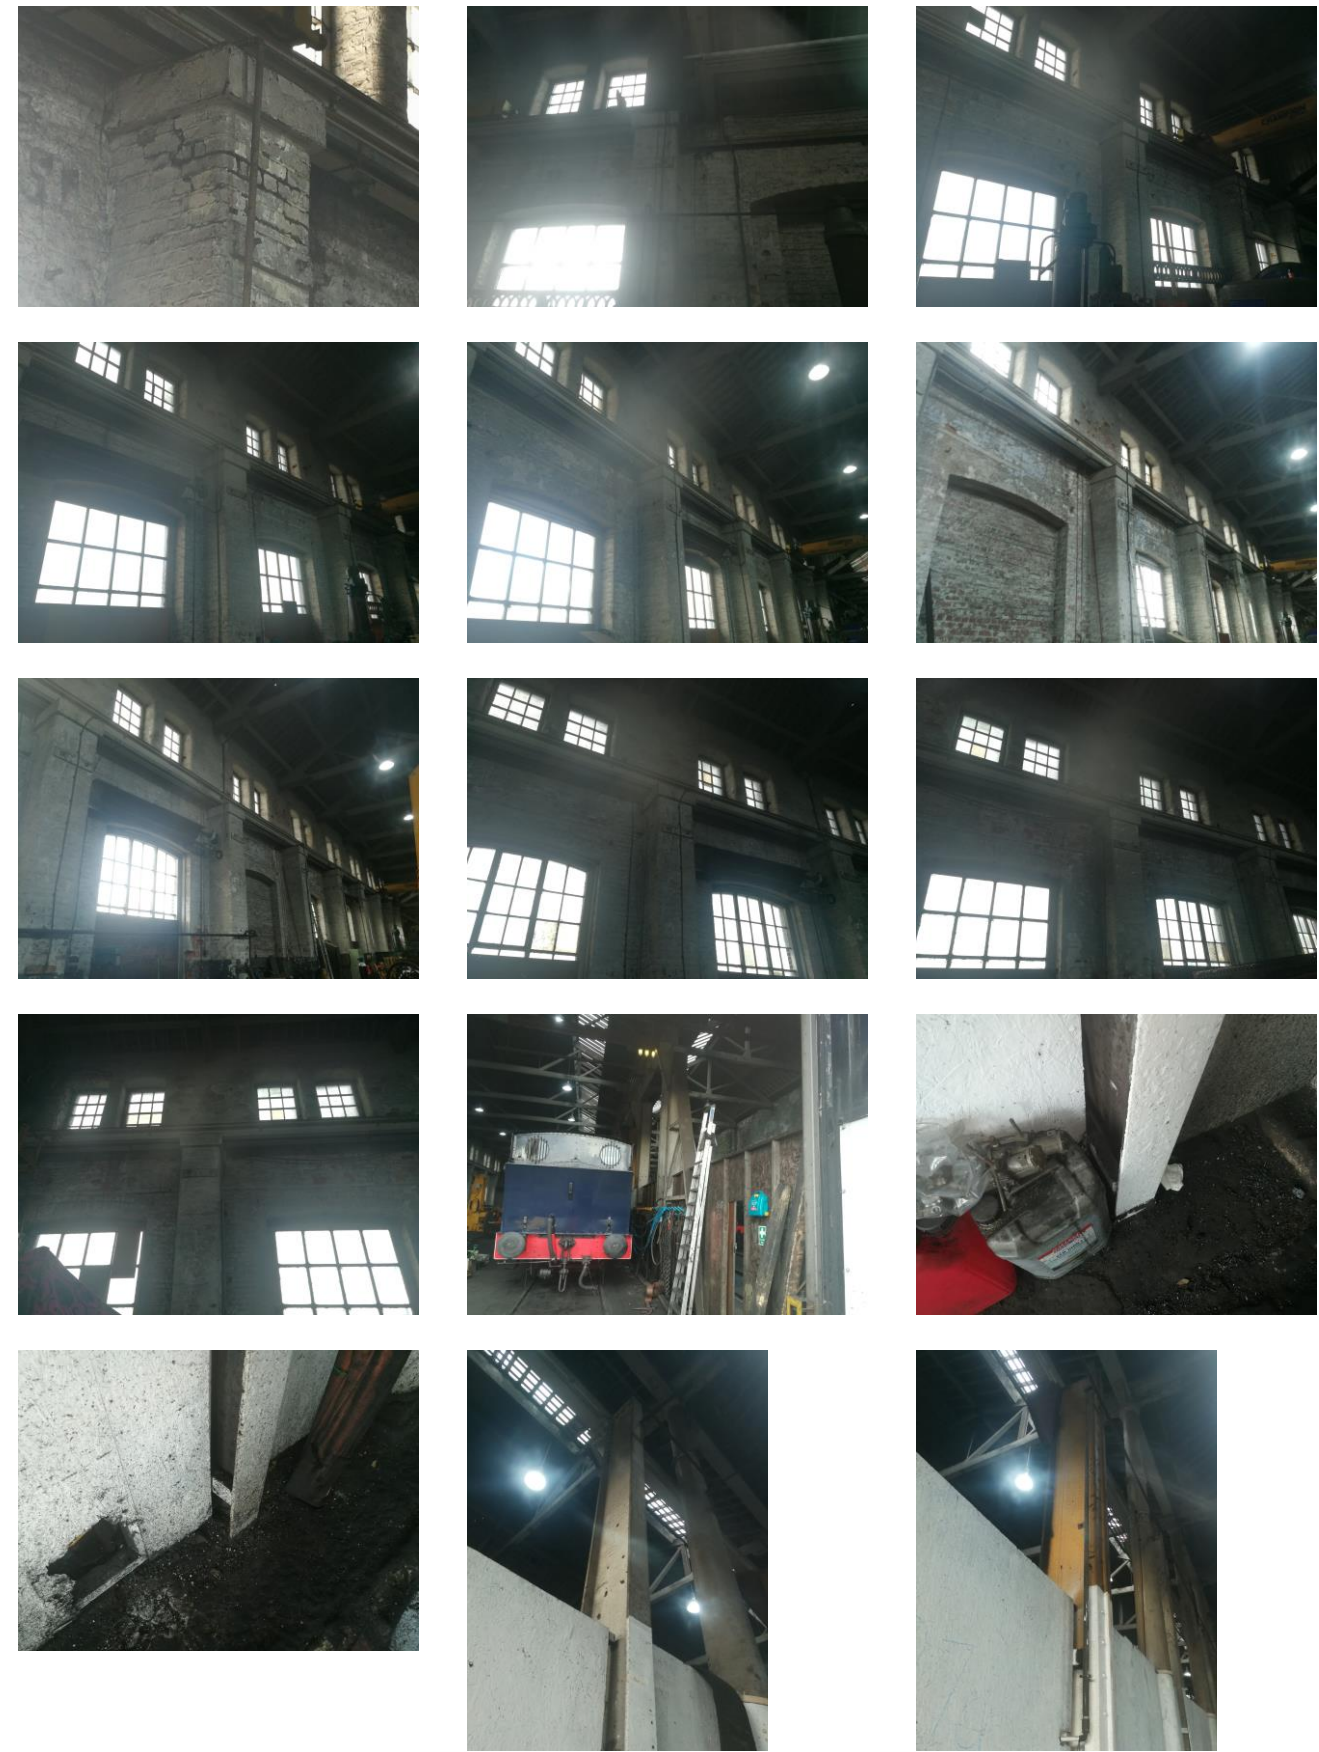

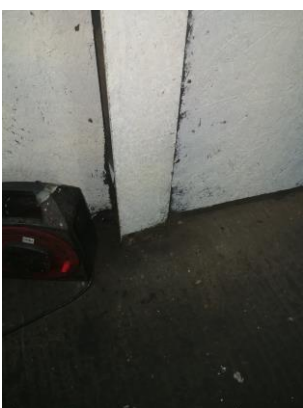




Appendix H


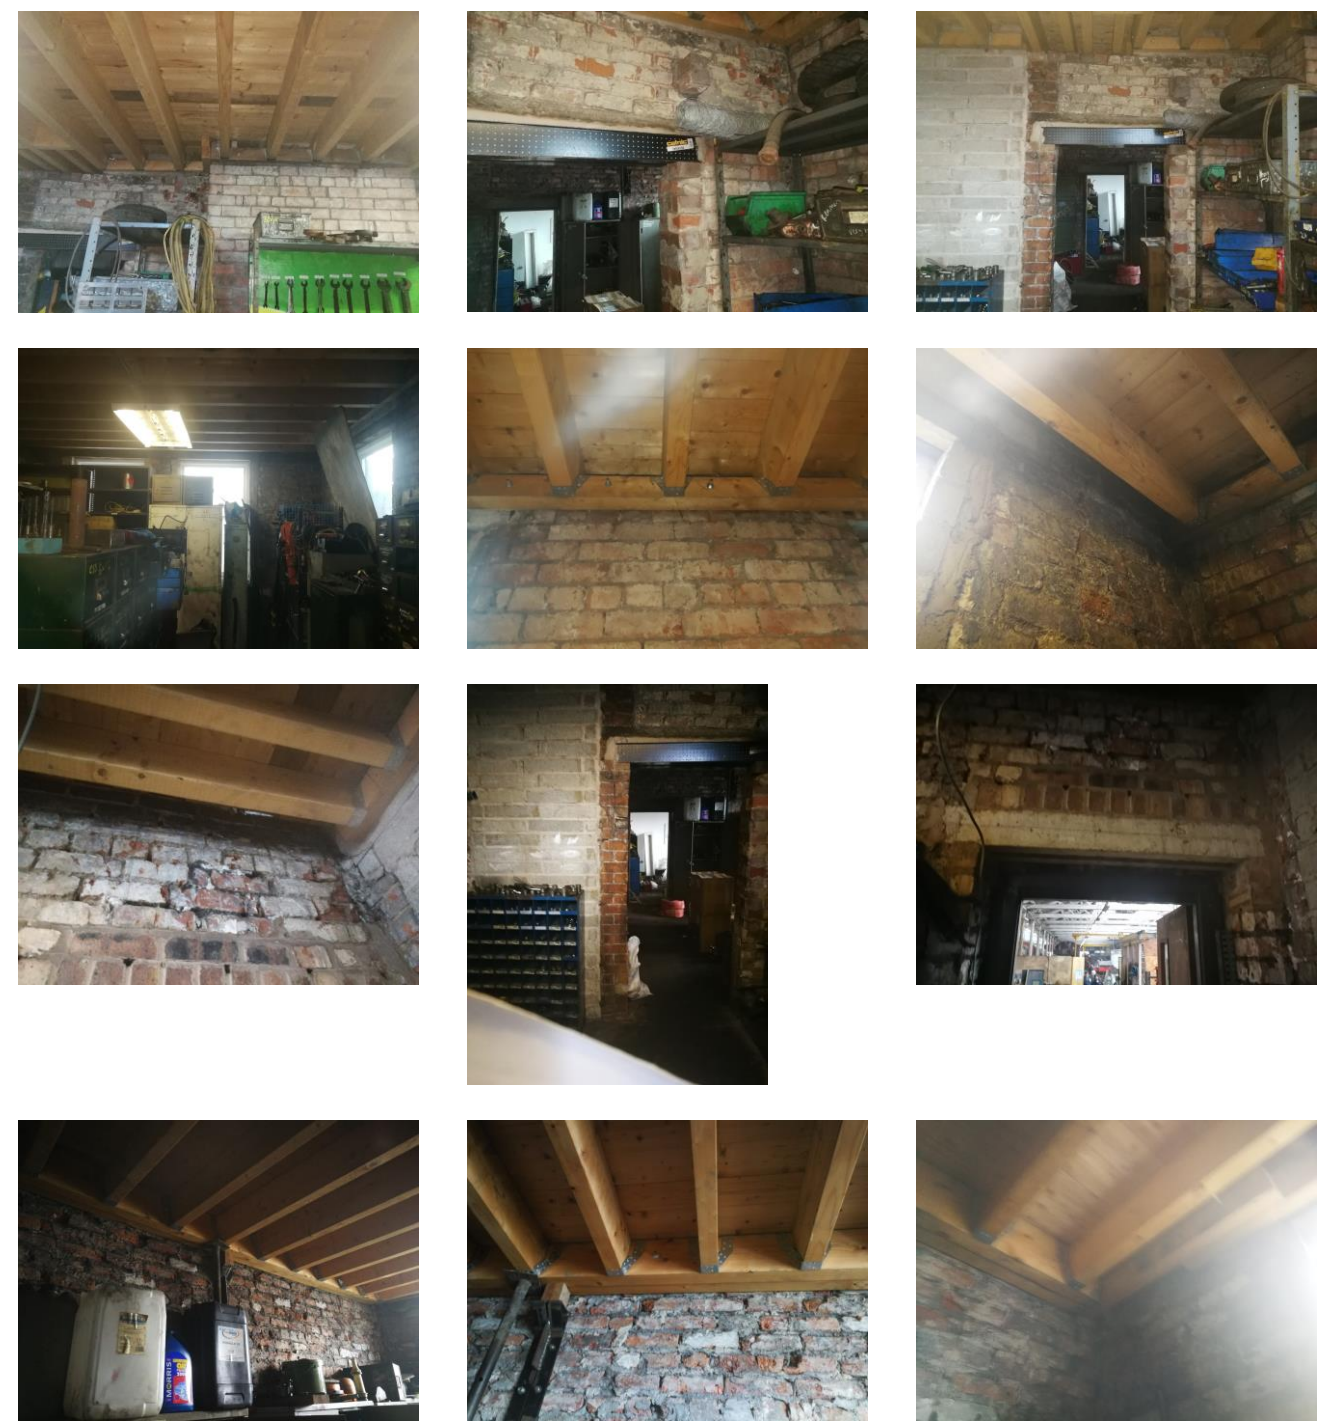


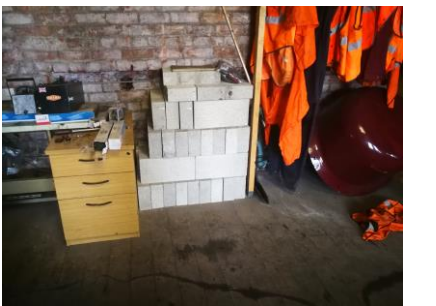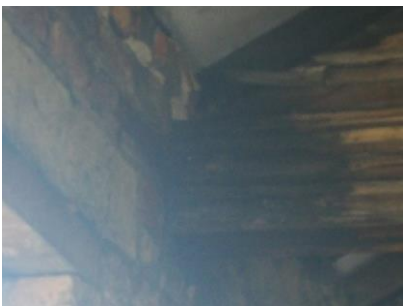

HAZARD! Excessive Load

HAZARD! Excessive Load

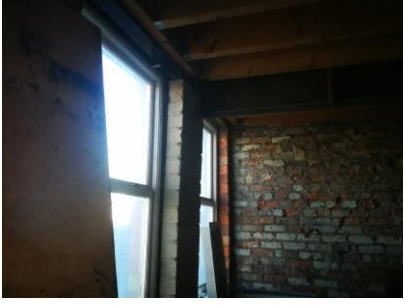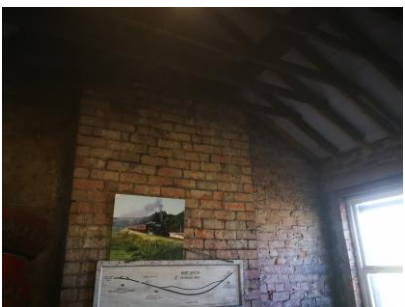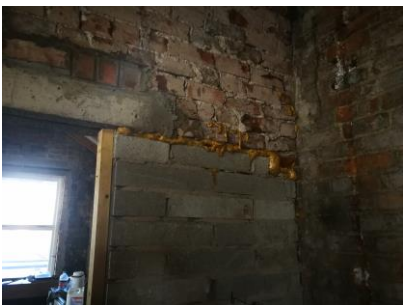

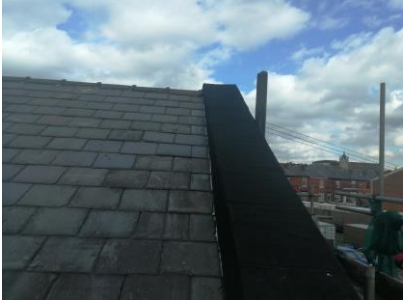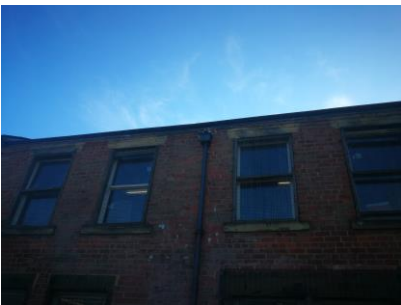

Appendix J

Below is a tally chart which summaries the quantity of defects across the entire carriage shed local to each truss.

		Purlin deflections evident	Items missing	Water damage	Strut missing	Spoil to brickwork	Movement detected	Truss tie rods not working	Bearing repair required	Decay evidence	Hazard!!
Truss 1	North West Quadrant		✓							✓	
Truss 2											
Truss 3									✓		
Truss 4								✓			
Truss 5							✓	✓	✓		
Truss 6							✓	✓			
Truss 7							✓	✓			
Truss 8							✓	✓			
Truss 9							✓	✓			
Truss 10							✓	✓			
Truss 11					✓	✓	✓	✓			
Truss 12											
Truss 13											
Truss 14										✓	
Truss 15									✓	✓	
Truss 16											
Truss 17							✓	✓	✓		
Truss 18			✓							✓	✓

Purlin deflections evident													
Items missing													
Water damage		✓	✓						✓			✓	✓
Strut missing													
Spoil to brickwork												✓	
Movement detected													
Truss tie rods not working													
Bearing repair required				✓	✓	✓	✓	✓	✓	✓	✓	✓	
Decay evidence											✓	✓	
Hazard!!												✓	
	South West Quadrant												
	Truss 19	Truss 20	Truss 21	Truss 22	Truss 23	Truss 24	Truss 25	Truss 26	Truss 27	Truss 28	Truss 29		

Purlin deflections evident													
Items missing													
Water damage		✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Strut missing													
Spoil to brickwork		✓		✓		✓	✓	✓	✓	✓	✓	✓	✓
Movement detected				✓					✓	✓	✓		
Truss tie rods not working													
Bearing repair required			✓	✓	✓	✓	✓	✓	✓	✓	✓		
Decay evidence		✓		✓					✓	✓	✓	✓	
Hazard!!													
	South East Quadrant												
	Truss 30	Truss 31	Truss 32	Truss 33	Truss 34	Truss 35	Truss 36	Truss 37	Truss 38	Truss 39	Truss 40		

Purlin deflections evident	
Items missing	
Water damage	
Strut missing	
Spoil to brickwork	
Movement detected	
Truss tie rods not working	
Bearing repair required	
Decay evidence	
Hazard!!	
Truss 41	
Truss 42	
Truss 43	
Truss 44	
Truss 45	
Truss 46	
Truss 47	
Truss 48	
Truss 49	
Truss 50	✓
Truss 51	
Truss 52	✓
Truss 53	
Truss 54	
Truss 55	
Truss 56	
Truss 57	
Truss 58	✓