


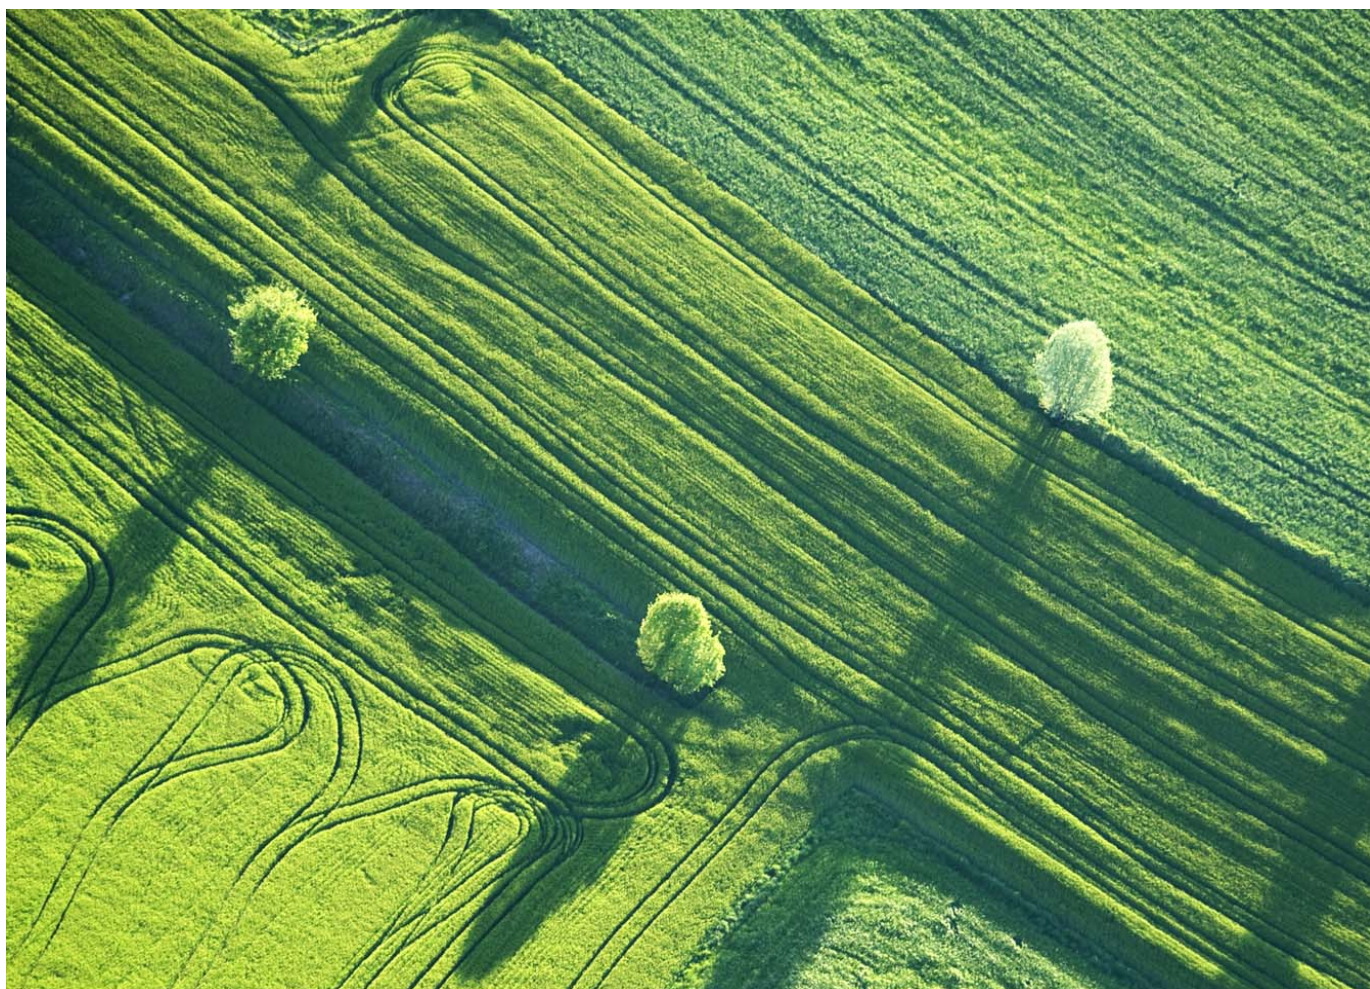

Bury Council

Fernhill Caravan Park, Every Street, Bury

Geo-environmental and geotechnical site investigation

11542-R02 (00)

RSK GENERAL NOTES

Project No.: 11542 R02 (00)

Title: Geo-environmental and geotechnical site investigation: Fernhill Caravan Park,
Every Street, Bury

Client: Bury Council

Date: August 2021

Office: RSK Environment Limited, Fourways House, 57 Hilton Street, Manchester, M1
2EJ. Tel 0161 2362757

Status: Rev (00)

Author Nik Reynolds

Signature



Technical reviewer Adrian Smith

Signature



Project manager Gavin Saddington

Signature



Quality reviewer Joyce Saddington

Signature



Revision control sheet				
Revision ref.	Date	Reason for revision	Amended by:	Approved by:
00	13/08/21	First issue for client review	n/a	see above

RSK Environment Limited (RSK) has prepared this report for the sole use of the client, showing reasonable skill and care, for the intended purposes as stated in the agreement under which this work was completed. The report may not be relied upon by any other party without the express agreement of the client and RSK. No other warranty, expressed or implied, is made as to the professional advice included in this report.

Where any data supplied by the client or from other sources have been used, it has been assumed that the information is correct. No responsibility can be accepted by RSK for inaccuracies in the data supplied by any other party. The conclusions and recommendations in this report are based on the assumption that all relevant information has been supplied by those bodies from whom it was requested.

This work has been undertaken in accordance with the quality management system of RSK Environment Ltd. No part of this report may be copied or duplicated without the express permission of RSK and the party for whom it was prepared.

Where field investigations have been carried out, these have been restricted to a level of detail required to achieve the stated objectives of the work.

CONTENTS

EXECUTIVE SUMMARY	1
1 INTRODUCTION.....	5
1.1 Commissioning	5
1.2 Objectives	5
1.3 Scope of works	5
1.4 Existing reports	6
1.5 Limitations	6
2 SITE DETAILS	7
2.1 Site location.....	7
2.2 Site description	7
2.3 Surrounding land uses	7
2.4 Development plans	7
2.5 Site history	8
2.6 Summary of previous investigations	11
2.7 Site setting	15
3 SITE INVESTIGATION STRATEGY & METHODOLOGY	18
3.1 Introduction	18
3.2 Objectives	18
3.3 Selection of investigation methods	18
3.4 Investigation strategy	19
3.5 Monitoring programme.....	20
3.6 Laboratory testing	21
4 SITE INVESTIGATION FACTUAL FINDINGS.....	24
4.1 Ground conditions encountered.....	24
4.2 Groundwater and surface water	26
4.3 Chemical laboratory results	27
4.4 Geotechnical laboratory results	27
4.5 Ground gas monitoring	27
5 GEO-ENVIRONMENTAL ASSESSMENT.....	28
5.1 Refinement of initial CSM	28
5.2 Linkages for assessment	29
5.3 Methodology and assessment of soil results	30
5.4 Methodology and assessment of water results.....	34
5.5 Ground gas risk assessment – bulk gases	34
5.6 Uncertainties and implications in refined CSM and GQRA	41
6 PRELIMINARY WASTE ASSESSMENT	42
6.1 Hazardous waste assessment.....	42
6.2 WAC assessment	44
7 GEOTECHNICAL ASSESSMENT.....	45
7.1 Proposed development.....	45
7.2 Key geotechnical hazards / development constraints	45
7.3 Foundations	45

7.4	Roads and hardstanding	46
7.5	Excavations for foundations and services	46
7.6	Chemical attack on buried concrete	47
7.7	Infiltration drainage	48
8	CONCLUSIONS AND RECOMMENDATIONS	49
8.1	Geo-environmental assessment	49
8.2	Geotechnical assessment	49
8.3	Recommendations	49
	REFERENCES	50

FIGURES

Figure 1	Site location plan
Figure 2	Exploratory hole plan
Figure 3	Site Plan (Historical Land Use)
Figure 4	Site Plan (Historical Land Use and Current Layout)

APPENDICES

Appendix A	Service constraints
Appendix B	Reference drawings
Appendix C	Summary of legislation and policy relating to land contamination
Appendix D	Environmental database report
Appendix E	Coal Authority report
Appendix F	Technical background
Appendix G	Exploratory hole records
Appendix H	Ground gas monitoring data
Appendix I	Laboratory certificates for soil analysis
Appendix J	Generic Assessment criteria for human health
Appendix K	United Utilities Risk Assessment for water pipes with assessment
Appendix L	GQRA data screening tables - soils
Appendix M	WM3 assessment

EXECUTIVE SUMMARY

Commissioning and purpose of assessment	RSK Environment Limited (RSK) was commissioned by Bury Council to carry out a geo-environmental and geotechnical report of the land at the Fernhill Caravan Park, Every Street, Bury, BL9 5BL, grid reference SD 805117. The overall aim of the project was to assess land contamination sources and geotechnical constraints to the proposed development
DESK-BASED ASSESSMENT	
Site description and proposed development	The site currently comprises a caravan park for travellers and occupies an area of 1.7 acres (0.69 hectares) and is being considered for development for a similar use.
History of site and surrounding area	The site was formerly used for a gravel pit and Corporation Yard. Potential sources of contamination identified on-site comprise imported contaminated soils, general waste (uncontrolled), incinerator ash and clinker, hydrocarbon products. Several potentially contaminative current activities have been identified in the surrounding area, including timber yards, foundries, railway land and a refuse destructor (incinerator).
Previous site investigation (SI) reports	This is the only deep ground investigation of the site; however, an investigation into the contents of the bunds (as well as limited area of shallow verges) which were present within the site boundary had been completed by Tergeo (2017) and RSK (2018). The volume of the bund was approximately 2,000 m ³ .
Geology and environmental setting	The Site is underlain by Devensian age Diamicton Till over Pennine Lower Coal Measures Formation (PLCMF) of Carboniferous age according to published geological data. There is also likely to be made ground associated with former use. Not affected by radon. Not affected by coal mining. • Groundwater within Till classified as a secondary aquifer* • Groundwater within bedrock classified as a secondary aquifer* • No groundwater abstractions within the vicinity of the site. • The River Irwell was situated 203 m west of the site boundary. • A primary school (St John with St Mark C of E) is situated immediately beyond the northern boundary.
Site reconnaissance findings	The site comprised 17 plots of permanent caravans with 6 facility blocks. A significant soil bund surrounded the majority of the perimeter of the site, which varied in height from 0.50 m to 4 m. The highest point was in the southern corner of the site, with the general heights varying between 1.50 m and 2.50 m.
Geotechnical constraints assessment	Access was limited on site due to be currently occupied by travellers and limited areas of drilling works.

Initial conceptual site model (CSM) and preliminary risk assessment (PRA)	Potentially complete contaminant linkages on site include: • Made ground associated with former buildings and gravel pit on-site – future site users - oral, dermal and inhalation exposure with impacted soil, soil vapour and dust/fibres • Made ground associated with former buildings and gravel pit on-site – future buildings and services - direct contact with contaminated soils or groundwater and chemical attack • Made ground associated with former buildings and gravel pit on-site - groundwater in the underlying secondary aquifers within the superficial deposits and the bedrock – leaching and percolation through permeable strata to aquifer/ lateral and vertical migration of dissolved phase • Made ground associated with on-site previous buildings and infilled former gravel pit – future site users and future buildings and services - vertical migration and ingress of ground gases into buildings, build-up in confined spaces and explosion/ asphyxiation • Previous shallow underground mine workings more than 50 years since last worked below site - future site users and future buildings and services - vertical migration and ingress of ground gases into buildings, build-up in confined spaces and explosion/ asphyxiation • Made ground associated with the previous off-site gravel pit - future site users and future buildings and services - vertical migration and ingress of ground gases into buildings, build-up in confined spaces and explosion/ asphyxiation. Uncertainties and data gaps have been identified in the CSM at desk study stage: • gaps in available historical OS maps • access not available to the existing facility blocks or office • proposed service positions not known • previous investigation information is only available for the soil in the perimeter soil mounds. There are no previous investigations available for the rest of the site, therefore no information on actual concentrations of contaminants in soil and groundwater or ground gas at this stage • groundwater depth and flow direction are conceptual at this stage • proposed site levels and foundation solutions are unknown
INTRUSIVE INVESTIGATION & ASSESSMENT	
SI scope	6 window sample boreholes drilled to 6 m, with 5 ground gas monitoring wells. The purpose of the investigation was to determine the depth of made ground, as well as its composition, and assess whether the site was impacted by ground gases.

SI factual findings	The made ground was noted to comprise a recent and a pre-1930's made ground. The recent made ground comprised a varied deposit of clay and silty sand with much brick and gravel and varied in thickness from 0.50 m to up to 2 m. The pre-1930's made ground comprised almost exclusively of ash and clinker and was encountered within borehole BH2 underlying the recent made ground. Underlying the made ground was medium dense silty sand and silt (alluvium). Groundwater was noted to be confined to sand lenses within the silt and was deep during the ground gas monitoring programme.
Refined conceptual site model and geo-environmental assessment	The made ground was noted to contain elevated concentrations of metals and polycyclic aromatic hydrocarbons which will require mitigation for occupants within garden areas. Asbestos had also been encountered within the recent made ground, and this will require mitigation to protect residents within gardens as well as maintenance workers repairing services within the highways and private connections. Turn over proposed to recover as much of the bund materials and process the recent made ground to create a geotechnically suitable platform. A 0.60 m thick inert cover required for garden areas. Service corridor to be provided beneath highways and for private connections to protect maintenance workers. Protectorline potable water supply mains anticipated to be required. Pre-1903's made ground will require proof rolling. No ground gas mitigation required. As many soils are to be retained on site, with all unsuitable materials removed from site following screening for the turnover.
Geotechnical assessment	The proposed single storey modular units are anticipated to either be piled or rafted on the turned over materials. The piles to be adopted should not bring soils to surface.
Recommendations including issues for further assessment	No further investigation considered to be required. The works to reprocess the recent made ground overlying the site, as well as the made ground in the bund will require permitting and potential licensing beyond the mobile plant license. The works are anticipated to be undertaken under the CL:AIRE Code of Practice for the Definition of Waste. Assessment and a watching brief will be required during the processing of the made ground to confirm the consistency and to address any hot spots of contamination encountered.
<i>The information given in this summary is necessarily incomplete and is provided for initial briefing purposes only. The summary must not be used as a substitute for the full text of the report.</i>	



Site Name	Fernhill Traveller Caravan Park	NGR	SD 805117
Site Address	Every Street, Bury, BL9 5BL	Site Area	0.69ha (1.7 acres)

1 INTRODUCTION

1.1 Commissioning

RSK Environment Limited (RSK) was commissioned by Bury Council to carry out a geoenvironmental and geotechnical site investigation of the land at Fernhill Caravan Park, Every Street, Bury. The project was carried out to an agreed brief as set out in RSK's proposal (Ref. 11542 TL02(00), dated 09 February 2021).

RSK's service constraints are shown in [Appendix A](#).

The Site in question is being considered for the improvement and replacement of the existing residential traveller's site and its facilities.

1.2 Objectives

The objective of the work is:

- to identify any land contamination and/or geotechnical constraints to the proposed development and to support discharge of relevant planning conditions and relevant building control requirements
- to identify the need for any additional investigation or remediation works to demonstrate that the site is suitable for its proposed use

1.3 Scope of works

The scope of this assessment has been developed in accordance with relevant British Standards and authoritative technical guidance as referenced through the report. The assessment of the contamination status of the site is in line with the technical approach presented in Land Contamination Risk Management (LCRM) (Environment Agency, 2020) – which supersedes CLR11 Model Procedures for Land Contamination – and in general accordance with BS 10175: 2011 + A2 2017 (BSI, 2017). It is also compliant with relevant planning policy and guidance.

The scope of the intrusive investigation has been designed in line with the recommendations of BS5930:2015+A1:2020 Code of practice for ground investigations (BSI, 2020), which maintains compliance with BS EN 1997-1 and 1997-2 and their related standards. It has also been developed in general accordance with BS 10175: 2011 + A2 2017. Ground gas assessment has been undertaken in general accordance with BS8576: 2013 and BS 8485:2015+A1:2019.

A brief summary of relevant legislation and policy relating to land contamination is given in Appendix C.

The scope of works for the assessment has included the following:

- design and implementation of an intrusive investigation, in situ testing, soil sampling, laboratory geo-environmental and geotechnical testing, groundwater and ground gas monitoring of installed boreholes
- interpretation of data to develop a refined conceptual site model (CSM)

- generic quantitative risk assessment (GQRA) of relevant contaminant linkages
- interpretation of ground conditions and geotechnical data to provide preliminary recommendations with respect to foundations and infrastructure design
- preparation of this interpretative report

1.4 Existing reports

RSK are only aware of the following reports pertaining to the site:

- 1. Tergeo (March 2017). Travellers Site, Every Street, Bury, BL9 5BE. Ref: 0293_01
- 2. RSK (October 2018). 11151-R01(01). Traveller Site (Fernhill Caravan Park), Bury. Soil Assessment – GQRA.
- 3. RSK (October 2018). 11151-R02(00). Traveller Site (Fernhill Caravan Park), Bury. Soil Assessment – DQRA.
- 4. RSK (Dec 2020). 11542-01(00). Fernhill Caravan Park, Every Street, Bury. Preliminary Risk Assessment (PRA).

Pertinent information from these reports has been summarised in [Section 2.6](#), with the potentially complete contaminant linkages identified in the RSK 2020 PRA forming the basis of our initial conceptual understanding of site and thus, the basis of this report.

1.5 Limitations

This report is subject to the RSK service constraints given in [Appendix A](#) and limitations that may be described through this document.

2 SITE DETAILS

2.1 Site location

Site location details are presented in Table 1 and a site location plan is provided on [Figure 1](#).

Table 1: Site location details

Site name	Fernhill Caravan Park, Every Street, Bury
Full site address and postcode	Every Street, Bury, BL9 5BL

2.2 Site description

The Site boundary and current site layout are shown on [Figure 2](#). The Site covers an area of approximately 0.69 hectares. It is currently occupied by Fernhill Caravan Park, a residential site for travellers with 17 plots and six facility blocks.

The site is roughly rectangular in shape and access is gained via Every Street, along the central northern boundary. There was no site security at the time of the site visit, and the gates are open to the public.

Each individual plot was separated by wooden fencing secured with concrete posts, approximately 1.20 m high, and occupied plots contain a mobile caravan, which have a lounge and bedrooms that are used by the occupants. The facility blocks include a food preparation area with plumbing for washing, cleaning, and toilets.

2.3 Surrounding land uses

The site is located in Bury, within a predominantly industrial and commercial setting. Immediate surrounding land uses are detailed in Table 2.

Table 2 Surrounding land uses

North	Residential properties and a primary school
East	Industrial and commercial units with residential beyond
South	Industrial and commercial units
West	Waste transfer station with railway beyond

2.4 Development plans

The proposed layout of the site, at the time of preparing this report, is shown in [Appendix B](#).

Proposed development plans show that the entire site is to be demolished and the 17 individual plots are to be reduced to 12, including six single-storey double-facilities blocks,

around the margins of the site, with each block to be shared between two plots. There will still be an office building to the east of the site entrance in the north eastern corner of the site. Each plot will contain sufficient space for either one or two touring caravans, which will be used for sleeping and it will also have private soft landscaped areas.

No details of the proposed ground levels have been provided therefore for the purpose of this report it has been assumed that the current levels will remain unchanged.

No planning applications pertaining to this development were found on the Bury Council planning portal.

The desktop study was designed generally to meet the objectives of a preliminary (phase 1) investigation, as defined by BS 10175:2011 + A2 2017 (BSI, 2017) and this assessment relates to LCRM Stage 1, Tier 1 preliminary risk assessment. The "vicinity" of the site for the purposes of this report is defined as locations situated within an approximate 250 m radius of the site, although certain sources and/ or sensitive targets further than 250 m may also have been considered.

The study aims principally to identify and assess the potential risks and liabilities associated with contamination of the ground, on and in the vicinity of the site. While this includes consideration of current operations and housekeeping on the site, the report does not constitute a comprehensive environmental audit of the site, as covered under ISO 14001.

2.5 Site history

2.5.1 Historical development record

The development history of the site and surrounding area based upon assessment of historical plans and records is detailed in Table 3. The historical maps reviewed are shown within the environmental database report in [Appendix D](#).

Table 3 Summary of historical development

Date from	Date to	Historical Land Use (on-site)	Area of site
1850	-	Site noted to be situated within a field. No features on site.	Entire site
1893	1930	Western and central southern area of the site was noted to be part of a gravel pit, with most of the site noted as a Corporation Yard. The remainder of the site was open. In 1910 the westernmost part of the site appears to be infilled. The entire gravel pit is infilled by 1930.	Central and western parts
1910	1992	The alignment of Every Street is shown to the immediate north and a track from this street enters the Site and is aligned west to east. From the 1939 mapping, the road within the Site is no longer marked. A railway/tram line passed through the west of the site, and possibly connected the former gravel pit with an	North and south east

		industrial facility south of the Site. A path in the south east corner connects with an unnamed street	
1910	1999	Two small buildings were shown near the northern end of the railway/tram line and close to the edge of the gravel pit. From 1959, only one of the buildings remained. The railway/tram line was only shown on the 1910 map. From the 1959 mapping a track follows the alignment of the former [narrow gauge] railway line. From 1978 the site is marked in the area of a Council Depot	Centre
Date from	Date to	Historical Land Use (off-site)	Distance (m) and orientation
1893	1978	Gravel Pit (shown to be flooded)	20 m west
1893	Present day	'Refuse Destructor' (incinerator) with associated chimney. An expansion is shown on the 1910 map. In present day is licensed as a waste transfer station.	90 m north west
1893	Present day	Raised land to west, possibly associated with Refuse Destructor, which is to the immediate north of the land. Raised land covers the area of the former gravel pit, to the west of the site. This area is part covered in trees and rough grass and is labelled as Corporation Yard from 1959 to at least 1982. Area is referred to as a Refuse Destructor from the 1992 mapping.	15 m west
1893	Present day	Railway situated at a lower level in a cutting.	110 m west
1910	1930	Tanks (type not specified but possibly associated with railway and used for water for steam train boilers).	100 m west
1910	1978	A former disused Iron Foundry is now labelled Fernhill Chemical Works	130 m west
1930	1959	Saw Mill with Timber Yard	50 m north east
1930	Present day	Residential properties	60 m north
1939	1978	Allotment gardens	80 m north west
1959	1978	Allotment gardens	20 m north
1978	Present day	St John's C of E Primary School	20 m north
1850	1893	Open farmland	Surrounding the site
1893	Present day	Woollen Mills	100 m east, 150 m south east
1893	Present day	Hat/textile Works	200 m south east

1893	1978	Residential properties	Directly south east
1893	Present day	Unlabelled complex of buildings that appears to possibly be a works with a chimney. The chimney structure is no longer shown from the 1959 map	30 m south
Relevant information sources: Historical OS maps ☒ Town plans ☐ Information from the Local Planning Authority ☐ Aerial photography ☒ Previous reports ☐			
<i>Note: Reference to published historical maps provides invaluable information regarding the land use history of the site, but historical evidence may be incomplete for the period pre-dating the first edition and between successive maps.</i>			

The site was situated within an area noted to be a Corporation Yard, with a refuse destructor and chimney (incinerator) beyond the north western site boundary. It is anticipated that the bi-products of the incinerated waste were used to backfill the gravel pit which was present within the western and southern central area of the site, as well as beyond the western boundary. The gravel pit was not shown on the 1850 historical map, and extraction was completed prior to the 1890 map edition. The gravel pits were filled (omitted from the historical maps) by 1930. It is anticipated that the bi-products comprised predominantly ash and clinker with the potential for bottom furnace slag to be present.

The site was noted to be open land with two small structures present centrally on site between 1930 and 1939, and by 1959, several tracks were noted to cross the site. The Corporation Yard was shown within the area of the gravel pit beyond the western boundary. Between 1960 and 1982, the site, as well as the surrounding area appears to have been covered by hardstanding and incorporated within a Council depot.

Between 1984 and 1996, a traveller site had been established off Todd Street, immediately beyond the south eastern boundary. The Todd Street site was abandoned by 2000, and the site for redevelopment was occupied. According to a review of the images from Google Earth, an earth bund was present around the northern and north western boundary, as well as the north eastern, eastern, and south eastern boundaries from the establishment of the site. The bund appears unchanged from the 2000 to 2019 image. According to the topographic survey, the majority of the bund varies between 1 m and 2.50 m in height, with the greatest height being 4 m in the southern corner of the site.

The site of the former Todd Street traveller site was replaced with hardstanding between 2003 and 2005. Between 2012 and 2017, this area was utilised for material storage, waste tyres, crushing and material sorting plant, with soils being deposited on the depot land beyond the north eastern site boundary in the 2017 image. The site appears to have been used for the storage of cement mixers, articulated lorries, and vans.

A traveller site was also situated beyond the southern boundary between 2013 and 2017. The site beyond the north eastern boundary with soils being deposited was covered with hardstanding by 2019 and used to store Intermediate Bulk Containers (IBC's).

The land to the west of the site, was occupied by the Every Street waste transfer station (currently operated by Suez). Land to the south of the waste transfer station (south west of the site) was noted to have a large stockpile of material, which had been removed

between 2013 and 2017, and was subsequently shown to be used as a storage area for articulated trailers.

There has been significant landfilling on and around the site, predominantly associated with the incineration of waste in the refuse destructor. The source of the bund around the site is unknown, although this may be associated with the levelling of the site, but it is also clear that soils have been imported to adjacent sites and hence these may have contributed to the current landform.

Other historical land uses surrounding the site are unlikely to present a significant risk to the site's proposed development. Several of the industrial land uses utilised chimneys, which can sometimes disperse potential contaminants to areas downwind, however, RSK consider the risk to be negligible.

2.6 Summary of previous investigations

A summary of pertinent information from previous investigations is included below in Table 4.

Relevant information relating to the identified ground and groundwater conditions has not been included within the table below but has been incorporated into [Section 2.7](#).

Table 4 Summary of previous site investigation reports

Report Details	1. Tergeo (March 2017). Travellers Site, Every Street, Bury, BL9 5BE - (ref: 0293_01)
Site coverage	The report pertains to the soil mounds around the perimeter of the Traveller Site.
Summary scope of works	Nine holes were dug with a hand-held auger to a maximum depth of 2.50 m below ground level (bgl) on the top of the earth mounds. Soil samples were tested for volatile organic compounds (VOCs) and sent for laboratory chemical analysis.
Does the client have reliance upon the report?	Yes

Key factual findings	No evidence of VOCs was detected during fieldwork. A generic quantitative risk assessment (GQRA) was completed, and exceedances were found in three of the samples for TPHCWG and PAH compounds. Asbestos containing material (ACM) was detected in two of the 11 samples tested with concentrations of 0.006% and 0.062%. These concentrations are below the hazardous threshold for waste acceptance. However, the report concludes that although the detections of quantifiable asbestos in the soil samples is at low levels, these less than the lowest order of detection concentrations need to be considered where the material is to be excavated and redeposited as asbestos is still present within the sample. The conclusion was that the measured concentrations of PAH and TPH compounds do not exceed the thresholds significantly, indicating that there is likely to be a moderate risk presented to the residents if the soil is left in-situ and unmanaged (it is possible that harm could arise to a receptor from a contaminant).
Report Details	2. RSK (October 2018). Geo-environmental Assessment: Traveller Site (Fernhill Caravan Park), Bury (ref:11151-R01 (00))
Site coverage	This report was associated with the soil mounds around the perimeter of the Traveller Site, including within the back gardens of three of the plots.
Summary scope of works	17 holes were excavated with hand tools along the soil mound and in the narrow soft landscaped strips either side of the main road to a maximum depth of 0.40 m (HP01 to HP17) Three of the holes were excavated in the soil mound within the back gardens of three of the plots (plots 10, 15 and 17). 19 soil samples were collected from the 17 holes and analysed for a suite of contaminants including metals, pH, total organic carbon (TOC), polycyclic aromatic hydrocarbon (PAH) compounds, asbestos, TPH CWG and moisture content.
Does the client have reliance upon the report?	Yes
Key factual findings	A GQRA was undertaken. Chemical analysis results were compared to RSK's generic assessment criteria (GAC), which found there to be exceedances in three PAH compounds in the perimeter mounds (benzo(a)pyrene, benzo(b)fluoranthene and dibenzo(a,h)anthracene) plus four PAH compounds in individual plots (benzo(a)anthracene, benzo(a)pyrene,

	benzo(b)fluoranthene and dibenzo(a,h)anthracene), except Plot 10. Asbestos was encountered in two of thirteen shallow (<0.30 m) soil samples, with concentrations of below the laboratory method detection limit (LMDL) of <0.001.
Assessment and conclusions	It was concluded that risks to site residents due to asbestos were low. The potentially risks associated with PAH compounds which were considered to require further investigation or assessment were: a) direct contact (soil and dust ingestion and/or inhalation and dermal contact) with potentially contaminated shallow soils in the perimeter soil mounds by site residents b) direct contact (soil and dust ingestion and/or inhalation and dermal contact) with potentially contaminated shallow soils in the plots/landscaped areas adjacent to internal roadways by site residents
Report Details	3. RSK (October 2018). Soil Assessment – DQRA: Traveller Site (Fernhill Caravan Park), Bury (ref: 11151-R02 (00))
Site coverage	This report was associated with the soil mounds around the perimeter of the Traveller Site, including within the back gardens of three of the plots.
Summary scope of works	17 holes were excavated with hand tools along the soil mound and in the narrow soft landscaped strips either side of the main road to a maximum depth of 0.40 m (HP01 to HP17) Three of the holes were excavated in the soil mound within the back gardens of three of the plots (plots 10, 15 and 17). 19 soil samples were collected from the 17 holes and analysed for a suite of contaminants including metals, pH, total organic carbon (TOC), polycyclic aromatic hydrocarbon (PAH) compounds, asbestos, TPH CWG and moisture content.
Does the client have reliance upon the report?	Yes
Assessment and conclusions	The DQRA concluded that the soils surrounding the site do not pose a significant possibility of significant harm to human health and intervention under part 2A was not warranted. This was based on the current use of the site, likely activities at the site and observations made by RSK regarding use of the perimeter mounds.

Report Details	4. RSK (December 2020) Fernhill Caravan Park, Every Street, Bury. Preliminary Risk Assessment (ref). 11542-01(00).
Site coverage	This report relates to the entire site and was a desk study alone with no further ground investigation.
Summary scope of works	Review of the history of development on the site and surroundings, including a study of historical ordnance Survey mapping and other sources of historical information via an environmental database report. Assessment of local geology, hydrogeology and surface water setting, including the identification of potential geological hazards including mining etc. Assessment of the potential risks from past, present and future coal mining activities obtained from a Coal Authority Mining Report. Risk from unexploded ordnance (UXO). Completion of a site reconnaissance survey to assess the visual condition of the site. Development of an initial conceptual site model (CSM) identifying potential contaminant linkages for potential contaminants, completion of a preliminary risk assessment (PRA) and identification of key uncertainties and assumptions in the CSM. Preliminary consideration of geotechnical constraints and hazards Identification of the need for further action, e.g., intrusive investigations, where applicable.
Does the client have reliance upon the report?	Yes
Assessment and conclusions	Potentially complete contaminant linkages on site include: • Made ground associated with the infilling of the gravel pit on-site – future site users - oral, dermal and inhalation exposure with impacted soil, soil vapour and dust/fibres • Made ground associated with the infilling of the gravel pit on-site – future buildings and services - direct contact with contaminated soils or groundwater and chemical attack • Made ground associated with the infilling of the gravel pit on-site - groundwater in the underlying secondary aquifers within the superficial deposits and the secondary aquifer status bedrock– leaching and percolation through permeable strata. • Made ground associated with the infilled of the former gravel pit – future site users and future buildings and

	services - vertical migration and ingress of ground gases into buildings, build-up in confined spaces and explosion/ asphyxiation • Previous shallow underground mine workings more than 50 years since last worked below site - future site users and future buildings and services - vertical migration and ingress of ground gases into buildings, build-up in confined spaces and explosion/ asphyxiation • Made ground associated with the previous off-site gravel pit - future site users and future buildings and services - vertical migration and ingress of ground gases into buildings, build-up in confined spaces and explosion/ asphyxiation The following recommendations are made for an intrusive exploratory investigation at the site to address the risks identified above and/or to address remaining uncertainties: • A Coal Mining Risk Assessment is recommended to better understand potential risks from historical coal mining at and in the vicinity of the site • An intrusive ground investigation to assess the soil and groundwater conditions on site with subsequent production of ground investigation report • Chemical and geotechnical laboratory analysis of soils • A gas and groundwater monitoring programme An MMP and waste classification laboratory testing if soils are to be moved off-site.
--	--

2.7 Site setting

A summary of the site setting based on findings from previous site investigations and desk study information is presented in Table 5.

Table 5 Site setting

Geology	Published geological records report the Site is underlain by superficial deposits comprising Till (an undifferentiated aquifer). Beneath the Till is bedrock of the Pennine Lower Coal Measures (a secondary A aquifer). The 2018 RSK site investigation was limited to the raised bund within the majority of the boundary of the site and soft landscaped areas within three of the plots. This comprised topsoil, to approximately 0.10 m, over made ground to a minimum depth of 0.40 m. The made ground generally
----------------	--

	comprised dark brown gravelly sand with cobbles and 5-30% man-made constituents including plastic, brick, metal, ceramics, wood, asphalt and clinker. A historic BGS borehole (SD 81SW 210, approx.140 m east of site) indicates that the made ground is underlain by Till, to 6.80 m, and comprised brown clayey silty sandy gravels and gravelly silty clays. Bedrock was encountered at 6.80 m to a maximum proven depth of 7.30 m. According to the British Geological Survey Manchester sheet 85 (Scale 1:50,000), solid geology map, the bedrock comprises grey siltstone and mudstone with coal seams, dipping 6° to the south.
Hydrology	There are no ponds, streams, or drainage ditches on or adjacent to the site. The nearest identified surface watercourse to the site is the River Irwell, located approximately 222 m to the west of the Site according to the Groundsure report. The Environmental Database report identifies the Irwell as River Quality C category. The environmental database report indicates that there are 18 current licensed surface water abstractions within a 2 km radius of the site. The closest of these, which is located 529 m to the south west is utilised for hydroelectric power generation and is unlikely to impact the proposed site. Surface drainage from the site appears to be discharged into the underground drainage network. The indicative floodplain map for the area, shows that the site does not lie in an area at risk from flooding from rivers or the sea.
Hydrogeology	As the previous ground investigation was only associated with the investigation of the soil boundary bund, no assessment can be made regarding the groundwater. Given the varied nature of the superficial deposits, groundwater is likely to be present perched locally over low permeable strata. The historical BGS borehole log, reference SD81SW210, approx.140 m east of site, indicates no groundwater was found in the full depth of the 7 m borehole. Shallow groundwater in the site area is anticipated to flow in a south westerly direction, i.e., towards and in the direction of flow of the River Irwell. It is also likely that shallow water may be present in any made ground deposits present on-site. The nearby former mineshaft 100 m south east of the site, could potentially have an impact on current hydrogeology,

	including the potential for rebounding groundwater levels following the end of mining and associated dewatering (see mining and quarrying below). The environmental database report indicates that there nine active licensed groundwater abstractions within a 2 km radius of the site, none of which was public water supply boreholes. The nearest of which is 140 m east of the site, for P&S Textiles Ltd, ref: 2569001015, at Fernhill Mill, used for manufacturing.
Mining and quarrying	The site is located over Lower Pennine Coal Measures bedrock and may therefore have been affected by coal mining activities. An initial site appraisal based on the Coal Authority Interactive GIS system identified that the entire site is in a Development High Risk Area. According to the Coal Authority Consultants Report, reference 71007891158001, dated 16 June 2021 a filled mine shaft was located in 1975, 100 m south east of the site, ref: 380411-001. The only reference to coal seams was the Arley Coal seam (1.30 m thick) at a depth of 49 m (dipping at 3° to the south east) was last mined beneath the site in 1900 (pillar and stall). According to the report, the site is not affected by probable unrecorded shallow workings or spine roads at shallow depths. No further works are required associated with coal mining.

3 SITE INVESTIGATION STRATEGY & METHODOLOGY

3.1 Introduction

RSK carried out intrusive investigation works with subsequent monitoring and sampling of ground gases and groundwaters between March and June 2021. The intrusive works comprised window sample boreholes over 2 phases of works, having encountered difficult ground conditions during Phase 1.

3.2 Objectives

The specific objectives of the current investigation were as follows:

- to establish the ground conditions underlying the site which were not investigated previously, including the extent and thickness of made ground.
- to investigate specific potential sources of contamination identified in the initial CSM
- to determine groundwater depth and flow direction
- to confirm the ground gas regime underlying the site
- to assess geotechnical properties of soils, to inform future geotechnical designs
- to identify any hazardous properties in soils

3.3 Selection of investigation methods

The techniques adopted for the investigation were chosen with consideration of the objectives and site constraints, which are described below.

Window sampling was chosen to target shallow made ground, natural soils and groundwaters across the Site, at or adjacent to potential contaminative sources identified during the previous site investigation and the RSK 2020 PRA. A small-tracked window sampling rig was the only form of plant able to enter all areas due to restricted access. The rig facilitates rapid drilling of shallow boreholes, with in-situ testing, collection of disturbed samples and allows for the installation of gas monitoring wells. Temporary casing was used to keep the borehole open in loose soils and enable monitoring wells to be installed at their target depth.

Prior to conducting intrusive works, utility service plans were obtained, and buried service clearance undertaken in line with RSK's health and safety procedures.

During the preliminary stages of the desktop assessment for the site, the Consultant's Report provided by the Coal Authority, reference 51002333075002, dated 1 December 2020 stated that the Arley coal seam was situated at a very close shallow depth. When queried, the depth of 3 m to 29 m beneath the site as stated in the report, was increased to 49 m within their report reference 71007891158001, dated 16 July 2021 was issued. The Arley coal seam is a regionally important commercially sought seam which was recorded within the general area to be typically 1.30 m in thickness. The Coal Authority do not consider that the site is impacted by shallow mine workings (generally <30 m) and

hence further exploratory boreholes to determine the potential for worked seams is not considered to be required based on the report provided.

3.4 Investigation strategy

The ground investigation was carried out using intrusive ground investigation techniques in general accordance with the recommendations of BS5930:2015+A1:2020, which maintains compliance with BS EN 1997-1 and 1997-2 and their related standards. Whilst every attempt was made to record full details of the strata encountered in the boreholes, techniques of hole formation and sampling will inevitably lead to disturbance, limited mixing, or loss of material in some soils and rocks.

The investigation strategy involved non targeted and targeted boreholes. The investigation comprised an exploratory investigation, providing a good spread of locations across site to establish the ground conditions, including the extent and thickness of made ground which had been identified as a potential source of contamination in the initial CSM.

The constraints to the investigation were as follows:

- Restricted access to exploratory positions located in and around occupied plots
- Parked cars over most exploratory positions during both Phases 1 and 2.
- Breaking out concrete/asphalt via concrete coring.
- Difficult ground conditions encountered during Phase 1, resulting in slow progress.

Small-tracked drilling rigs were used to gain access to restricted areas. Boreholes positioned on concrete/asphalt were facilitated by a concrete core rig.

To avoid striking buried services and structures, a specialist utility surveyor was commissioned to ensure exploratory were scanned using EML and GPR, as well as a CAT scanner.

Details of the investigation locations, installations and rationale are presented in Table 6. The initial drilling work was undertaken on 9th March 2021, comprising 2 dynamic sampled boreholes (BH01 and BH03). The second phase for drilling was undertaken on 16th April 2021 and comprised 4 dynamic sampled boreholes (BH02, BH04-BH06). All boreholes were drilled to a maximum depth of 6.45 m bgl, with 5 boreholes installed with a combined gas and groundwater monitoring well. An exploratory hole location plan is shown on [Figure 2](#). BH07 was concrete cored but not drilled due to insufficient time and sufficient spatial coverage across site.

Table 6 Exploratory hole and monitoring well location rationale

Investigation type	Number	Designation	Monitoring well installation	Rationale examples below
Boreholes by dynamic/windowless sampling methods	5	BH01 to BH03, BH05, BH06	Gas/ groundwater	To determine the contamination status of the ground beneath the site and to install additional dual-

Investigation type	Number	Designation	Monitoring well installation	Rationale examples below
				purpose groundwater and gas monitoring wells

3.4.1 Implementation of investigation works

The exploratory holes were logged by an engineer in general accordance with the recommendations of BS5930:2015+A1:2020 (which incorporates the requirements of BS EN ISO 14688-1, 14688-2 and 14689-1).

The monitoring well construction and associated response zones are detailed on the exploratory hole records in [Appendix G](#). The response zones were installed to target identified gas generation sources or migration pathways detailed in the initial preliminary CSM. The installations within boreholes BH1 and BH3 started at or just below the made ground, to determine control sampling of the drift and whether ground gases were migrating (should they be present) from deeper areas of made ground beyond the site boundary within the underlying coal measures bedrock. Borehole BH2 had been drilled within the former gravel pit and encountered deep made ground, with the installation being constructed within the deeper ash and clinker (waste associated with the refuse destructor). Boreholes BH5 and BH6 were both installed entirely within the made ground; however, it should be noted that the base of BH5 included a section of core which had been noted as 'no recovery'. Obviously, core cannot disappear during drilling, although, it is considered that this stratum comprises a saturated fine sand which is lost during the recovery. The thickness of lost core in this instance is 0.60 m.

The soil sampling and analysis strategy was designed to characterise each encountered soil strata, permit an assessment of the potential contaminant linkages identified and investigate the geotechnical characteristics. In addition, samples were taken to allow for geo-environmental and geotechnical testing to be undertaken.

Soils collected for laboratory analysis were placed in a variety of containers appropriate to the anticipated testing suite required. They were dispatched to the laboratory in cool boxes under chain of custody documentation. Samples were stored in accordance with the RSK quality procedures to maintain sample integrity and preservation and to minimise the chance of cross contamination.

3.5 Monitoring programme

3.5.1 Ground gas monitoring

In line with the initial CSM, response zones, shown in Table 15, were installed to target the identified sources or pathways. Dual gas taps were installed in line with BS8576 at depths of at least 0.50 m above the ground water level recorded at the time of drilling.

Dual gas taps were utilised on site. Methane is lighter than air, but in the mixtures in which it is generally found in the ground, there is little difference in mass to air. Carbon dioxide is denser than air and will tend to collect in low points and depressions. Gases that differ in density can be stratified in a well. To allow for full gas circulation the standpipe was fitted

with a bung with two valves (in line with BS 8576). A pipe extended from one of the valves to the base of the borehole (or to just above the water table)

Six monitoring rounds have been undertaken to provide data to support refining of the CSM. The number of monitoring rounds undertaken is in general accordance with the decision matrix presented as Figure 6 of BS8576 for a very low (infilled gravel pit) to moderate (mine workings and shallow made ground) source generation potential and high sensitivity development.

A calibrated infrared gas meter (Geotechnical Instruments GA5000) was used to measure gas flow, concentrations of carbon dioxide (CO₂), methane (CH₄) and oxygen (O₂) in percentage by volume, while hydrogen sulphide (H₂S) and carbon monoxide (CO) were recorded in parts per million.

Initial and steady state concentrations were recorded.

The atmospheric pressure before and during monitoring, together with the weather conditions, were recorded. The monitoring included periods of falling atmospheric pressures and after/during rainfall.

All ground gas monitoring results together with the temporal conditions are contained within [Appendix H](#). Equipment calibration certificates are available on request.

3.5.2 Groundwater monitoring and sampling

Groundwater levels were monitored during each ground gas monitoring visit, and groundwater was sampled on one occasion.

Groundwater was noted to be very deep within all wells on site, and hence there was no requirement to circulate the groundwater present.

Depths to groundwater were recorded using an electronic dip meter on each of the return monitoring visits.

Groundwater samples were retrieved using a United States Environment Protection Agency (USEPA) approved low-flow purging and sampling methodology. Details of the low-flow sampling procedure are set out in [Appendix F](#). Water samples were dispatched to the laboratory in cool boxes under chain of custody documentation.

3.6 Laboratory testing

Laboratory testing was undertaken at a UKAS accredited laboratory with ISO17025 and MCERTS accredited test methods were specified where applicable for contamination testing and as shown in the laboratory test certificates appended.

3.6.1 Chemical analysis of soil samples

The soil sampling strategy was designed to characterise made ground and/or natural strata typically within the upper 1 m of the ground profile whilst also characterising deeper strata and the potential for contaminant migration from relevant sources of identified within the preliminary CSM.

The programme of chemical tests undertaken on soil samples obtained from the intrusive investigation is presented in Table 7 with the laboratory testing results contained in

[Appendix I](#). The suite of analysis below does not include the suites completed by both TerGeo and RSK for samples obtained from the bund surrounding the site, and this will be addressed later within the report.

Table 7 Summary of chemical testing of soil samples

Stratum	Tests undertaken	Number of tests
Made ground (MOT gravel)	Asbestos screening, metals, BRE sulphates, PAH USEPA 16, TPH CWG	1
Made ground (Clay)	Asbestos screening, metals, BRE sulphates, PAH USEPA 16, TPH CWG	3
Made ground (Silt)	Metals, BRE sulphates, PAH USEPA 16, TPH CWG	1
Made ground (Sand)	Asbestos screening, metals, BRE sulphates, PAH USEPA 16, TPH CWG, Total organic content	1
Made ground (Gravel)	Asbestos screening, metals, BRE sulphates, PAH USEPA 16, TPH CWG	1
Made ground (ash and clinker) – <1930's waste	Metals, BRE sulphates, PAH USEPA 16, TPH CWG	1
Natural – Silt	Metals, BRE sulphates, PAH USEPA 16, TPH CWG	2
Natural peaty/Clay	Metals, BRE sulphates, PAH USEPA 16, TPH CWG	3

3.6.2 Geotechnical analysis of soils

Due to the thickness of the made ground, the very low loading of the proposed structures for the site, and the anticipation treatment of the made ground to accommodate the bund material, no geotechnical analysis, beyond the chemical analysis to address sub surface concrete classification in accordance with BRE Special Digest SD1 was undertaken.

3.6.3 Infiltration testing

Due to the site being underlain by significant depths of made ground, infiltration testing was not undertaken, nor falling or rising head tests within the window sample boreholes drilled.

3.6.4 Chemical analysis of groundwater and surface water samples

Chemical testing undertaken on water samples obtained during the monitoring programme is presented in Table 8 with the laboratory testing results contained in [Appendix I](#). Groundwater samples were collected in containers appropriate to the anticipated testing suite required. The containers were filled to capacity and placed in a cool box to minimise volatilisation.

Table 8 Summary of chemical testing of water samples

Sample type	Tests undertaken	Number of tests
Groundwater	Metals, US EPA 16 PAH, TPH CWG	2

4 SITE INVESTIGATION FACTUAL FINDINGS

The results of the intrusive investigation and subsequent geo-environmental and geotechnical laboratory analysis undertaken are detailed below.

4.1 Ground conditions encountered

The descriptions of the strata encountered, notes regarding visual or olfactory evidence of contamination, list of samples taken, field observations of soil and groundwater, in-situ testing, and details of monitoring well installations are included on the exploratory hole records presented in [Appendix G](#).

The exploratory holes revealed that the site was underlain by a variable thickness of made ground between 0.50 m and 5.40 m.

For the purpose of discussion, the ground conditions encountered during the fieldworks are summarised in Table 9 with the strata discussed in subsequent subsections.

Table 9 General succession of strata encountered

Stratum	Exploratory holes encountered	Depth to top of stratum m bgl	Proven thickness (m)
Made ground (recent)	All	Beneath hardstanding	0.50 m to 1.90 m
Made ground (<1930's waste)	BH2	1.45 m	3.95 m
Interbedded very sandy SILT and silty SAND	All	0.50 m to 5.90 m	Base of boreholes 6.45 m to 7.45 m

4.1.1 Made ground

The made ground which is considered relatively recently deposited was generally encountered beneath a gravel stratum comparable to MOT road stone beneath a bitumen surface. In BH4, the thickness of bitumen was noted to be 0.55 m and was underlain by a significant thickness of gravel (0.50 m). The remaining boreholes either comprised a very sandy clay or a silty sand. Both were noted to contain fragmented concrete, brick, bitumen and tar, glass, wood, and clinker. Where the bitumen was encountered, there was a slight hydrocarbon odour. The maximum depth of recent made ground from existing ground level ranged from 0.50 m to 1.90 m.

Deeper seated made ground encountered within borehole BH2 was distinctly different from the recent deposits and comprised principally ash and clinker with steel fragments and was conjectured to be waste bi-product deposited within the former gravel pit from the refuse destructor (incinerator) that was present beyond the north western boundary.

The majority of made ground was noted to have low 'N' values from the Standard Penetration Tests (SPT's) completed, although several tests appear to have been impacted by gravel and cobbles.

The made ground within boreholes BH1 and BH4 were too shallow to undertake SPT's due to the service pit being taken to 1.20 m.

Borehole BH2 had one 'N' value within the recent made ground and was noted to be 25/50 for 20 mm which is indicative of encountering an obstruction which impacted the progress of the test. The deeper-seated ash and clinker made ground increased from 2 at 2 m, to 4 at 3 m, with single increment improvements until the base of the made ground (5 m) where an 'N' value of 6 was encountered.

Borehole BH3 encountered gravel and cobbles as the stratum for the SPT and encountered a very low 'N' value of 1, although 32 blows were recorded, which is indicative that the test was impacted by obstructions, as would be expected for this stratum.

Boreholes BH5 and BH6 both encountered clay made ground and recorded low density 'N' values of 4 and 9 respectively.

4.1.2 Variable cohesive and granular unit

The natural strata were encountered at a depth of between 0.50 and 1.90 below existing ground levels over the majority of the site; however, where the gravel pit was encountered within borehole BH2, the depth to natural stratum was 5.40 m. The strata were noted to comprise a soft and soft to firm / loose laminated clayey, very sandy silt or very silty sand. The units were highly variable in thickness and it is anticipated that there is likely to be more discrete variability with these strata than had been recorded within the visual assessment of the cores.

The 'N' values were all noted to increase with depth, and it should be noted that the horizons with no core recovery also recorded progressive values. The range of 'N' values are as noted below in Table 10:

Table 10 SPT 'N' Values and their representative stratum

Exploratory Position ref	SPT 'N' Values	Density	Depth
Borehole BH1	9 - 21	Medium dense	Full depth
Borehole BH2	20	Medium dense	5.40 m - 6.45 m
Borehole BH3	15 - 20	Medium dense	2 m – 6.45 m
Borehole BH4	6 - 8	Loose	1 m – 2 m
Borehole BH4	12 - 24	Medium dense	2 m – 6.45 m
Borehole BH5	4 - 14	Loose/Loose to medium dense	2 m - 4 m
Borehole BH6	7 - 22	Loose to medium dense	2 m - 3 m

Exploratory Position ref	SPT 'N' Values	Density	Depth
Borehole BH6		Medium dense	4 m - 6 m

4.1.3 Visual/olfactory evidence of soil contamination

The only odours recorded were associated within the recent made ground where bituminous materials were encountered. The odours are anticipated to be remnant diesel and polycyclic aromatic hydrocarbons associated with its use as a hardstanding but will be relatively immobile.

4.2 Groundwater and surface water

4.2.1 Groundwater encountered during intrusive works

Groundwater was encountered in 4 of the 6 boreholes, with boreholes BH2 and BH6 noted as being dry during drilling.

The majority of groundwater strikes recorded were situated within the silt. Borehole BH3 encountered groundwater perched within the made ground overlying natural clay.

Boreholes BH4 and BH5 encountered sections of missing core, which coincided with groundwater strikes. Although it is hard to prove, it is likely these are saturated sand lenses that collapse as the core is returned to the surface. The Standard Penetration Test 'N' values all indicate that this stratum was a medium dense sand.

4.2.2 Groundwater encountered during monitoring

Rest groundwater levels recorded during the monitoring programme are summarised in Table 11 based on the data provided in [Appendix H](#).

Table 11 Summary of groundwater monitoring results

Monitoring well	Response Zone Depths (m aOD begl)	Response zone stratum	Groundwater elevation (m begl) – min.	Groundwater elevation (m begl) – max.
BH1	1.00 m – 5.00 m	Sandy SILT and silty SAND	4.49	4.59
BH2	2.40 m – 5.40 m	Ash & clinker made ground	5.37	5.39
BH3	1.55 m – 6.00 m	Sandy SILT and a 0.9 5 m sand lenses	4.74	5.23
BH4	No Well Installed			
BH5	0.50 m – 2.50 m	Made ground, clay and saturated sand	1.9	2.25
BH6	0.50 m – 2.00 m	Clay made ground	2.5	2.51

For the duration of the ground gas monitoring programme, the groundwater within all the wells have been static. The greatest variation in groundwater level was noted in borehole BH3 in Round 5, with the first 4 visits having 0.27 m variability.

It should be noted that groundwater levels might fluctuate for a number of reasons including seasonal variations.

4.2.3 Visual/olfactory evidence of groundwater contamination

There was no evidence of groundwater contamination during the course of the ground investigation.

4.3 Chemical laboratory results

The soil and groundwater testing results are presented in Appendix I.

Asbestos was encountered within one of three samples where analysis was undertaken. It should be noted that as a routine precaution for the health and safety of laboratory staff, all samples undergo a basic assessment for the presence of asbestos. RSK were not notified about the presence of asbestos in any of the other samples.

4.4 Geotechnical laboratory results

No geotechnical analysis was undertaken due the proposed development and the anticipated methods of founding these structures.

4.5 Ground gas monitoring

The results of the ground gas monitoring and testing carried out are given in [Appendix H](#) and discussed in Section 5.

5 GEO-ENVIRONMENTAL ASSESSMENT

5.1 Refinement of initial CSM

The initial conceptual model for the potential risk of former land use is shown below in Table 12.

Table 12 Summary of sources for contamination

Potential sources	Contaminants of concern	Current or historical?
On-site		
Made ground (i.e. fill material) associated with the former buildings and earth mounds surrounding the Site	Unknown fill material but potentially including brick, ash and clinker and containing toxic and phytotoxic metals, inorganics, polycyclic aromatic hydrocarbons (PAHs), asbestos	Historical
Former gravel pit (c.1890s to 1930s)	Unknown fill material but potentially including brick, ash and clinker and containing toxic and phytotoxic metals, inorganics, polycyclic aromatic hydrocarbons (PAHs), asbestos	Historical
Off-site		
Surrounding industrial land uses including: Woollen Mills, Gravel Pit, Refuse Destructor, unspecified Tanks, Saw Mill	Various contaminants including petroleum hydrocarbons, PAHs, toxic and phytotoxic metals, inorganics, metals	Current and historical

The potential risk associated with ground gas were determined as below in Table 13.

Table 13 Summary of sources for ground gas

Potential sources	Indicative ground gas generation potential (CIEH, 2008)	Additional information
On-site		
Made ground associated with the infilled former gravel pit (1890s to 1930s)	Moderate	Infill material is unknown and could potentially generate ground gases
Mine workings more than 50 years since last worked	Moderate	Shallow mine workings have been reported below the site
Off-site		
Made ground associated with historic infilled gravel pit (1890s to 1970s), 20 m to west	Low/ moderate	Infill material is unknown and could potentially generate ground gases which could migrate to the site

The ground investigation largely confirmed the assumptions made within the initial conceptual site model (CSM). There were two forms of made ground, that conjectured prior to the 1930's formed from the combustion of waste within the former gravel pit, overlain by a site wide general cohesive and granular made ground of a more recent age.

Groundwater was deep on site and encountered as confined seepages within the alluvium silt at depth or within the granular made ground and was relatively static. Groundwater was not considered during the CSM.

It was conjectured prior to the ground gas investigation that due to the age of the made ground the likelihood that ground gas would be generated would be low. It should be noted that as the made ground would be formed by the bi-product of the waste destructor (incinerator) what little putrescible materials were disposed of at this time would have been burnt off. Carbon dioxide was considered the most likely form of ground gas present.

The ground gas monitoring completed on site determined that although carbon dioxide was present, the concentration encountered was both below the tier 1 threshold concentration of 5% for all bar one readings, with no ground gas flow recorded. Hence, ground gas is not considered to pose a risk to the development of this site.

All potential linkages associated with ground gas (associated with both made ground and coal mining) can therefore be dismissed as not relevant.

(incinerator) what little putrescible materials were disposed of at this time would have been burnt off. Carbon dioxide was considered the most likely form of ground gas present.

The ground gas monitoring completed on site determined that although carbon dioxide was present, the concentration encountered was both below the tier 1 threshold concentration of 5% for all bar one readings, with no ground gas flow recorded. Hence, ground gas is not considered to pose a risk to the development of this site.

All potential linkages associated with ground gas (associated with both made ground and coal mining) can therefore be dismissed as not relevant.

5.2 Linkages for assessment

As described in LCRM (Environment Agency, 2021), there are two stages of quantitative risk assessment (QRA), Tier 2 generic (GQRA) and Tier 3 detailed (DQRA). The GQRA comprises the comparison of soil, groundwater, soil gas and ground gas results with generic assessment criteria (GAC) that are appropriate to the linkage being assessed. This comparison can be undertaken directly against the laboratory results or following statistical analysis depending upon the sampling procedure that was adopted. This assessment relates to LCRM Stage 1, Tier 2 generic quantitative risk assessment

Following the refinement of the CSM, the potentially complete contaminant linkages that require further assessment and the methodology of assessment are presented in Table 14.

Table 14 Linkages for GQRA

Potentially relevant contaminant linkage	Assessment method
Soil data	
1. Oral, dermal and inhalation exposure with impacted soil, soil vapour and dust by future residents	Human health GAC in Appendix J for a proposed residential end use with home-grown produce since the proposed end use includes residential gardens. Consideration given to the applicability of the use of Statistical Assessment.
2. Inhalation exposure of future residents to asbestos fibres	Qualitative assessment based on the asbestos minerals present, their form, concentration, location, and the nature of the proposed development.
3. Uptake of contaminants by vegetation potentially impacting plant growth (phytotoxicity)	Comparison of soil data to GAC for phytotoxicity.
4. Contaminants permeating potable water supply pipes	Comparison of soil data to GAC in Appendix K for plastic water supply pipes using UKWIR (2010) guidance and the United Utilities Risk Assessment.
5. Leaching of soil contaminants and dissolved phase migration	Since no leachate data is available the potential for leaching has been considered qualitatively using soil and groundwater results.
Ground Gas	
1. Concentrations of methane and carbon dioxide in ground gas entering and accumulating in enclosed spaces or small rooms in new buildings, which could affect future site users. For methane this could create a potentially explosive atmosphere, while death by asphyxiation could result from carbon dioxide.	Borehole hazardous gas flow rates (Qhg) have been calculated using maximum (peak) methane and carbon dioxide concentrations and steady state flow rates in accordance with BS8485. This is subject to interpretation and use of professional judgement to designate the site or zones of the site characteristic situation by comparison to a Gas Screening Value (GSV) as appropriate and in line with the CSM. For applicable low-rise residential developments (with a pre-cast concrete floor system) reference to NHBC guidance has also been considered.

5.3 Methodology and assessment of soil results

The analysis of laboratory results relating to soil samples submitted for testing, including leachate analysis, is included in the following sections.

5.3.1 Oral, dermal and inhalation exposure with impacted soil by future occupants/site users

In order to assess the soil results against the appropriate GAC, the soil results have been split into appropriate data sets relevant to the oral, dermal and inhalation linkage.

The datasets being considered in the assessment are:

- data set 1a Made ground underlying the site.
- data set 1b Made ground within the bund surrounding the site.

As an initial assessment of each dataset, all soil results in each dataset have been directly compared against the GAC for residential with home-grown produce / residential without home-grown produce.

5.3.1.1 *Data set 1a – Made Ground underlying the site*

All made ground results have been compared with the residential with and without plant uptake GAC. A soil organic matter (SOM) of 1% has been selected since laboratory results within the made ground range from 1.07% and 11.5%. The soil screening output spreadsheet is presented as [Appendix L](#).

Of the 8 samples analysed, Borehole BH5 (1.95 m) and BH6 (2.30 m) were natural, and all other samples were made ground. Samples from boreholes BH2 (0.40 m), BH4 (0.80 m and 1.25 m), BH5 (0.90 m) and BH6 (0.60 m) were all sampled from what is regarded as more recent made ground. Borehole BH2 (1.55 m) was obtained from made ground which was pre-1930's and associated with infilling of the gravel pit from the waste destructor.

Using the most conservative assessment for human health risk assessment (residential with plant uptake 1% soil organic matter), both samples of natural strata were uncontaminated.

The **most recent made ground** was noted to have slight contamination associated with lead and zinc (phytotoxic threshold), asbestos (loose fibres and cement of chrysotile), polycyclic aromatic hydrocarbon (PAH) compounds (principally benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene, chrysene, dibenzo(ah)anthracene), with the shallow sample of BH6 encountering additional PAH compounds (indeno(123-cd)pyrene, naphthalene and phenanthrene).

Total petroleum hydrocarbon (TPH) compounds were encountered elevated above threshold concentrations also with the same samples with elevated concentrations of PAH compounds. All elevated compounds were aromatic phase and between C12-C16 and C21 to C35, which is anticipated to comprise predominantly of the PAH compounds already encountered rather than fuel.

A source signature double ratio plot had been completed to assess the potential source of the PAH compounds encountered, and all are associated with coal-based processes.

Deeper made ground (<1930's) within borehole BH2 was conjectured to comprise the bi-product of the waste destructor (ash and clinker). This stratum was noted to contain significant concentrations of arsenic (194 mg/kg), copper (1,440 mg/kg), lead (2,110 mg/kg), nickel (137 mg/kg) and zinc (1,100 mg/kg), although all concentrations of compounds within the TPH CWG and US EPA 16 suites were all negligible.

5.3.1.2 *Data set 1b – Made Ground within the bund surrounding the site*

There was also a bund within the boundary of the site. This was sampled by both Tergeo and RSK during 2017 and 2018.

The Tergeo investigation comprised 9 hand augered boreholes with 11 samples obtained from up to 2.50 m depth below the crest of the bund. All samples were analysed for the presence of asbestos, 5 samples were analysed for metals and BRE Special Digest SD1 compounds, 5 samples were analysed for TPH CWG speciated aliphatic and aromatic

compound, VOC and SVOC compounds, and 5 samples for phenols and cresols. It should be noted that although for most of the analysis 5 samples were selected, it is not necessary the same samples that have been analysed for all analytes. Asbestos was only encountered within 2 samples as fibres and clumps of chrysotile (0.062% BH2 at 2.00 m and 0.006% BH6 at 1.00 m).

Metals exceeded the threshold for human health with and without vegetable uptake for lead within 3 of the 5 samples, and the phytotoxic threshold for zinc in 1 sample. These were suitable for use at depth as general fill, but below 0.45 m from the base of topsoil (0.60 m from proposed surface), and hence will be suitable for use.

The hydrocarbon compound assessment determined that only BH1 at 1.00 m encountered elevated concentrations of aromatic compounds between the chain lengths C12 to C16, C16 to C21 and C21 to C35. As the PAH compounds are situated within this range of the elevated concentrations of TPH compounds, it was determined that rather being fuel derived, these were associated with the combustion of organic based materials, most likely in the form of ash and clinkers. Having completed a source signature ratio plot for the sample, this is also indicative of the source being combustion rather than fuel.

PAH compounds were noted to be elevated in all of the samples; however, the highest concentrations were in BH1 at 1.00 m. Compounds which exceed the human health threshold for use with plant uptake were phenanthrene (BH1 at 1.00 m), benzo(a)anthracene (BH1 at 1.00 m, BH2 at 2.00 m and BH9 at 2.50 m), benzo(a)pyrene and chrysene (BH1 at 1.00 m, BH2 at 2.00 m and BH9 at 2.50 m), and benzo(b)fluoranthene (in all 5 samples). The majority of the compounds and elements noted above also exceed the threshold for residential usage without plant uptake. Assuming the compounds are not liable to leach, all are within threshold to be utilised within general materials suitable to be engineered fill, with the exception of asbestos, which will require special mitigation measures to be adopted, and restrictions for placement to prevent contact with personnel who may repair services.

RSK (11151) excavated 17 shallow (<0.40 m) hand dug holes to recover samples from both the bund as well as the service strips either side of the road. Three of the exploratory holes were excavated within the bund which was present within the rear gardens of three plots. Nineteen samples were analysed and encountered exceedances in 3 PAH compounds in the perimeter mounds, including benzo(a)pyrene, benzo(b)fluoranthene and dibenzo(a,h)anthracene) plus 4 PAH compounds in individual plots, which include (benzo(a)anthracene, benzo(a)pyrene, benzo(b)fluoranthene and dibenzo(a,h)anthracene), except Plot 10. Two samples were noted to have a presence of asbestos; however, the concentration was less than detection using accredited methods (<0.001%). The form of asbestos was chrysotile board (HP2) and loose fibres (HP6).

There was correlation between the analysis undertaken between the Tergeo and RSK within the bund with regard to specific PAH compounds and metals which exceed threshold concentrations for residential end use. The only form of asbestos encountered was chrysotile.

5.3.1.3 Summary

The made ground present on site, both underlying the site and contained within the bund around the site boundary is not suitable to be present at the surface and accessible to

residents for the proposed end use as a caravan park. Mitigation measures, which will include segregation and sorting of materials will be required to allow those materials suitable to be retained on site to be recovered.

The made ground is not considered to pose a risk to the wider environment; however, it does pose a potential risk of harm to the end users of the development (residents) as well as maintenance workers who may be required to excavate where services are located.

It is recommended that all soft landscaping on site adopts an inert cover. The thickness of the inert cover should be 0.60 m, with a material separator/hard to dig at the boundary with the underlying made ground. The inert cover will comprise 0.15 m of topsoil, with underlying subsoil. Acceptable concentrations of elements and compounds within the topsoil and subsoil are presented in Appendix J.

All road corridors should be free of contamination which may impact maintenance workers who will repair services. The services are to be provided in clean channels, with a material separator (i.e., Terram woven sheet) between the made ground and the clean corridor. There should be a minimum of 0.50 m of clean material below the invert level of the deepest drainage (typically the foul). These works will be part of the turnover operation. All shallower service corridors for private supply will need to also be created, otherwise potentially contaminated soils will require disposal if to be completed during the build phase of the development. It should also be noted that should areas without mitigation measures be excavated post development, contractors may bring contaminated soils to the surface.

5.3.2 Inhalation exposure of future occupants/site users to asbestos fibres

Asbestos was encountered within both the made ground underlying the site, as well as the bund surrounding the site. The analysis of the soils has identified the asbestos to be chrysotile and present as both fibres and clumps, with one sample of chrysotile board.

The bund was noted to contain loose fibres/clumps between 0.006% and 0.062% by weight.

Mitigation measures will be required for both the handling of this material during the development phase of the site, as well as post development.

5.3.3 Uptake of contaminants by vegetation potentially inhibiting plant growth (phytotoxicity)

Phytotoxic metals were noted to be above threshold concentrations within the made ground, although below human health threshold concentrations. As the made ground requires remediation and mitigation due to other compounds and elements, the phytotoxic assessment becomes irrelevant and is addressed within the mitigation requirements.

5.3.4 Impact of organic contaminants on potable water supply pipes

For initial assessment purposes, the results of the investigation have been compared with the GAC presented in [Appendix J](#) for this linkage, which are reproduced from *UKWIR Report 10/WM/03/21. Guidance for the Selection of Water Supply Pipes to be used in Brownfield Sites* (UKWIR, 2010). The United Utilities Risk Assessment for water pipes has been partially filled out and is contained in [Appendix K](#).

The results indicate that a relevant linkage is likely to exist associated with organic contaminants due to polycyclic aromatic hydrocarbon compounds within the TPH CWG analysis. We anticipate that Protectorline or similar barrier pipework will be required for the potable water supply for this site. The site is to undergo a significant 'turnover' and hence the materials will be completely disturbed. As the site is to have an inert service corridor, the requirement for this form of potable protection maybe removed to standard PE piping; however, the threshold values as stated on the risk assessment must be achieved with imported aggregate.

5.3.5 Leaching of contaminants and dissolved phase migration to wider secondary aquifer*

Groundwater analysis of samples obtained from the boreholes did not indicate that mobile contamination is present.

5.4 Methodology and assessment of water results

5.4.1 Dissolved phase migration of contaminants to wider secondary aquifer*

The analytical results for groundwater samples obtained from boreholes BH1 and BH3 are below the relevant GAC protective of groundwater receptors indicating contaminant linkages to the wider aquifer associated with contaminants in the dissolved phase are incomplete. Groundwater is not considered to be impacted by contamination.

5.5 Ground gas risk assessment – bulk gases

5.5.1 Appropriate guidance

The risks to development from ground gases have been assessed in accordance with BS8485:2015+A1:2019 (BS8485), which provides guidance on ground gas (methane and carbon dioxide) characterisation and hazard assessment, as well as providing a framework for the prescription of protection measures within new buildings.

The process involves characterising the gas hazard from combining the qualitative assessment of risk (using the CSM) with ground investigation data so that a 'characteristic situation' (CS) can be derived for the site or zones within the site. Characteristic situations range from CS1 to CS6, the higher the CS, the higher the hazard potential. Gas protection measures within new buildings can be prescribed using a point scoring system, taking into consideration the CS and the proposed building type.

BS8485 indicates that the gas hazard can be characterised using the following methods:

- an empirical semi-quantitative approach using gas monitoring data to determine the 'characteristic situation' of the site (or zones of the site) and subsequent protective measures (Wilson and Card approach).
- an empirical semi-quantitative approach using TOC data to determine the 'characteristic situation' of the site (or zones of the site) and subsequent protective measures (CL:AIRE RB17 approach) or
- detailed quantitative assessment methodologies

For the purpose of this assessment, the empirical semi-quantitative using gas monitoring approach above has been used to characterise the gas hazard and provide advice on the protective measures likely to be required within new buildings at the site.

5.5.2 Summary of the refined CSM for ground gas

In the assessment of risks and selection of appropriate mitigation measures, BS8485 highlights the importance of the conceptual model. In summary, potential sources of ground gas within influencing distance of the site identified in [Section 5.1](#) comprise:

- Made ground (Recent) typically <2.00 m deep site wide – on site
- Made ground (<1930) – limited to the area of former gravel pit – on site.
- Made ground beyond the boundary – extensions to that noted above close proximity.
- Corporation Yard – on site
- Chemical works and multiple industrial works – former – situated within 200 m

The made ground derived from the waste destructor (incinerator) is considered to have a low potential for organic content due to the combustion process; however, carbon dioxide was a potential risk. The recent made ground appeared low in organic content and was also considered to have a low to moderate risk for carbon dioxide. There were no sources which would be considered as having ground gases under pressure/flowing within close proximity to the proposed site; however, certain industrial processes up hydraulic gradient may have mobile sources of contamination within the groundwater which may impact the site with regard to vapours, although this is considered unlikely.

Pathways and receptors for ground gas were identified in [Section 5.1](#). It is understood that building foundations are to include piles or raft with an integral floor slab.

This assessment has been undertaken to determine the risks to building structures and proposed end users. The assessment has not taken into consideration the health and safety of construction workers. Risks may still be present to construction workers especially where works include the entry into excavations within the ground. Construction workers should undertake appropriate risk assessments and risks should be managed through health and safety procedures and safe systems of work.

The risk assessment has been undertaken based on the current understanding of the CSM.

5.5.3 Empirical semi-quantitative approach using borehole monitoring data (Wilson and Card approach, BS8485)

5.5.3.1 Background

The empirical semi quantitative approach using gas monitoring data requires the designation of a gas screening value (GSV) for the entire site or zones within the site, which informs the hazard potential and associated prescribed ground gas protection measures within new buildings (where necessary). BS8485 defines the GSV as the '*flow rate (l/hr) of a specific hazardous gas **representative of a site or zone**, derived from assessment of borehole concentration and flow rate measurements and taking account of all other influencing factors, in accordance with a conceptual site model*'.

BS8485 Section 6.3.1 outlines the process for developing a GSV for the site or a zone as follows:

- borehole hazardous gas flow rate (Q_{hg}) is calculated for each borehole standpipe for each monitoring event. The borehole hazardous gas flow rate is defined in BS8485 as the '*flow rate of a specific hazardous gas, either methane or carbon dioxide, from a borehole standpipe*'. The Q_{hg} is calculated from individual borehole measurements of total gas flow and the concentration of the specific hazardous gas. BS8485 states in Section 6.3.4 that the **maximum** gas concentration recorded during the monitoring event should be used, together with **steady-state** values of gas flows.
- the reliability of the measured gas flow rates and concentrations are assessed taking into account borehole construction;
- decisions are made about how to deal with any temporal or spatial shortages in the data; and
- judgements are made about what GSV to designate for use for design purposes taking all relevant information and the conceptual site model into account.

Once the Q_{hg} has been calculated for methane and carbon dioxide, individual borehole measurements are compared to the thresholds presented in Table 2 of BS8485 which inform the CS that directly relates to each individual measurement. Taking into account the site data (i.e., borehole gas concentration and flow rate to calculate the Q_{hg}) and all other influencing factors in accordance with the CSM, a decision can then be made regarding the GSV that is considered to be representative of the site or a zone within it.

Typical threshold concentrations of methane (1% v/v) and carbon dioxide (5% v/v), and flow rates (>70 l/h), are also considered when designating the GSV for the site or zone, which in turn dictates the hazard potential and CS. It is important to note that the site or zone characteristic GSV and maximum concentration or flow thresholds are guideline values and not absolute. The thresholds may be exceeded in certain circumstances, if the CSM indicates it is safe to do so.

5.5.3.2 Designation of a GSV for the site or zone

The results of the ground gas monitoring and testing undertaken, alongside site conditions at the time of monitoring, are given in [Appendix H](#).

No wells were flooded or otherwise impeded in their construction or ground conditions. Groundwater was noted to be deep in all wells.

A summary of the maximum recorded concentrations per borehole (or minimum for oxygen) is presented in Table 9 overleaf. This table also presents details of the response zone, maximum recorded initial and steady state flow rates, and minimum recorded depth to water across all monitoring rounds.

The maximum concentration of methane and carbon dioxide encountered across the site was 0.1% by volume and 7.4% by volume respectively. Methane was only encountered at this trace level within boreholes BH3 and BH5 on one occasion, with all other readings being zero. Carbon dioxide was only encountered above the initial assessment threshold of 5% on one occasion (BH2 third visit) with the next highest concentration of 4.1% by volume within BH2 (fifth visit).

To assess the potential risk of ground gas the concentration encountered is divided by 100, then multiplied by the flow rate to derive the gas screening value (GSV). The worst-case ground gas situation using the worst-case concentrations/flows from across the site and not borehole/visit specific are as follows:

Methane

$(0.1\% \text{ by volume}/100) \times 0.2 \text{ l/hr} = 0.0002 \text{ l/hr}$

Carbon dioxide

$(7.4\% \text{ by volume}/100) \times 0.2 \text{ l/hr} = 0.0148 \text{ l/hr}$

As neither the methane or the carbon dioxide posed a risk and were classified as requiring Characteristic Situation 1 (CS1) ground gas mitigation measures for properties to be constructed on site, there is no requirement for zonation or any other form of delineation on site.

Table 15 Summary of ground gas monitoring results

Exploratory position ID	Response zone top (mbgl)	Response zone base (mbgl)	No. of monitoring rounds	Peak CH ₄ max. (%/vol)	Steady-state CH ₄ max. (%/vol)	Peak CO ₂ max. (%/vol)	Steady-state CO ₂ max. (%/vol)	Oxygen min. (%/vol)	Peak gas flow max. (l/hr)	Steady-state gas flow max. (l/hr)	Depth to water min. (m)	Depth to water max. (m)	Atm. pressure min. (mb)	Atm. pressure max. (mb)
BH1	1	6	6	0	0	3	3	8.9	0.2	0.2	4.64	4.74	974	1012
BH2	2.4	5.4	6	0	0	7.4	7.3	7.5	0	0	5.5	DRY	974	1012
BH3	1.55	6	6	0.1	0	2.9	2.9	1.4	0	0	4.84	5.33	974	1012
BH5	0.5	2.5	4	0.1	0	2.1	2.1	18.2	0.1	0.1	2	2.34	974	1012
BH6	0.5	2	6	0	0	3.8	3.6	7.6	0.1	0.1	2.61	DRY	974	1012

Borehole Response Zone Geology Unit

- BH1 - Loose to medium dense, light brown, slightly gravelly, very sandy SILT, and thick lenses of fine to coarse sand.
- BH2 - MADE GROUND Loose, dark brown, slightly silty SAND and GRAVEL
- BH3 - Soft to firm, orangish, brown, slightly gravelly, very sandy SILT
- BH5 - MADE GROUND Sandy, gravelly CLAY, and very soft organic clay (possible made ground)
- BH6 - MADE GROUND Sandy, gravelly CLAY

5.5.3.3 Summary of borehole hazardous gas flow rates


Borehole hazardous gas flow rates (Q_{hg}) have been calculated for each borehole standpipe, for each monitoring round and are presented, alongside two 'worst case' checks in [Appendix H](#) comprising a probable 'worst case' and potential 'worst case' from the available monitoring data. Within this data gas concentrations exceeding the thresholds presented in Table 2 of BS8485 are identified, alongside the CS that could be associated with each individual borehole monitoring event.

The majority of ground gas monitoring visits for all boreholes encountered zero ground gas flow recorded. The highest flow rate was 0.2 l/hr and was noted in borehole BH1 on one occasion. All other visits to this borehole encountered zero or -0.1 l/hr. For the worse case assessment, 0.2 l/hr should be adopted as the ground gas flow rate to assess the potential ground gas risk for this site.

During the period of monitoring (7 May to 18 June 2021), the atmospheric pressure was noted to vary between 974 mbars and 1012 mbars, with the initial two readings being less than 1,000 mbars. Borehole BH5 was the only installation not to be monitored six times, with four visits completed, one of which was completed during a period of atmospheric pressure below 1,000 mbars.

The closest weather station to the site was noted as IBURY40 (amateur station) situated on Fairlands Road, Bury (Latitude / Longitude: 53.612° N, 2.291° W, Elevation: 423 m aOD). The atmospheric pressure charts shown below for this weather station have arrows indicating monitoring dates. There were no readings taken between 10 and 20 May 2021 by the weather station.

Atmospheric pressure for May 2021 (no readings for 10 to 20 May 2021)

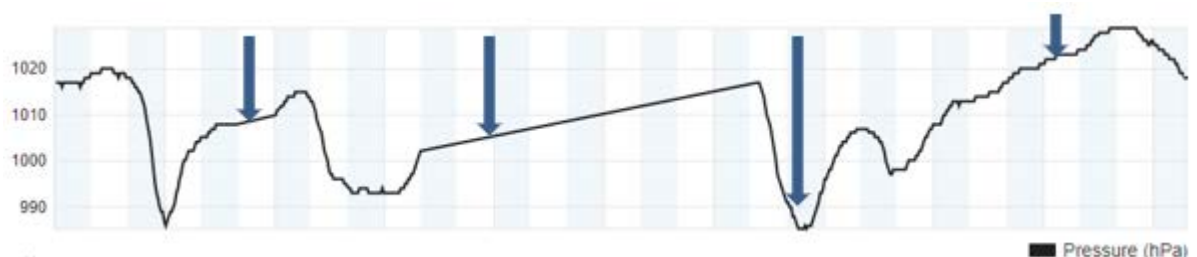

Atmospheric pressure for June 2021



(<https://www.wunderground.com/dashboard/pws/IBURY40/graph/2021-05-30/2021-05-30/monthly>)

According to the pressure charts, the third monitoring visit on the 21 May 2021 was undertaken during a deep period of very low pressure, with the first, fourth and fifth readings taken close to the peak high pressure, with the atmospheric pressure still rising.

Although due to the station being offline for a period of time the deep low pressure maybe erroneous.

5.5.3.4 *Consideration of negative flow rates*

Several very minor negative flow rates were encountered during the monitoring which may be associated with the borehole installation or minor fluctuations of groundwater.

5.5.3.5 *Data Limitations*

It should be noted that there are inherent limitations in ground gas monitoring including spatial adequacy of monitoring locations, changes in groundwater levels, variation in temporal or atmospheric conditions and whether these have been adequately characterised by the scope of monitoring undertaken.

The investigation undertaken to date has incorporated an appropriate number of ground gas monitoring visits, the data is considered reliable, and spatially representative of the site. It is also noted that 6 round(s) were completed during low and falling atmospheric pressure (<1000 mb) indicating that possible worst-case conditions have been present during monitoring.

5.5.3.6 *Trace gases*

Carbon monoxide and hydrogen sulphide are also monitored as part of this phase of the investigation.

No hydrogen sulphide had been encountered in any of the boreholes during monitoring.

Carbon monoxide had been encountered within all boreholes with concentrations ranging from 2.1ppm to 7.4ppm. Carbon dioxide is a colourless, odourless, tasteless gas which is generally associated with combustion. Typically, domestic carbon monoxide monitors have alarms set once concentrations reach between 50ppm and 300ppm (certificated BS EN 50291). It should be noted that those alarms sounding at lower concentrations than 300ppm where the gas is detected over a longer period of time. The 50ppm alarm is activated between 60 minutes and 90 minutes. The concentrations on site are not considered to pose a risk to the development.

5.5.4 **BS8485 recommended ground gas protection measures**

Case 1: CS1 classification

Based on the current understanding of the conceptual site model and the assessment undertaken, the site has been classified as CS1. In accordance with BS8485, ground gas protective measures are not considered necessary within proposed buildings.

5.5.5 **Application of NHBC Guidance**

The NHBC Guidance for ground gas is not relevant to this form of development as this risk assessment is only to be used where ground floor slabs comprise a screed, block and beam/pre-cast concrete ground floor slab system. These structures will not be constructed in this manner.

5.6 Uncertainties and implications in refined CSM and GQRA

In accordance with good practice, data gaps and uncertainties in the refined CSM have been identified at this stage. These are summarised in Table 16 along with the likely implications.

Table 16 Data gaps and uncertainties

Data gap/ uncertainty	Details	Implications
The full extent of the gravel pit has not been established	The former gravel pit was associated with deep made ground (<1930's)	Using the historical mapping it should be possible to determine the extent of the gravel pit as far as required. The depth of the gravel pit has not been confirmed. Should further confirmation be required additional boreholes will be required to delineate this feature.
The area of the bund as well as the sites of the current occupied units were inaccessible for investigation.	Restrictions to the area of the investigation.	Unforeseen ground conditions could be present within these areas; however, the investigation completed to date indicated consistent ground in accordance with that observed on the historical maps/
Low concentrations of asbestos were found in made ground samples tested	It should be noted that due to the location of the site and the origin of the more recent made ground being unknown, more asbestos may be encountered.	Vigilance should be maintained for any potential ACM or fibrous material during below ground works
Hydrocarbon contamination not identified in SI or monitoring works	This area was historically used as a Corporation Yard as well as a traveller site. There is the potential for localised hotspots of hydrocarbon contamination which have not been encountered to date.	The site will be remediation using a turnover solution, and hence any localised contamination may be identified and treated during the works.

6 PRELIMINARY WASTE ASSESSMENT

In accordance with the definition provided in the Waste Framework Directive (WFD), materials are only considered waste if 'they are discarded, intended to be discarded or required to be discarded, by the holder'. Naturally occurring soils are not considered waste if reused on the site of origin for the purposes of development. Soils such as made ground that are not of clean and natural origin (irrespective of whether they are contaminated or not) and other materials such as recycled aggregate, do not become waste until the criteria above are met. Further background information is provided in [Appendix F](#).

The site has a significant volume of waste present and comprises the following:

- Pre-1930's Incinerator waste – The former gravel pit appears to have been filled using the ash and clinker wastes from the refuse destructor that was present north west of the site.
- Post 1930's to circa 2000 – Generally thin layer of made ground approximately 2 m in depth. This made ground is anticipated to have derived from beyond the site boundary from unknown sources.
- Circa 2000 – Bund surrounding the site anticipated to be formed from a site scrape, with possible off-site sources contributing.

The site is not classified as a landfill site in accordance with the desktop searches.

To undertake a sustainable development, the client is proposing to retain as much material on site as possible. As such, the client is proposing to undertake a turnover process for the site within the most recent made ground (excluding the <1930 made ground) as well as the bund. This will remove any unsuitable material present, and breakup oversized granular units (such as concrete and brick wall sections). All unacceptable 'U' grade materials (Classes U1A, U1B and U2 in accordance with Volume 1, Specification for Highways Works, Series 600, Earthworks) will be removed from site. All remaining materials to be retained on site will be suitable for use to create a development platform and hence should not be considered waste.

Due to the potential for asbestos to be present within the made ground, all road corridors will be clean development strips, with inert cover required for soft landscaping which will require 100% importation.

Excavation arisings from the development may therefore be classified as waste if surplus to requirements or unsuitable for reuse. The following assessments assume the material tested is classified subsequently as waste.

6.1 Hazardous waste assessment

Technical Guidance WM3 (EA, 2018) sets out in its Appendix D requirements for waste sampling. It is a legal requirement to correctly assess and classify waste. The level of sampling should be proportionate to the volume of waste and its heterogeneity. The preliminary assessment provided below is based only upon the available sample results and may not be sufficient to adequately classify the waste.

6.1.1 Chemical contaminants

EnviroLab, an RSK company, has developed a waste soils characterisation assessment tool (HASWASTE), which follows the guidance within Technical Guidance WM3. The analytical results have been assessed using this tool to assess the hazardous properties to support potential off-site disposal of materials in the future. Note that it is ultimately for landfills to confirm what wastes they are able to accept within the constraints of their permit.

Two samples (HP8 and HP10) from the analysis undertaken by RSK of the bund were noted to have a concentration of hydrocarbon compounds which exceeded 1,000 mg/kg and are considered to exceed the threshold for **carcinogenic risk HP7**, and **mutagenic risk HP11**. These are anticipated to be associated with bitumen products within the bund. It should be noted that asbestos had not been quantified within this assessment, and asbestos containing materials had been recovered and identified. The hazardous waste threshold concentration is 0.1%. We anticipate that handpicking fragments will minimise the potential for asbestos concentrations to exceed this value.

Three samples (BH2 at 0.40 m, BH2 at 1.55 m and BH6 at 0.60 m) from the latest analysis undertaken by RSK from boreholes drilled across the site are considered to be hazardous waste for the same risk factors. It is anticipated that zinc also fails the threshold within BH2 at 1.55 m.

It should be noted that hydrocarbon compounds are considered to comprise polycyclic aromatic hydrocarbon compounds and are likely to diminish through the processing of the soils. The concentrations which have been recorded are all compliant for soils to be situated at depth (0.45 m>)

6.1.2 Asbestos within waste soils

Technical Guidance WM3 requires that within a mixed waste the separately identifiable wastes be assessed separately.

For instance, where waste soil contains identifiable pieces of asbestos (visible to the naked eye) the asbestos should, where feasible, be separated from the soil and classified separately. This should be disposed of within a hazardous, stable non-reactive hazardous waste landfill or a special cell in a non-hazardous waste landfill.

6.1.3 Processing Soils for Reuse

The process of turning over this site will require a temporary mobile plant licence to undertake the works. Depending upon the amount of asbestos encountered, this may also be potentially licensable or non-notifiable works.

It will be for a competent contractor to obtain all the required licenses and permits to ensure that the proposed works are undertaken within the current legal and regulatory frameworks.

It will be for the contractor to prove that through the process of sorting the made ground, all unacceptable materials have been removed and those materials remaining on site are suitable for reuse and hence no longer should be considered waste.

The processing of the soils will create a geotectonically suitable development platform, with sterile corridors (within a Terram wrap) to mitigate the risk of service contractors coming into contact with soils which may contain asbestos fibres.

The proposed foundation option (piles or semi-stiff raft foundation) will require confirming prior to the turnover being undertaken as there are different requirements for proposed ground levels during this operations with the different build types. Typically for piling projects a piling blanket will be required, although the turnover may create a surface suitable for lower loaded piling rigs. A specific pile blanket calculation will be required depending upon the plant to be used and the ground conditions.

Ground levels are anticipated to require raising around the areas piled, due to cropping of surplus lengths, capping and the construction of the associated ground beam.

Raft foundations are integral units which have a shallow toe and are typically founded 1.0 m below finished floor level (0.8 5 m below proposed ground level), and hence this will be remediation platform level for turn over works.

A full remediation proposal for the turnover operation will be required.

6.2 WAC assessment

Waste Acceptance Criteria (WAC) Assessment tests have not been completed on this site, as these should be undertaken on stockpiles of material for disposal.

It is intended to reuse the majority of the soils, although unacceptable materials will be stripped out of the soil mass for specific waste streams for disposal. It is anticipated that, assuming approximately 30% of the surrounding bund consists of unacceptable materials, there should be a rough balance of materials to maintain, although considering the location of the site, should there be a surplus, it is not anticipated that a rise in ground level will impact on the development or the surrounding industrial area.

A full cut and fill model will be required, as well as the assessment for foul drainage requirements of the site to determine the minimum finished ground levels for this site.

WAC Analysis should be undertaken on any surplus soils on site for disposal.

7 GEOTECHNICAL ASSESSMENT

7.1 Proposed development

It is understood that the proposed development is to involve the construction of six pairs of semi-detached, single storey modular units and associated infrastructure, as well as a single storey gatehouse/office.

At this stage no specific information relating to building loads has been provided and therefore a bearing capacity of 50kN/m² has been considered. It has been assumed the units will be either situated on a semi-stiff integral raft or ground beams supported on piles.

7.2 Key geotechnical hazards / development constraints

The key risk identified from the available ground investigation data are discussed below:

- Differential settlement from a variable depth and consistency of made ground

7.3 Foundations

7.3.1 Foundation options

As the site will be turned over, a competent development platform will be created which will be sufficient to support a 50kN/m² bearing capacity load.

It will be a commercial decision as to whether the modular units will be founded on a semi-stiff integral raft or piles. The development is to be a design and build contract whereby the modular unit developers will determine which foundation will be adopted. It should be noted that raft foundations will require modification to address noise transmission between the semi-detached units if adopted, although as these are a non-standard construction consultation with either Premier Guarantee or the NHBC will be required. It should be noted that usually noise transmission is addressed in the robust details for the proposed structures.

The raft foundations must be designed by a Structural Engineer, and we anticipate that one design will be sufficient for this site as all units will be identical. By using semi-stiff rafts in lieu of standard stiff rafts, groundworks contractors should be able to construct all aspects of this structure without the requirement of steel fixers.

Should piles be adopted, these may comprise micro-piles, standard pre-cast concrete piles, screw piles or reverse flight auger piles (to avoid bringing potentially contaminated soils to the surface). The pile design should be completed by the piling contractor and will be dependent on structural loadings.

The depth and number of piles cannot be determined at this stage without maximum line loads known. Deeper boreholes would be recommended to confirm the depth of silt underlying the site and the presence of more competent ground for the deeper-seated piles.

The development platform should be suitable to be considered as a piling blanket.

It should be noted that solutions such as screw piles are outside the scope of standard piling and their design will be specific to the contractor.

7.3.2 Foundation works risk assessment

It is anticipated that a foundation works risk assessment report will not be required for the development because:

- the type of foundation/ ground improvement method* proposed does not have the potential to create preferential pathways for migration of ground gas to surface or groundwater to depth
- there are no identified ground gas sources present at depth that could be affected by the type of foundation and ground improvement method proposed

7.3.3 Floor slabs

INTEGRAL

Should semi-stiff raft foundations be adopted, these are integral units whereby the ground floor slab is tied into the footing forming the toe. These will be cast in situ, and situated on proof rolled, compacted made ground.

CAST IN-SITU CONCRETE SLAB

Either a cast in situ or pre-cast concrete suspended ground floor slab will be supported on ground beams for the piles. The ground beams may be pre-cast or cast in situ concrete and will be designed by the piling contractor with approval by the Structural Engineer.

7.4 Roads and hardstanding

The contractor who will be undertaking the turnover for the proposed development will be creating sterile road corridors suitable for services.

It is assumed this will be an adoptable highway and a minimum CBR of 5% will be present 0.60 m below the proposed top of road level and built up with suitable capping in accordance with Local Authority requirements.

The sub-grade condition at the time of construction should be confirmed by testing at the final formation level by in situ CBR and plate loading tests.

7.5 Excavations for foundations and services

It is not possible to observe the short-term stability of side walls where boreholes are drilled. It is therefore recommended to assume that side walls of excavations will be unstable in the short term and hence excavation support systems are utilised during the groundwork stage of the development. No manned entry is permitted to excavations unless appropriate temporary works are adopted to support the sides (with associated gas monitors).

Confined spaces protocols for the Health and Safety of personnel should always be used where man entry into excavations is to be undertaken as low oxygen conditions may be present.

Dewatering maybe required for deep excavations, with localised removal of infiltrated and surface water inflow from shallow to medium depth excavations. Sump excavations maybe prudent to allow localised dewatering.

Excavation should be possible using conventional site plant. Breakers may be necessary to remove any concrete obstructions within the made ground.

7.6 Chemical attack on buried concrete

This assessment of the potential for chemical attack on buried concrete at the site is based on BRE Special Digest 1: Concrete in aggressive ground, which represents the most up-to-date guidance on this topic currently available in the UK.

The desk study and site reconnaissance indicate that, for the purposes of assessing the aggressive chemical environment of the site, the site should be considered as comprising brownfield ground unlikely to contain pyrite.

Based on chemical analysis completed on the samples obtained during the window sample drilling over the site, and omitting the soil analysis in the surrounding bunds, Table 17 gives the characteristic pH, water-soluble and total sulphate content values for soils from each of the geological units and groundwater encountered on-site. As the soils are not considered to contain pyritic materials, there is no reason to consider the total potential sulphate results.

Table 17 Characteristic pH, water soluble sulphate and total sulphate values

Stratum	Number of Samples	pH	Water Soluble Sulphate (mg/l)	Total Potential Sulphate (mg/l)
Recent made ground	4	6.92 – 8.1	<0.01 – 0.09	<200 – 770
<1930 made ground	1	7.31	0.07	1,300
Alluvial Clay	2	7.09 – 7.74	<0.01	<200 - 230

Based on the results above and following the steps outlined in the BRE guidance, the Design Sulphate Classes and Aggressive Chemical Environment for Concrete classifications are summarised in Table 18 on the basis of water-soluble sulphate.

The groundwater within the made ground has been assessed as being static, as a significant proportion was either a silty granular strata, or a clay. There are granular layers which may be classified as mobile; however, the static assessment is the most onerous.

Table 18 Concrete design class

Stratum	Groundwater	DS Class	AC Class	DC Class
Made Ground	Static	DS-1	AC-1s	DC-1
Alluvial Clays	Static	DS-1	AC-1s	DC-1

7.7 Infiltration drainage

It is unlikely, due to the thicknesses of made ground on this site, that soakaway pits for surface water drainage will be permitted and will require discharge to the surface water drainage system, although small scale SuD's schemes such as permeable paving may be permitted.

8 CONCLUSIONS AND RECOMMENDATIONS

8.1 Geo-environmental assessment

Based on the results of the site investigation and GQRA, the contaminant linkages that have been identified to be potentially complete (relevant contaminant linkages) and to require further action are:

- Elevated concentrations of metals, PAH and TPH compounds as well as asbestos (chrysotile).
- No ground gas mitigation required.

It is proposed to turn over the upper 2 m of the site and utilise the material contained within the bund (once screened and sorted for suitable material) to form a development platform. All road corridors and private supplies will be contained within clean corridors to a depth of 0.50 m below the invert of the deepest sewer (assumed foul). The corridor will have a woven geotextile to prevent material mixing.

For all landscaping, 0.60 m inert cover will be required, comprising 0.15 m of topsoil and 0.45 m subsoil.

Soils were noted to be potentially hazardous waste due to elevated concentrations of metals as well as hydrocarbon compounds (anticipated to be PAH compounds). Asbestos has not been identified as being a component of hazardous waste; however, asbestos maybe present within the bund at above 0.1% and not encountered to date.

Protectorline potable water supply barrier pipework anticipated to be required.

8.2 Geotechnical assessment

The site is to be turned over to create a development platform for the proposed properties. This will be designed to at least 50kN/m² bearing capacity to accommodate either the semi-stiff raft foundations with integral ground floor slabs or piles.

8.3 Recommendations

No further investigation considered to be required.

The works to reprocess the recent made ground overlying the site, as well as the made ground in the bund will require permitting and potential licensing beyond the mobile plant license. The works are anticipated to be undertaken under the CL:AIRE Code of Practice for the Definition of Waste.

Assessment and a watching brief will be required during the processing of the made ground to confirm the consistency and to address any localised areas of contamination encountered.

REFERENCES

Previous SI reports and other site related information

Tergeo, Travellers Site, Every Street, Bury, reference 0293_01, March 2017

RSK, Geoenvironmental Assessment: Traveller Site (Fernhill Caravan Park), reference 11151-R01 (00), October 2018

RSK, Soil Assessment - DQRA: Traveller Site (Fernhill Caravan Park), reference 11151-R02 (00), October 2018

RSK, Preliminary Risk Assessment: Traveller Site (Fernhill Caravan Park), reference 11542-R01 (00), December 2020

Coal Authority, Consultants Report, reference 71007891158001, dated July 2021

Landmark Report, reference 269841542_1_1, dated 1 December 2020.

Standards and guidance

AGS Interim Guidance (2013), 'Site investigation and asbestos risk assessment for the protection of site investigation and geotechnical laboratory personnel', February.

Baker, K., Hayward, H., Potter, L., Bradley, D. and McLeod, C. (2009), CIRIA Report C682. The VOCs Handbook. Investigating, assessing and managing risks from inhalation of VOCs at land affected by contamination.

Boyle, R. A. and Witherington, P. J. (2007), 'Guidance on Evaluation of Development Proposals on Sites where Methane and Carbon Dioxide are Present', National House-Building Council and RSK Group.

British Standards Institution (BSI) (1990), 'BS 1377:1990. Methods of test for soils for civil engineering purposes'.

British Standards Institution (BSI) (2020), 'BS 5930:2015+A1:2020. Code of practice for ground investigations'.

British Standard Institution (BSI) (2019), 'BS 8485:2015+A1:2019. Code of practice for the design of protective measures for methane and carbon dioxide ground gases for new buildings'.

British Standards Institution (BSI) (2011), 'BS 10175:2011 + A2:2017. Investigation of potentially contaminated sites: Code of practice'.

British Standards Institution (BSI) (2013), BS8576:2013. Guidance on investigations for ground gas – permanent gases and volatile organic compounds (VOCs).

Building Research Establishment (2005), BRE Special Digest 1: Concrete in aggressive ground.

Card G, Wilson S, Mortimer S, (2012). A Pragmatic Approach to Ground Gas Risk Assessment. CL:AIRE Research Bulletin RB17. CL:AIRE, London, UK. ISSN 2047- 6450 (Online).

Chartered Institute of Environmental Health (CIEH), (2008), The Local Authority Guide to Ground Gas. Wilson, Card and Haines, September 2008.

CIRIA (2014). Good practice on the testing and verification of protection systems for buildings against hazardous ground gases.

Environment Agency (2018), 'Technical Guidance WM3. Guidance on the classification of and assessment of waste, 1st Edition, v.1.1, May 2018.

Environment Agency (2020), Land contamination risk management,
<https://www.gov.uk/government/publications/land-contamination-risk-management-lcrm>, 8
October 2020

National House Building Council (NHBC) (2016), Technical Extra, April 2016.

Norbury, D. (2010), Soil and Rock Description in Engineering Practice.

Part IIA of the Environmental Protection Act (Contaminated Land Regulations (England)) 2002.

Rudland, D. J., Lancefield, R. M. and Mayell, P. N. (2001), CIRIA C552. Contaminated Land Risk Assessment: A Guide to Good Practice.

Stone, K., Murray, A., Cooke, S., Foran, J., Gooderham, L., (2009) CIRIA C681, Unexploded Ordnance (UXO). A guide for the construction industry.


Transport and Road Research Laboratory, (1970), 'TRRL Road Note 29 (Appendix 1). Road pavement design'.

Transport and Road Research Laboratory (1984), 'TRRL Report LR1132 (Table C1)'.

UK Water Industry Research, (2010), UKWIR Report 10/WM/03/21. Guidance for the Selection of Water Supply Pipes to be used in Brownfield Sites.

FIGURES

FIGURE 1 SITE LOCATION PLAN

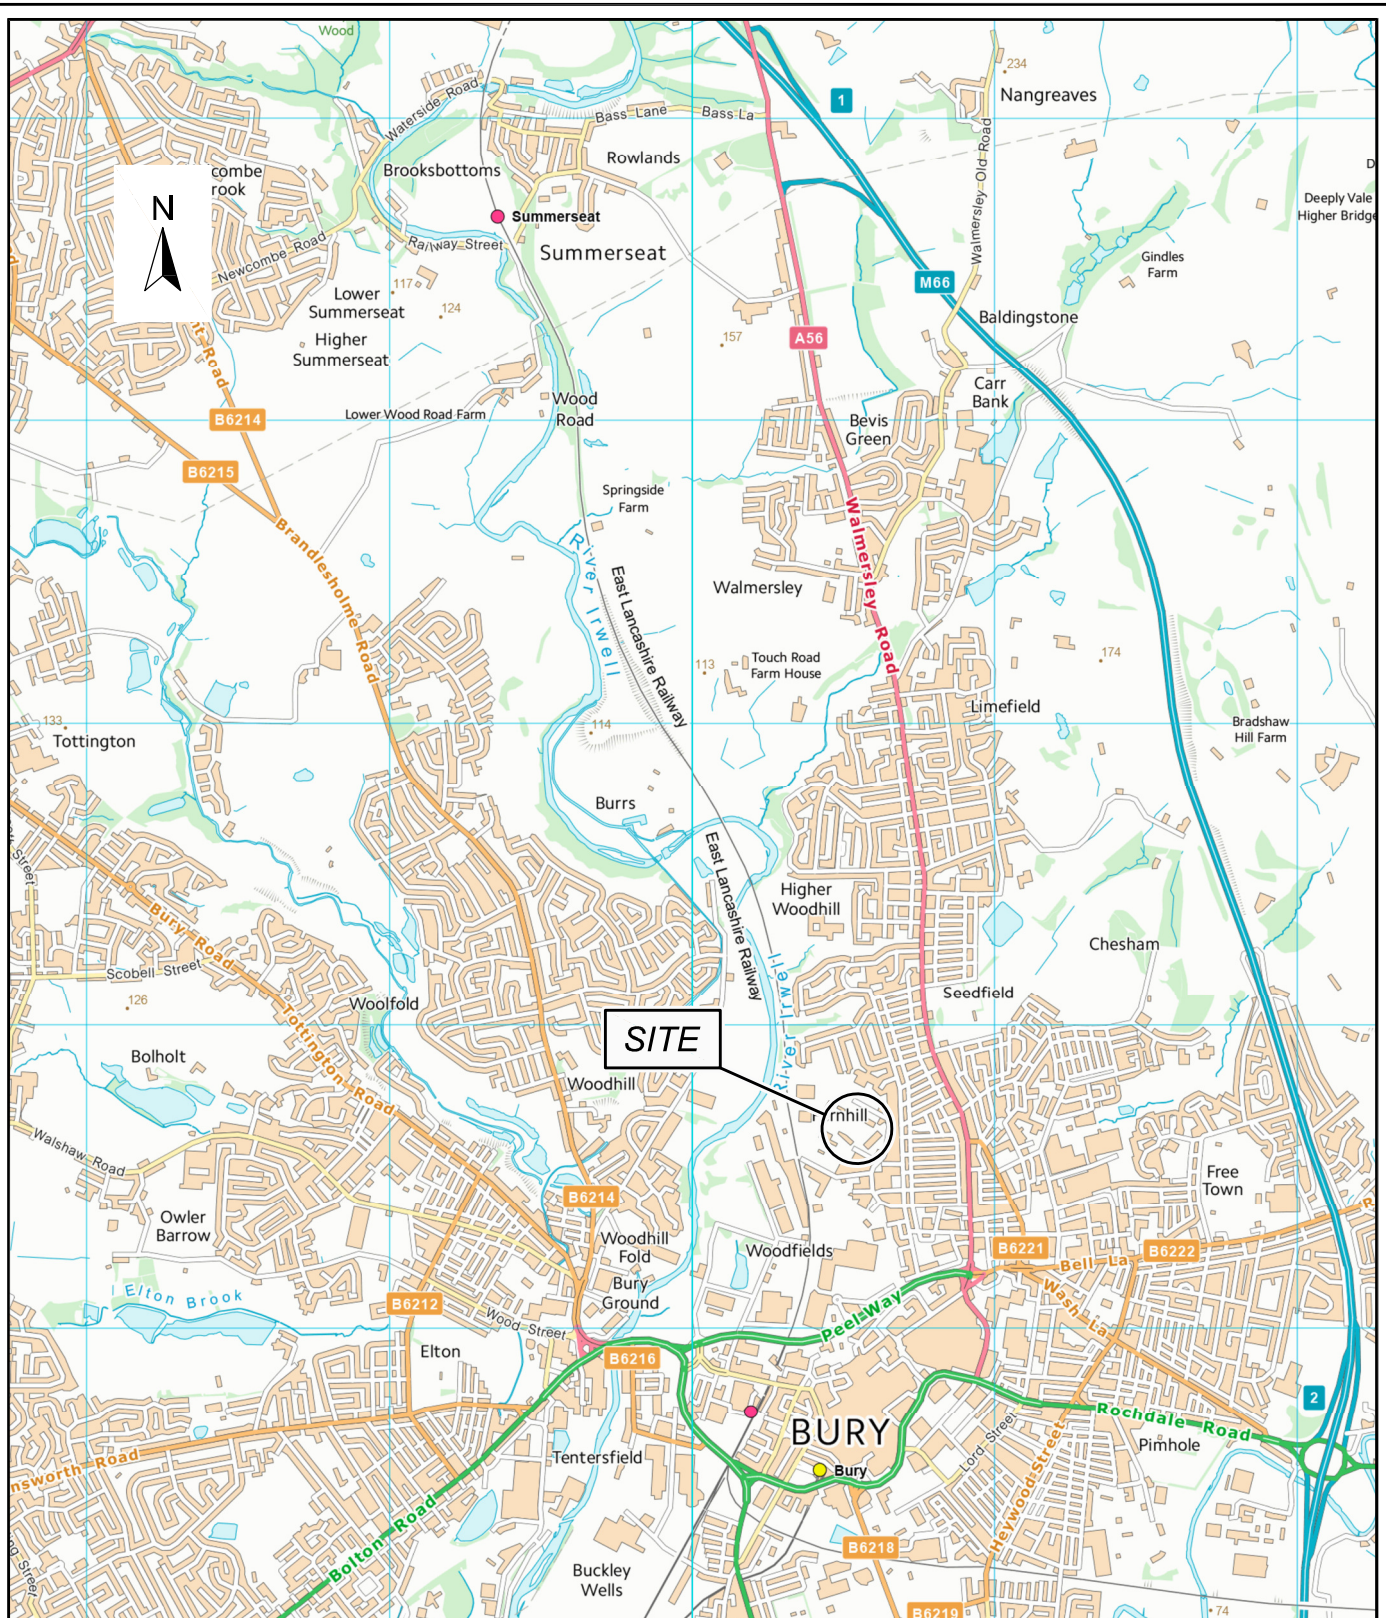

Contains Ordnance Survey data © Crown copyright and database right 2013



The Old School,
Stillhouse Lane,
Bedminster,
Bristol,
BS3 4EB

Tel: +44 (0)117 947 1006
Email: info@rsk.co.uk
Web: www.rsk.co.uk

Client

Bury Council

Project Title


Fernhill Caravan Park, Every Street, Bury

Drawing Title

SITE LOCATION MAP

Rev	Drawn	Date	Checked	Date	Approved	Date
00	NP	09.12.20	LB	09.12.20	-	-
Dimensions		Scale		Original Size		
m		1:25,000		A4		

Project Number	Grid Ref
11542	SD 804 117



Drawing Number
FIGURE 1

FIGURE 2 EXPLORATORY HOLE PLAN

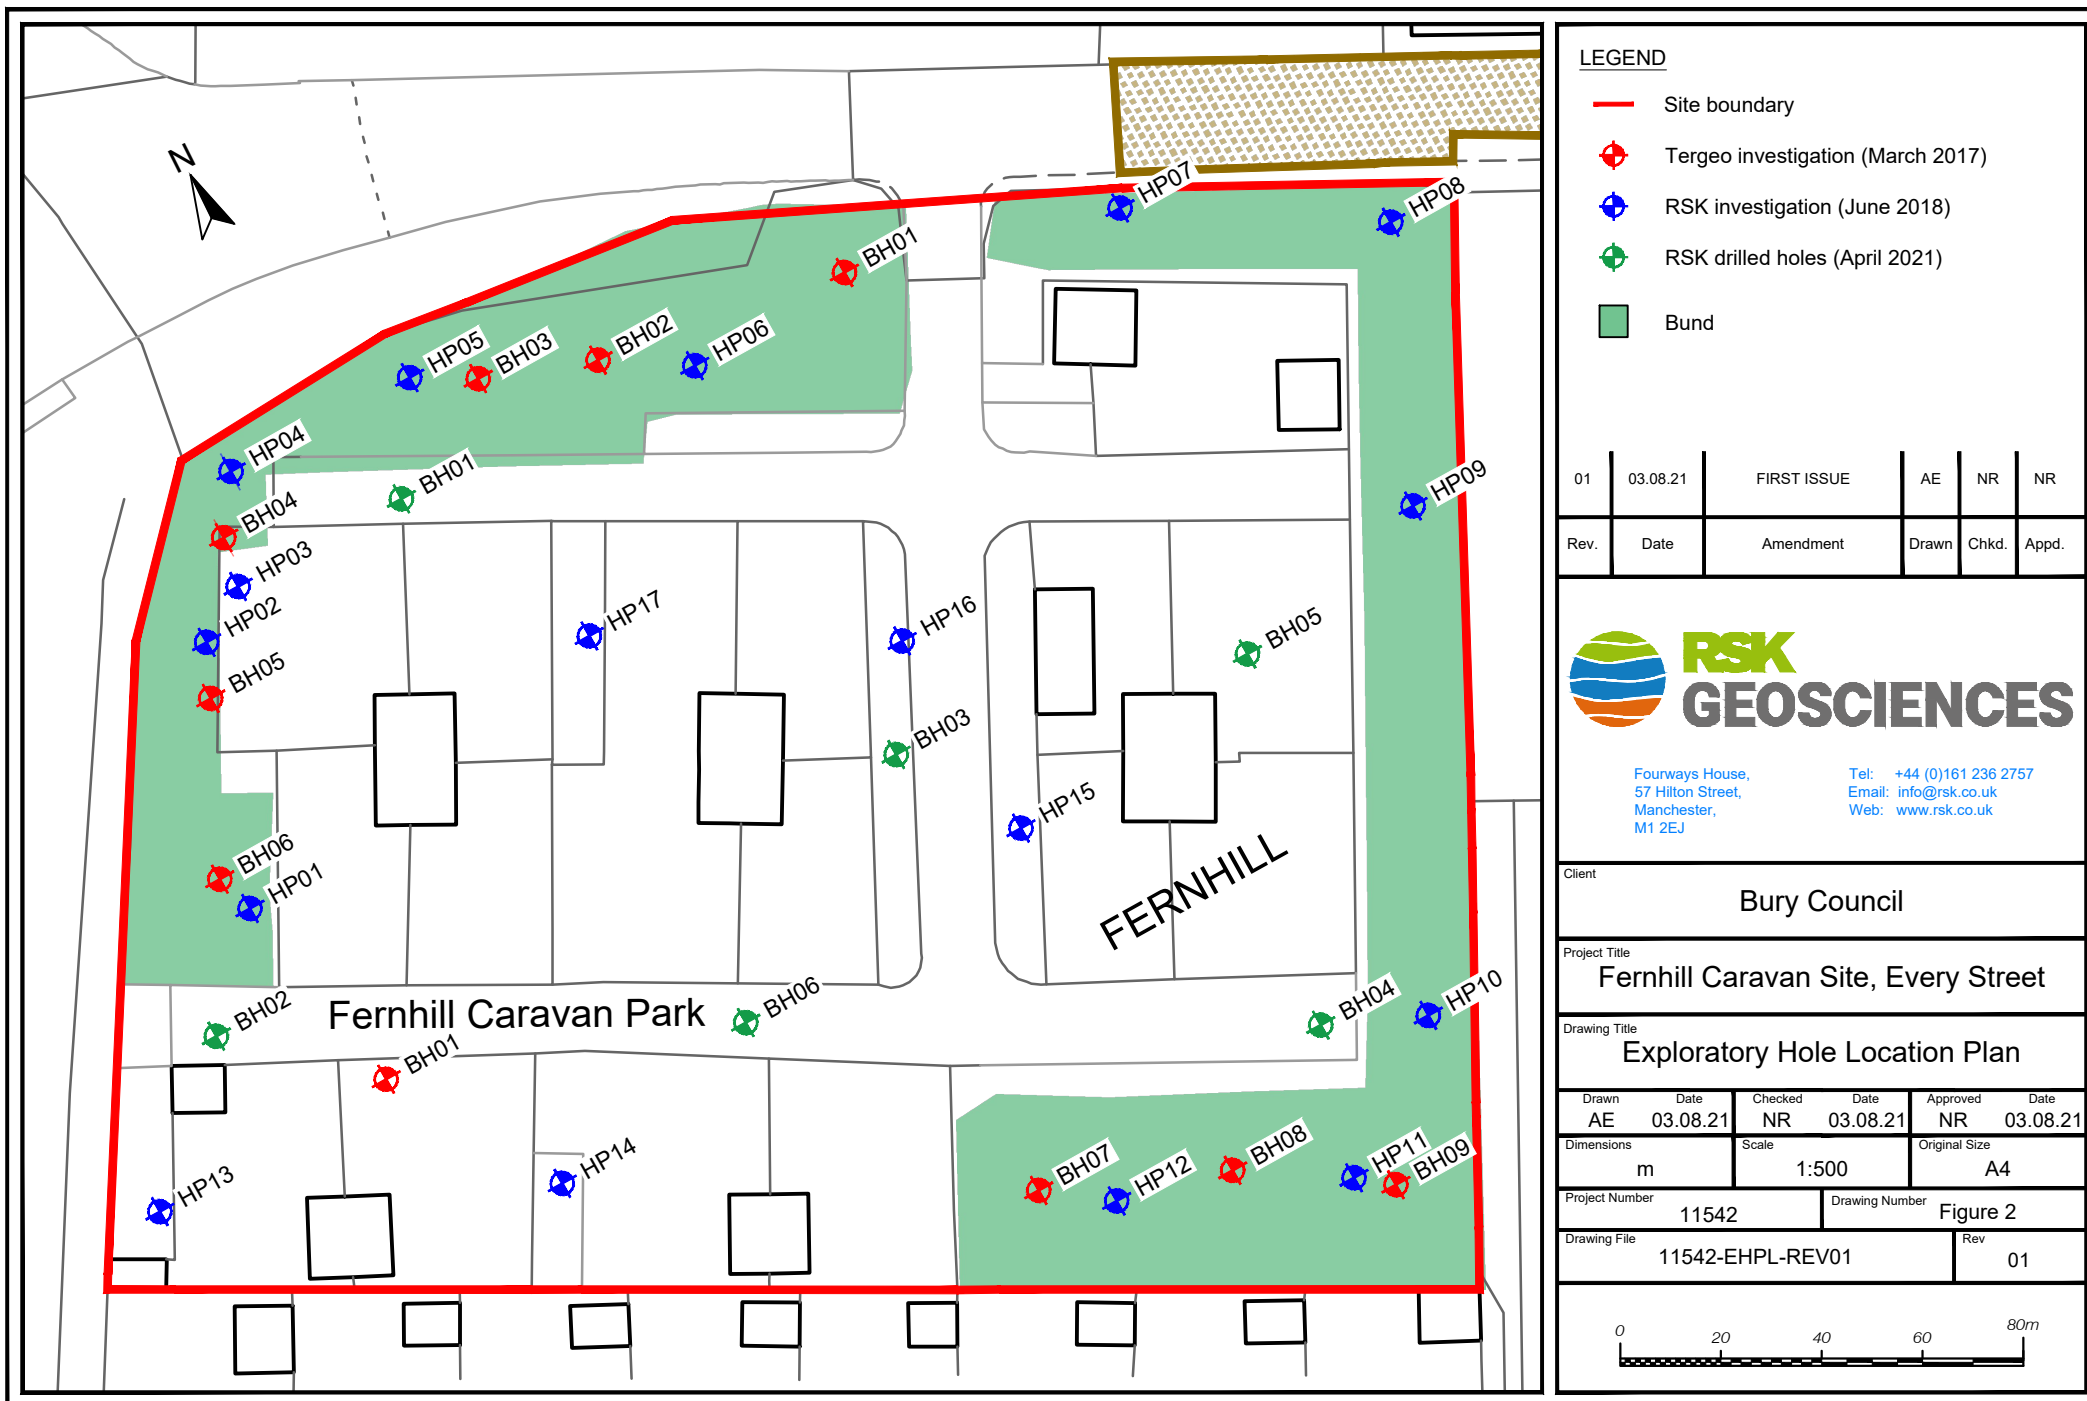


FIGURE 3 SITE PLAN (HISTORICAL LAND USE)

EVERY STREET

FERNHILL

- Site boundary
- ⊕ Tergeo investigation (March 2017)
- ⊕ RSK investigation (June 2018)
- ⊕ RSK drilled holes (April 2021)
- Former Buildings (1910-1939 (West) and 1991 (East))
- + Former Train/Tram Line (1910)
- Former maximum extent of gravel pit (1850-1930)
- Tracks

01	03.08.21	FIRST ISSUE	AE	NR	NR
Rev.	Date	Amendment	Drawn	Chkd.	Appd.



Fourways House,
57 Hilton Street,
Manchester,
M1 2EJ

Tel: +44 (0)161 236 2757
Email: info@rsk.co.uk
Web: www.rsk.co.uk

Client
Bury Council

Project Title
Fernhill Caravan Site, Every Street

Drawing Title
Site Plan (Historical Landuse)

Drawn	Date	Checked	Date	Approved	Date
AE	03.08.21	NR	03.08.21	NR	03.08.21
Dimensions	Scale		Original Size		
m	1:500		A4		
Project Number	11542		Drawing Number	Figure 3	
Drawing File	11542-SPHL-REV01		Rev	01	



FIGURE 4 SITE PLAN (HISTORICAL LAND USE AND CURRENT LAYOUT)

APPENDICES

APPENDIX A

SERVICE CONSTRAINTS

1. This report and the site investigation carried out in connection with the report (together the "Services") were compiled and carried out by RSK Environment Limited (RSK) for Bury Council (the "Client") in accordance with the terms of a contract between RSK and the Client, dated 30 November 2020. The Services were performed by RSK with the reasonable skill and care ordinarily exercised by an environmental consultant at the time the Services were performed. Further, and in particular, the Services were performed by RSK taking into account the limits of the scope of works required by the client, the time scale involved and the resources, including financial and manpower resources, agreed between RSK and the Client.
2. Other than that, expressly contained in paragraph 1 above, RSK provides no other representation or warranty whether express or implied, in relation to the Services.
3. Unless otherwise agreed in writing, the Services were performed by RSK exclusively for the purposes of the Client. RSK is not aware of any interest of or reliance by any party other than the Client in or on the Services. Unless expressly provided in writing, RSK does not authorise, consent or condone any party other than the client relying upon the Services. Should this report or any part of this report, or otherwise details of the Services or any part of the Services be made known to any such party, and such party relies thereon that party does so wholly at its own and sole risk and RSK disclaims any liability to such parties. **Any such party would be well advised to seek independent advice from a competent environmental consultant and/or lawyer.**
4. It is RSK's understanding that this report is to be used for the purpose described in the introduction to the report. That purpose was a significant factor in determining the scope and level of the Services. Should the purpose for which the report is used, or the proposed use of the site change, this report may no longer be valid and any further use of or reliance upon the report in those circumstances by the client without RSK's review and advice shall be at the client's sole and own risk. Should RSK be requested to review the report after the date of this report, RSK shall be entitled to additional payment at the then existing rates or such other terms as agreed between RSK and the client.
5. The passage of time may result in changes in site conditions, regulatory or other legal provisions, technology or economic conditions which could render the report inaccurate or unreliable. The information and conclusions contained in this report should not be relied upon in the future without the written advice of RSK. In the absence of such written advice of RSK, reliance on the report in the future shall be at the Client's own and sole risk. Should RSK be requested to review the report in the future, RSK shall be entitled to additional payment at the then existing rate or such other terms as may be agreed between RSK and the client.
6. The observations and conclusions described in this report are based solely upon the Services which were provided pursuant to the agreement between the Client and RSK. RSK has not performed any observations, investigations, studies or testing not specifically set out or required by the contract between the client and RSK. RSK is not liable for the existence of any condition, the discovery of which would require performance of services not otherwise contained in the Services. For the avoidance of doubt, unless otherwise expressly referred to in the introduction to this report, RSK did not seek to evaluate the presence on or off site of asbestos, invasive plants, electromagnetic fields, lead paint, heavy metals, radon gas, persistent, bioaccumulative or toxic chemicals (including PFAS/ PFOS) or other radioactive or hazardous materials, unless specifically identified in the Services.
7. The Services are based upon RSK's observations of existing physical conditions at the Site gained from a visual inspection of the site together with RSK's interpretation of information, including documentation, obtained from third parties and from the Client on the history and usage of the site, unless specifically identified in the Services or accreditation system (such as UKAS ISO 17020:2012 clause 7.1.6):
 - a. The Services were based on information and/or analysis provided by independent testing and information services or laboratories upon which RSK was reasonably entitled to rely.


- b. The Services were limited by the accuracy of the information, including documentation, reviewed by RSK and the observations possible at the time of the visual inspection.
- c. The Services did not attempt to independently verify the accuracy or completeness of information, documentation or materials received from the client or third parties, including laboratories and information services, during the performance of the Services.

RSK is not liable for any inaccurate information or conclusions, the discovery of which inaccuracies required the doing of any act including the gathering of any information which was not reasonably available to RSK and including the doing of any independent investigation of the information provided to RSK save as otherwise provided in the terms of the contract between the Client and RSK.

- 8. The intrusive environmental site investigation aspects of the Services are a limited sampling of the site at pre-determined locations based on the known historic / operational configuration of the site. The conclusions given in this report are based on information gathered at the specific test locations and can only be extrapolated to an undefined limited area around those locations. The extent of the limited area depends on the properties of the materials adjacent and local conditions, together with the position of any current structures and underground utilities and facilities, and natural and other activities on site. In addition, chemical analysis was carried out for a limited number of parameters (as stipulated in the scope between the client and RSK, based on an understanding of the available operational and historical information) and it should not be inferred that other chemical species are not present.
- 9. Any site drawing(s) provided in this report is (are) not meant to be an accurate base plan but is (are) used to present the general relative locations of features on, and surrounding, the site. Features (intrusive and sample locations etc) annotated on site plans are not drawn to scale but are centred over the approximate location. Such features should not be used for setting out and should be considered indicative only.
- 10. The comments given in this report and the opinions expressed are based on the ground conditions encountered during the site work and on the results of tests made in the field and in the laboratory. However, there may be conditions pertaining to the site that have not been disclosed by the investigation and therefore could not be taken into account. In particular, it should be noted that there may be areas of made ground not detected due to the limited nature of the investigation or the thickness and quality of made ground across the site may be variable. In addition, groundwater levels and ground gas concentrations and flows, may vary from those reported due to seasonal, or other, effects and the limitations stated in the data should be recognised.
- 11. Asbestos is often observed to be present in soils in discrete areas. Whilst asbestos-containing materials may have been locally encountered during the fieldworks or supporting laboratory analysis, the history of brownfield and demolition sites indicates that asbestos fibres may be present more widely in soils and aggregates, which could be encountered during more extensive ground works.
- 12. Unless stated otherwise, only preliminary geotechnical recommendations are presented in this report and these should be verified in a Geotechnical Design Report, once proposed construction and structural design proposals are confirmed.

APPENDIX B

REFERENCE DRAWINGS

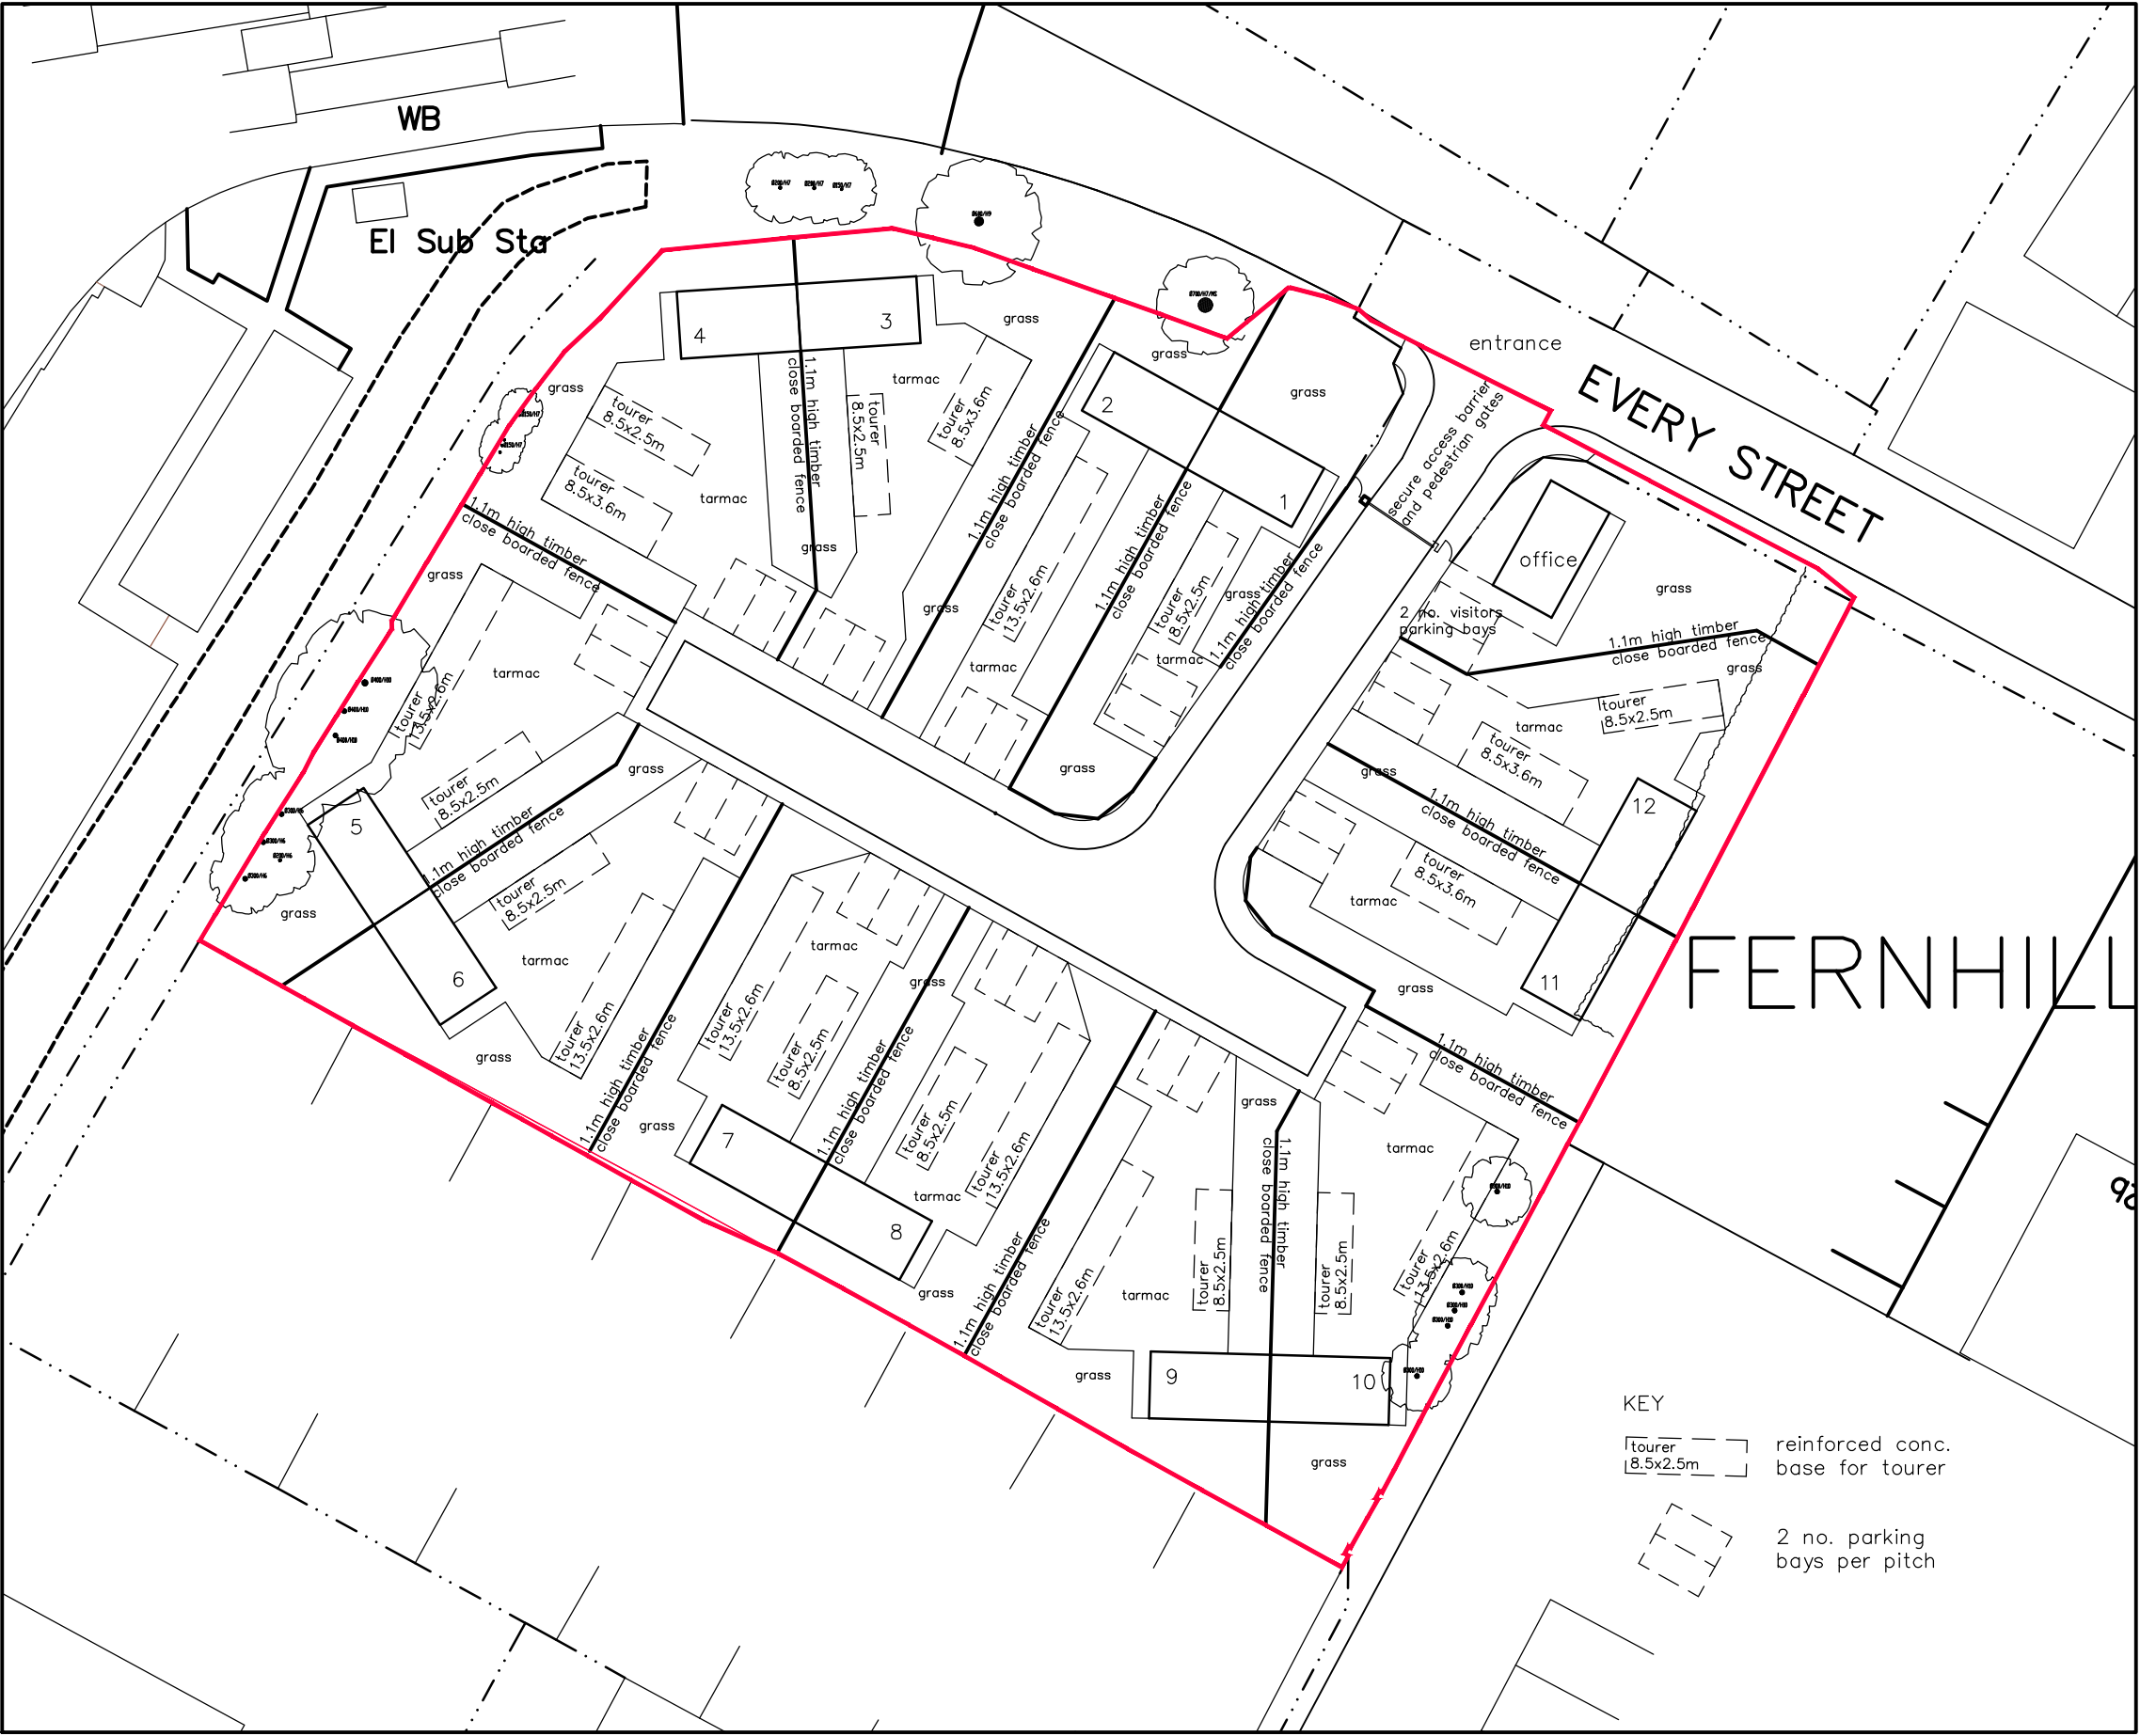

Notes: This drawing is the copyright Paddock Johnson Partnership Limited and may not be used without their prior written consent. Written dimensions to be taken in preference to scaled dimensions. Due to the inaccuracies of scanning, scanned images should not be scaled.

+ REV: DATE: DESCRIPTION: BY:

CLIENT:	PROJECT:	DRAWING TITLE:	DRAWING NUMBER:	SCALE:	DATE:
Bury Council	Fernhill Gypsy and Traveller Site Re-development	Proposed Site Layout - Alternative Site Entrance	19144-101	1:500@A3	22.10.20.
STATUS:			BY:	CHECKED:	
For Information			MK	SH	

PADDOCK
JOHNSON

Studio 2, The Lyceum,
Bath Street, Port Sunlight,
Merseyside, CH62 4UJ
0151 643 1234
Info@paddockjohnson.com
www.paddockjohnson.com
Paddock Johnson Partnership
Limited. Registered in England
and Wales. No. 06684275

APPENDIX C

SUMMARY OF LEGISLATION AND POLICY RELATING TO LAND CONTAMINATION

Part IIA of the Environmental Protection Act 1990

Part IIA of the Environmental Protection Act 1990 (Part IIA) and its associated Contaminated Land Regulations 2000 (SI 2000/227), which came into force in England on 1 April 2000, formed the basis for the current regulatory framework and the statutory regime for the identification and remediation of contaminated land. Part IIA of the EPA 1990 defines contaminated land as 'any land which appears to the Local Authority in whose area it is situated to be in such a condition by reason of substances in, on or under the land, that significant harm is being caused, or that there is significant possibility of significant harm being caused, or that pollution of controlled waters is being or is likely to be caused'. Controlled waters are considered to include all groundwater, inland waters and estuaries.

In August 2006, the Contaminated Land (England) Regulations 2006 (SI 2006/1380) were implemented, which extended the statutory regime to include Part IIA of the EPA as originally introduced on 1 April 2000, together with changes intended chiefly to address land that is contaminated by virtue of radioactivity. These have been replaced subsequently by the Contaminated Land (England) (Amendment) Regulations 2012, which now exclude land that is contaminated by virtue of radioactivity.

The intention of Part IIA is to deal with contaminated land issues that are considered to cause significant harm on land that is not undergoing development (see Environmental Protection Act 1990: Part 2A Contaminated Land Statutory Guidance, April 2012). This document replaces Annex III of Defra Circular 01/2006, published in September 2006 (the remainder of this document is now obsolete).

Planning Policy

Contaminated land is often dealt with through planning because of land redevelopment. This approach was documented in Planning Policy Statement: Planning and Pollution Control PPS23, which states that it remains the responsibility of the landowner and developer to identify land affected by contamination and carry out sufficient remediation to render the land suitable for use. PPS23 was withdrawn early in 2012 and has been replaced by much reduced guidance within the National Planning Policy Framework (NPPF), reference ISBN: 978-1-5286-1033-9, February 2019.

The new framework has only limited guidance on contaminated land, as follows:

Chapter 11. Making effective use of land

117 Planning policies and decisions should promote an effective use of land in meeting the need for homes and other uses, while safeguarding and improving the environment and ensuring safe and healthy living conditions. Strategic policies should set out a clear strategy for accommodating objectively assessed needs, in a way that makes as much use as possible of previously-developed or 'brownfield' land.

118. Planning policies and decisions should:

c) give substantial weight to the value of using suitable brownfield land within settlements for homes and other identified needs, and support appropriate opportunities to remediate despoiled, degraded, derelict, contaminated or unstable land.

Chapter 15. Conserving and enhancing the natural environment

170. Planning policies and decisions should contribute to and enhance the natural and local environment by:

e) preventing new and existing development from contributing to, being put at unacceptable risk from, or being adversely affected by, unacceptable levels of soil, air, water or noise pollution or land instability. Development should, wherever possible, help to improve local environmental conditions such as air and water quality, taking into account relevant information such as river basin management plans; and

f) remediating and mitigating despoiled, degraded, derelict, contaminated and unstable land, where appropriate.

Ground conditions and pollution

178. Planning policies and decisions should ensure that:

a) a site is suitable for its proposed use taking account of ground conditions and any risks arising from land instability and contamination. This includes risks arising from natural hazards or former activities such as mining, and any proposals for mitigation including land remediation (as well as potential impacts on the natural environment arising from that remediation);

b) after remediation, as a minimum, land should not be capable of being determined as contaminated land under Part 2A of the Environmental Protection Act 1990; and

c) adequate site investigation information, prepared by a competent person, is available to inform these assessments.

179. Where a site is affected by contamination or land stability issues, responsibility for securing a safe development rests with the developer and/or landowner.

Water Resources Act (WRA)

The Water Resources Act 1991 (Amendment) (England and Wales) Regulations 2009 updated the Water Resources Act 1991, which introduced the offence of causing or knowingly permitting pollution of controlled waters. The Act provides the Environment Agency with powers to implement remediation necessary to protect controlled waters and recover all reasonable costs of doing so.

Water Framework Directive (WFD)

The Water Framework Directive 2000/60/EC is designed to:

- enhance the status and prevent further deterioration of aquatic ecosystems and associated wetlands that depend on the aquatic ecosystems
- promote the sustainable use of water
- reduce pollution of water, especially by 'priority' and 'priority hazardous' substances
- ensure progressive reduction of groundwater pollution.

The WFD requires a management plan for each river basin be developed every six years.

Groundwater Directive (GWD)

The 1980 Groundwater Directive 80/68/EEC and the 2006 Groundwater Daughter Directive 2006/118/EC of the WFD are the main European legislation in place to protect groundwater. The 1980 Directive is due to be repealed in December 2013. The European legislation has been transposed into national legislation by regulations and directions to the Environment Agency.

Priority Substances Directive (PSD)

The Priority Substances Directive 2008/105/EC is a 'Daughter' Directive of the WFD, which sets out a priority list of substances posing a threat to or via the aquatic environment. The PSD establishes environmental quality standards for priority substances, which have been set at concentrations that are safe for the aquatic environment and for human health. In addition, there is a further aim of reducing (or eliminating) pollution of surface water (rivers, lakes, estuaries and coastal waters) by pollutants on the list. The WFD requires that countries establish a list of dangerous substances that are being discharged and EQS for them. In England and Wales, this list is provided in the River Basin Districts Typology, Standards and Groundwater threshold values (Water Framework Directive) (England and Wales) Directions 2010. In order to achieve the objectives of the WFD, classification schemes are used to describe where the water environment is of good quality and where it may require improvement.

Environmental Permitting Regulations (EPR)


The Environmental Permitting (England and Wales) Regulations 2016 (as amended) provide a single regulatory framework that streamlines and integrates waste management licensing, pollution prevention and control, water discharge consenting, groundwater authorisations, and radioactive substances regulation. Schedule 22, paragraph 6 of EPR 2016 states: 'the regulator must, in exercising its relevant functions, take all necessary measures - (a) to prevent the input of any hazardous substance to groundwater; and (b) to limit the input of non-hazardous pollutants to groundwater so as to ensure that such inputs do not cause pollution of groundwater.'

Notes:

1. *The above information is provided for background but does not constitute site-specific advice*
2. *The above summary applies to England only. Variations exist within other countries of the United Kingdom*

APPENDIX D

ENVIRONMENTAL DATABASE REPORT

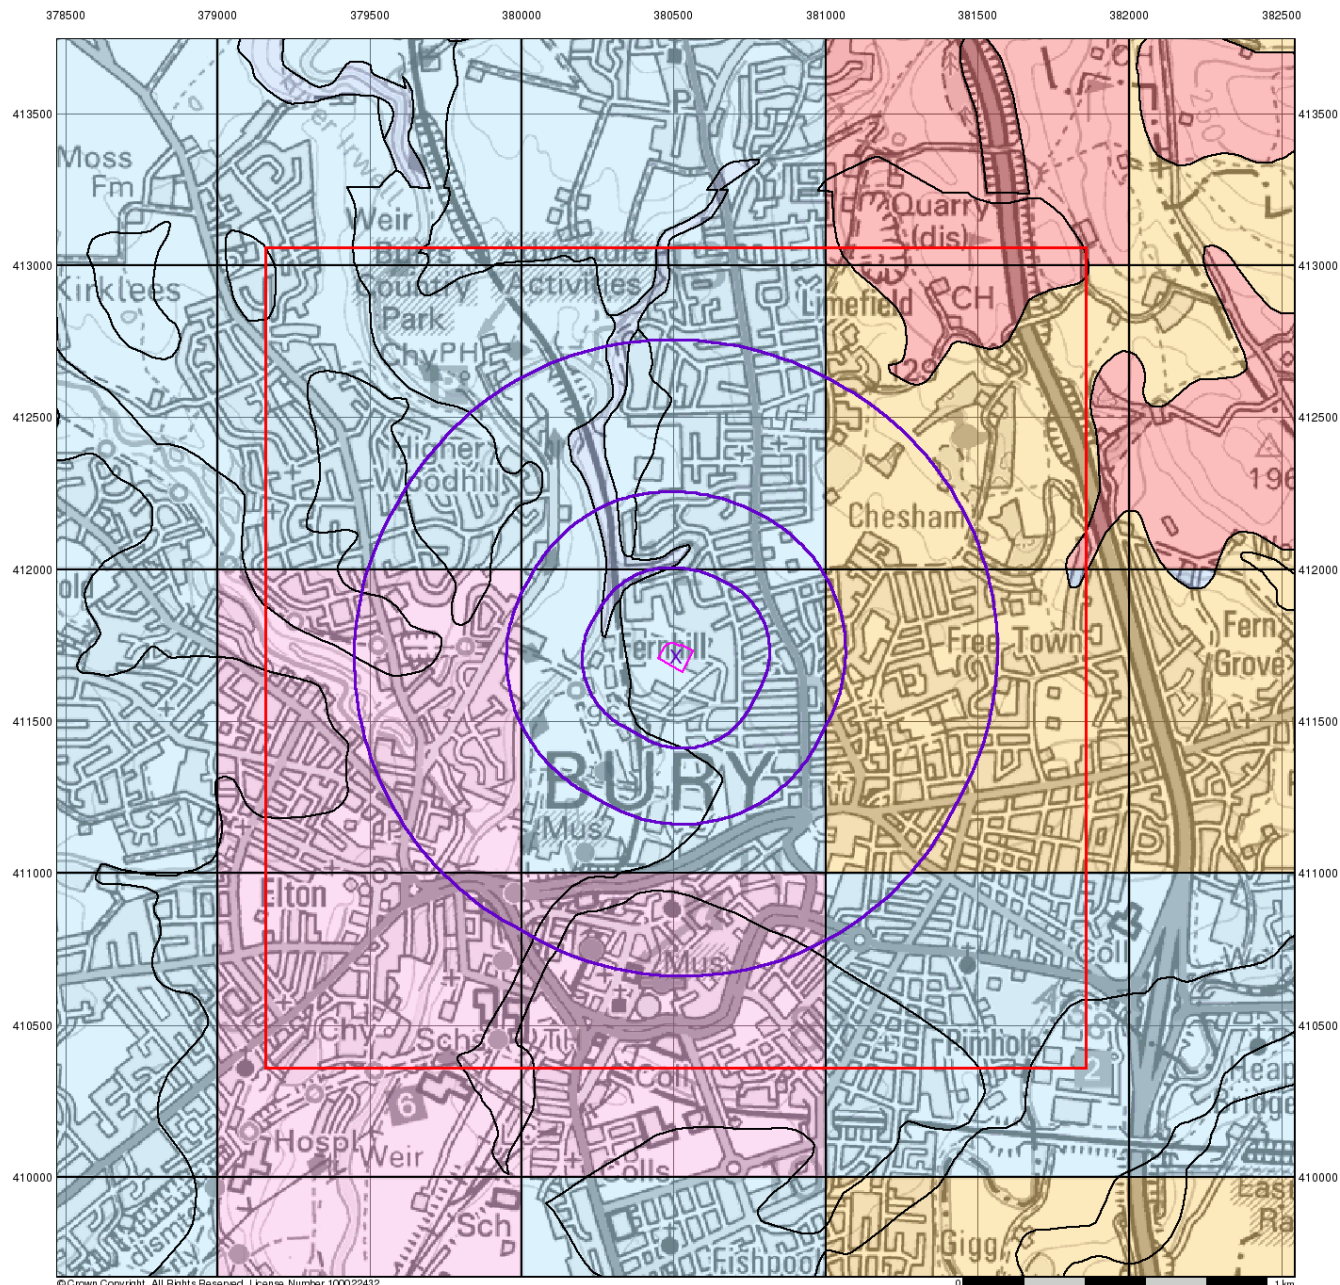

© Crown Copyright. All Rights Reserved. License Number 100022432.



Groundwater Vulnerability

General

- X Specified Site
- Specified Buffer(s)
- X Bearing Reference Point
- Slice
- 8 Map ID

Agency and Hydrological

Bedrock Aquifers

- High Vulnerability, Principal Aquifer
- High Vulnerability, Secondary Aquifer
- Medium Vulnerability, Principal Aquifer
- Medium Vulnerability, Secondary Aquifer
- Low Vulnerability, Principal Aquifer
- Low Vulnerability, Secondary Aquifer


Superficial Aquifers

- High Vulnerability, Principal Aquifer
- High Vulnerability, Secondary Aquifer
- Medium Vulnerability, Principal Aquifer
- Medium Vulnerability, Secondary Aquifer
- Low Vulnerability, Principal Aquifer
- Low Vulnerability, Secondary Aquifer

Unproductive Aquifer

Soluble Rock

Site Sensitivity Context Map - Slice A

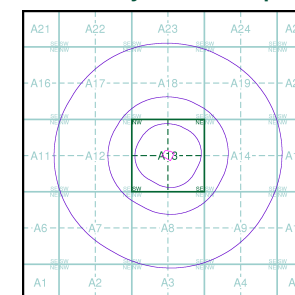

Order Details


Order Number: 269841542_1_1
 Customer Ref: 11542
 National Grid Reference: 380510, 411710
 Slice: A
 Site Area (Ha): 0.65
 Search Buffer (m): 1000

Site Details

Site at 380490, 411720

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

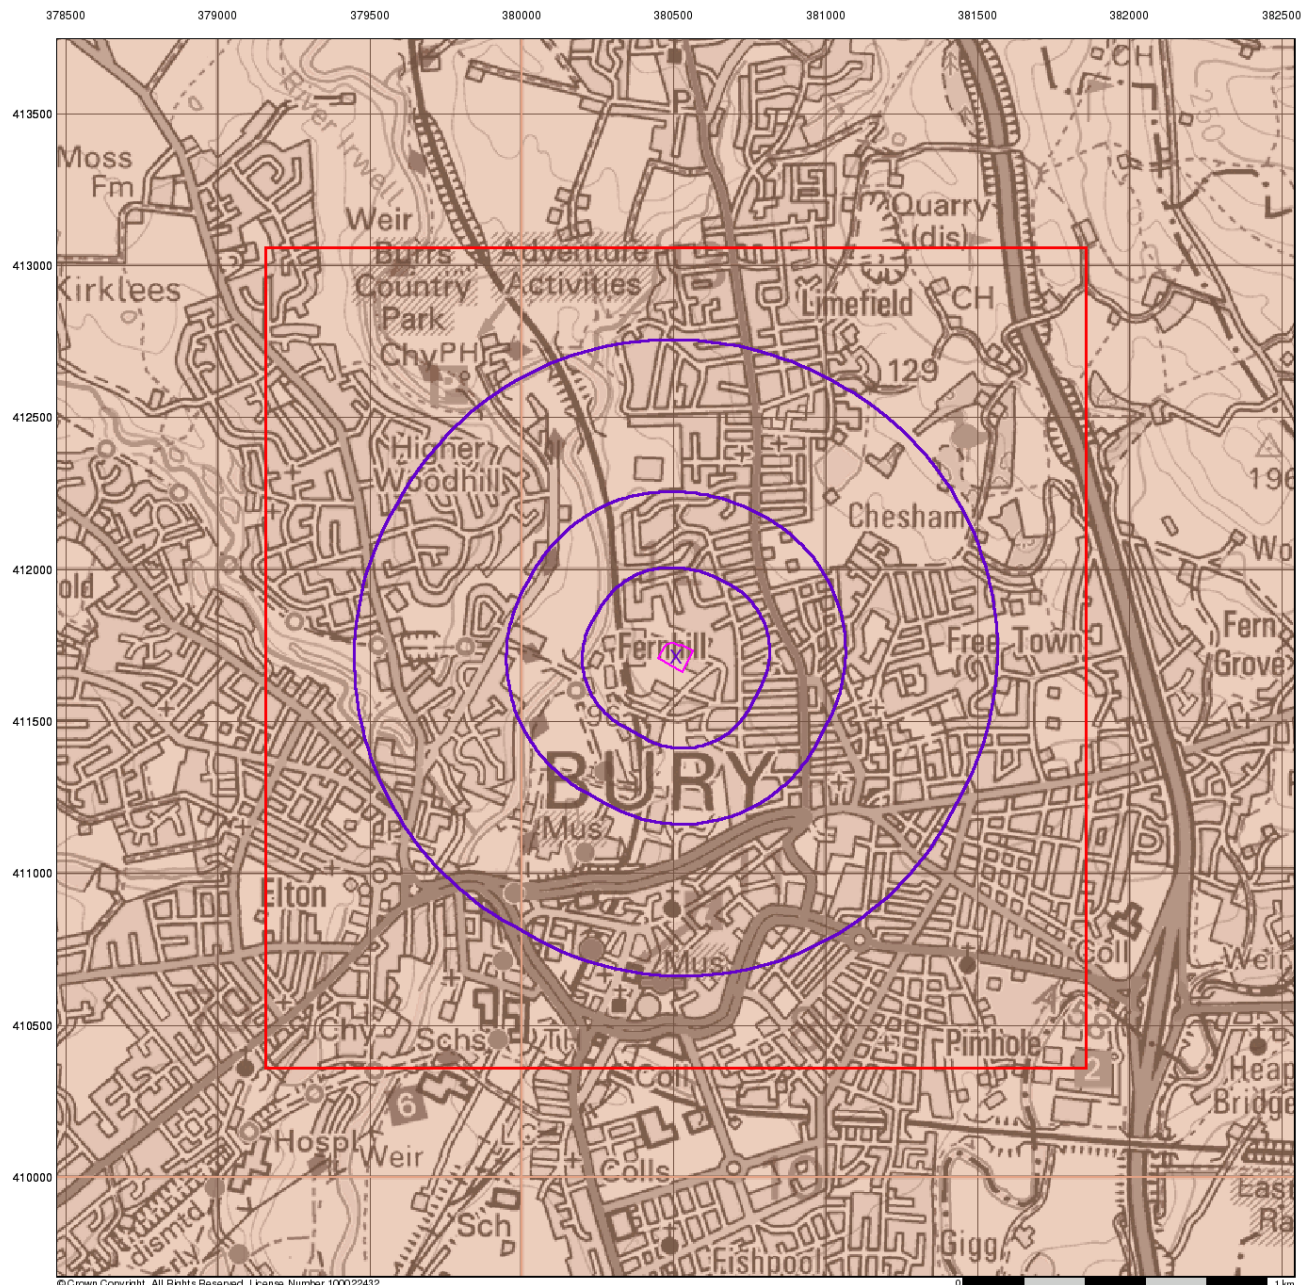

© Crown Copyright. All Rights Reserved. License Number 100022432.

0 1 km



Bedrock Aquifer Designation

General


- ◆ Specified Site ○ Specified Buffer(s) X Bearing Reference Point
- Slice 8 Map ID

Agency and Hydrological

Geological Classes

- Principal Aquifer
- Secondary A Aquifer
- Secondary B Aquifer
- Secondary Undifferentiated
- Unproductive Strata
- Unknown
- Unknown (Lakes and Landslip)

Site Sensitivity Context Map - Slice A

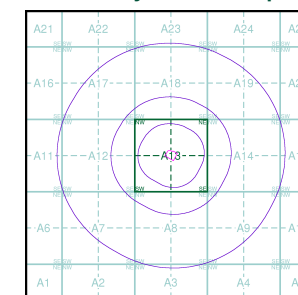

Order Details


Order Number: 269841542_1_1
 Customer Ref: 11542
 National Grid Reference: 380510, 411710
 Slice: A
 Site Area (Ha): 0.65
 Search Buffer (m): 1000

Site Details

Site at 380490, 411720

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

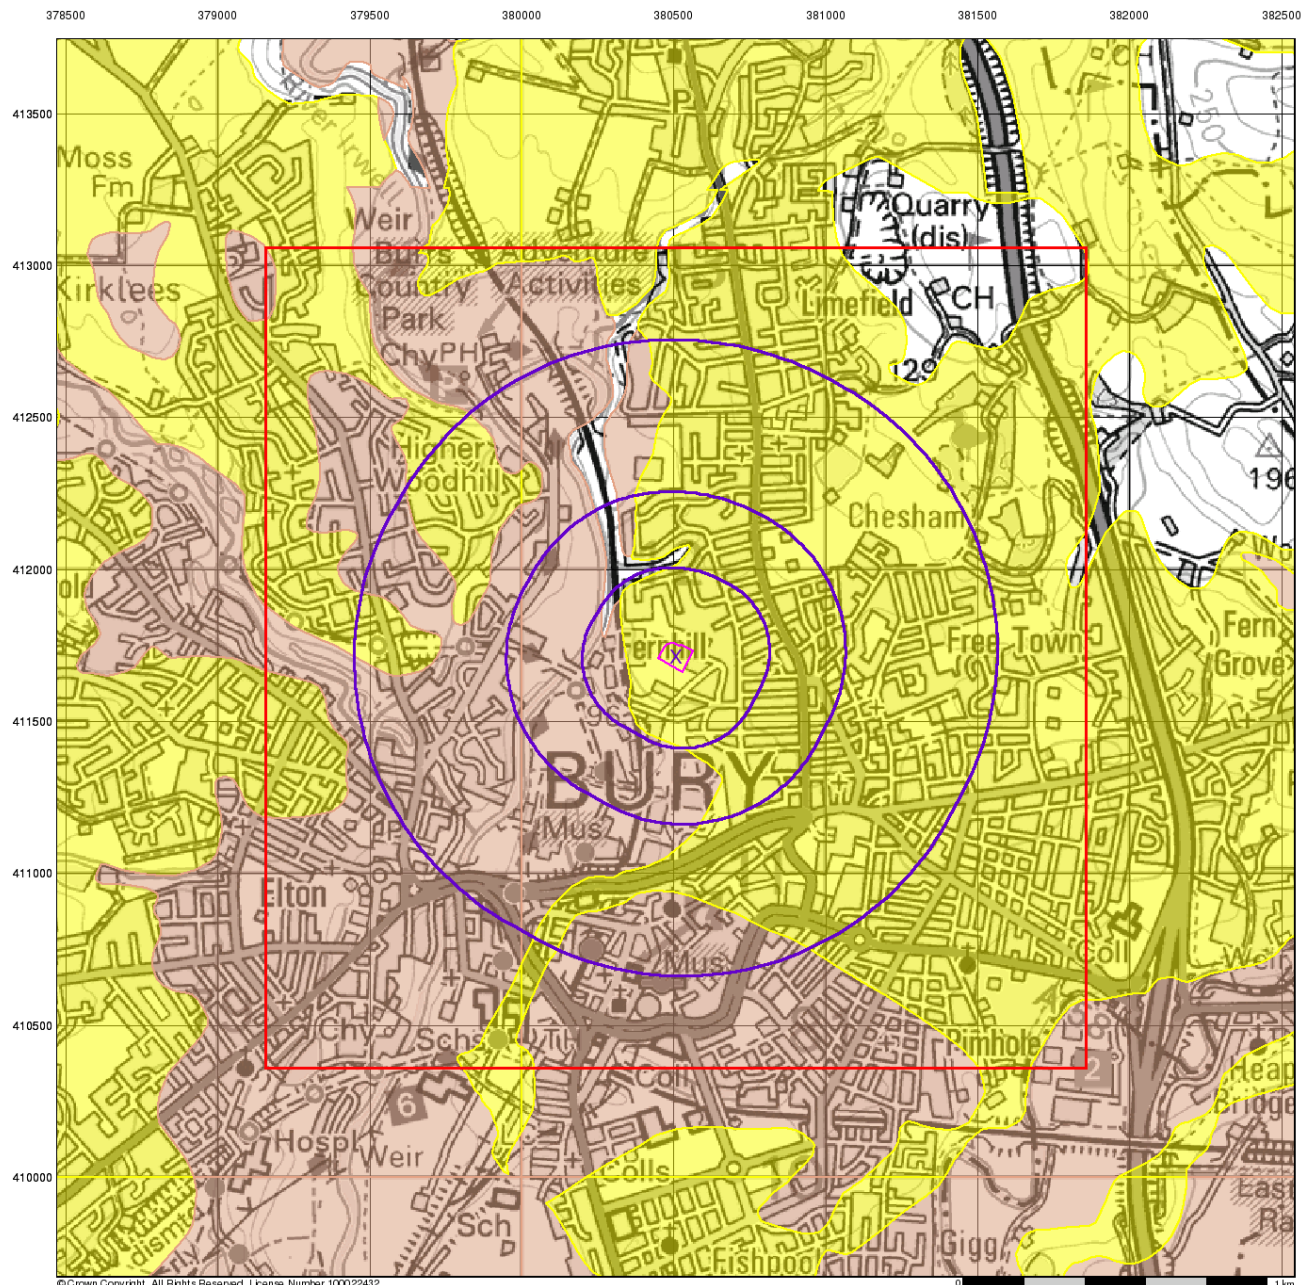

© Crown Copyright. All Rights Reserved. License Number 100022432.



Superficial Aquifer Designation

General


- Specified Site
- Specified Buffer(s)
- Bearing Reference Point
- Slice
- Map ID

Agency and Hydrological

Geological Classes

- Principal Aquifer
- Secondary A Aquifer
- Secondary B Aquifer
- Secondary Undifferentiated
- Unproductive Strata
- Unknown
- Unknown (Lakes and Landslip)

Site Sensitivity Context Map - Slice A

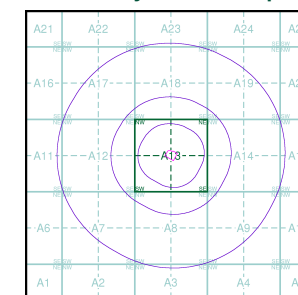

Order Details


Order Number: 269841542_1_1
 Customer Ref: 11542
 National Grid Reference: 380510, 411710
 Slice: A
 Site Area (Ha): 0.65
 Search Buffer (m): 1000

Site Details

Site at 380490, 411720

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

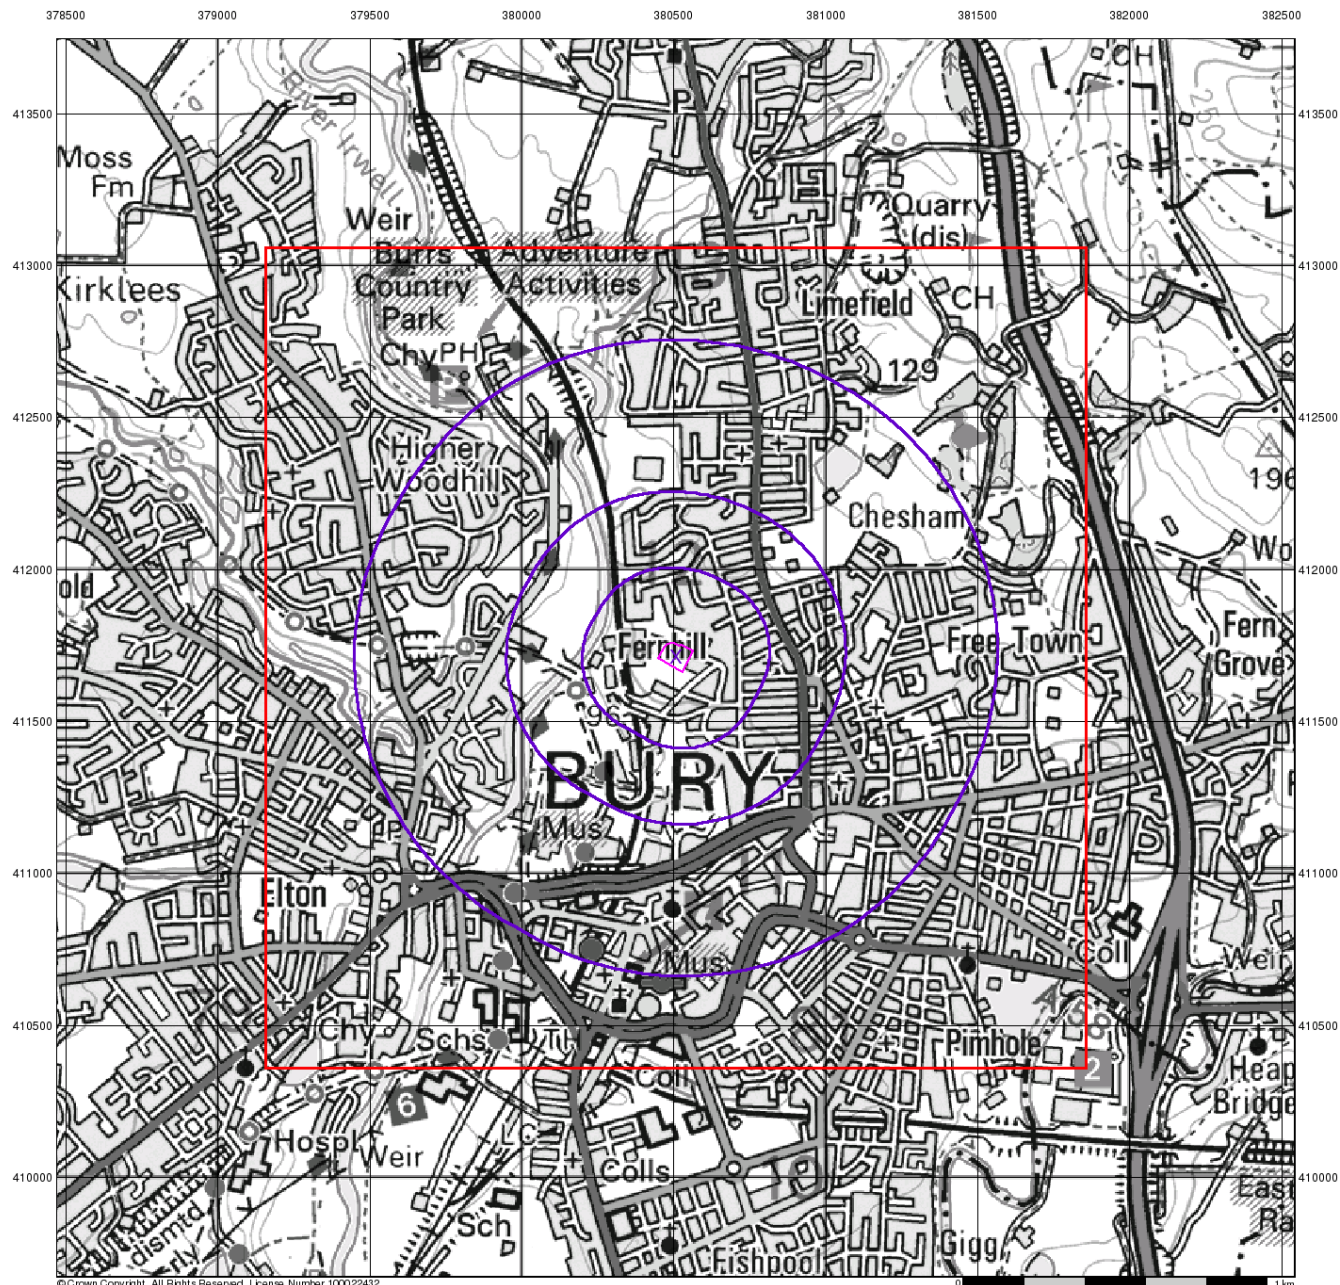

© Crown Copyright. All Rights Reserved. License Number 100022432.



Source Protection Zones


General

- Specified Site
- Specified Buffer(s)
- Bearing Reference Point
- Slice
- Map ID

Agency and Hydrological

- Inner zone (Zone 1)
- Inner zone - subsurface activity only (Zone 1c)
- Outer zone (Zone 2)
- Outer zone - subsurface activity only (Zone 2c)
- Total catchment (Zone 3)
- Total catchment - subsurface activity only (Zone 3c)
- Special interest (Zone 4)

Site Sensitivity Context Map - Slice A

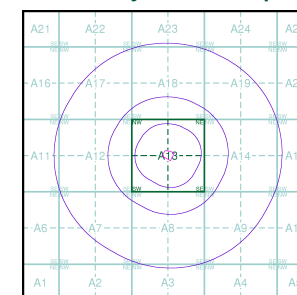

Order Details


Order Number: 269841542_1_1
 Customer Ref: 11542
 National Grid Reference: 380510, 411710
 Slice: A
 Site Area (Ha): 0.65
 Search Buffer (m): 1000

Site Details

Site at 380490, 411720

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

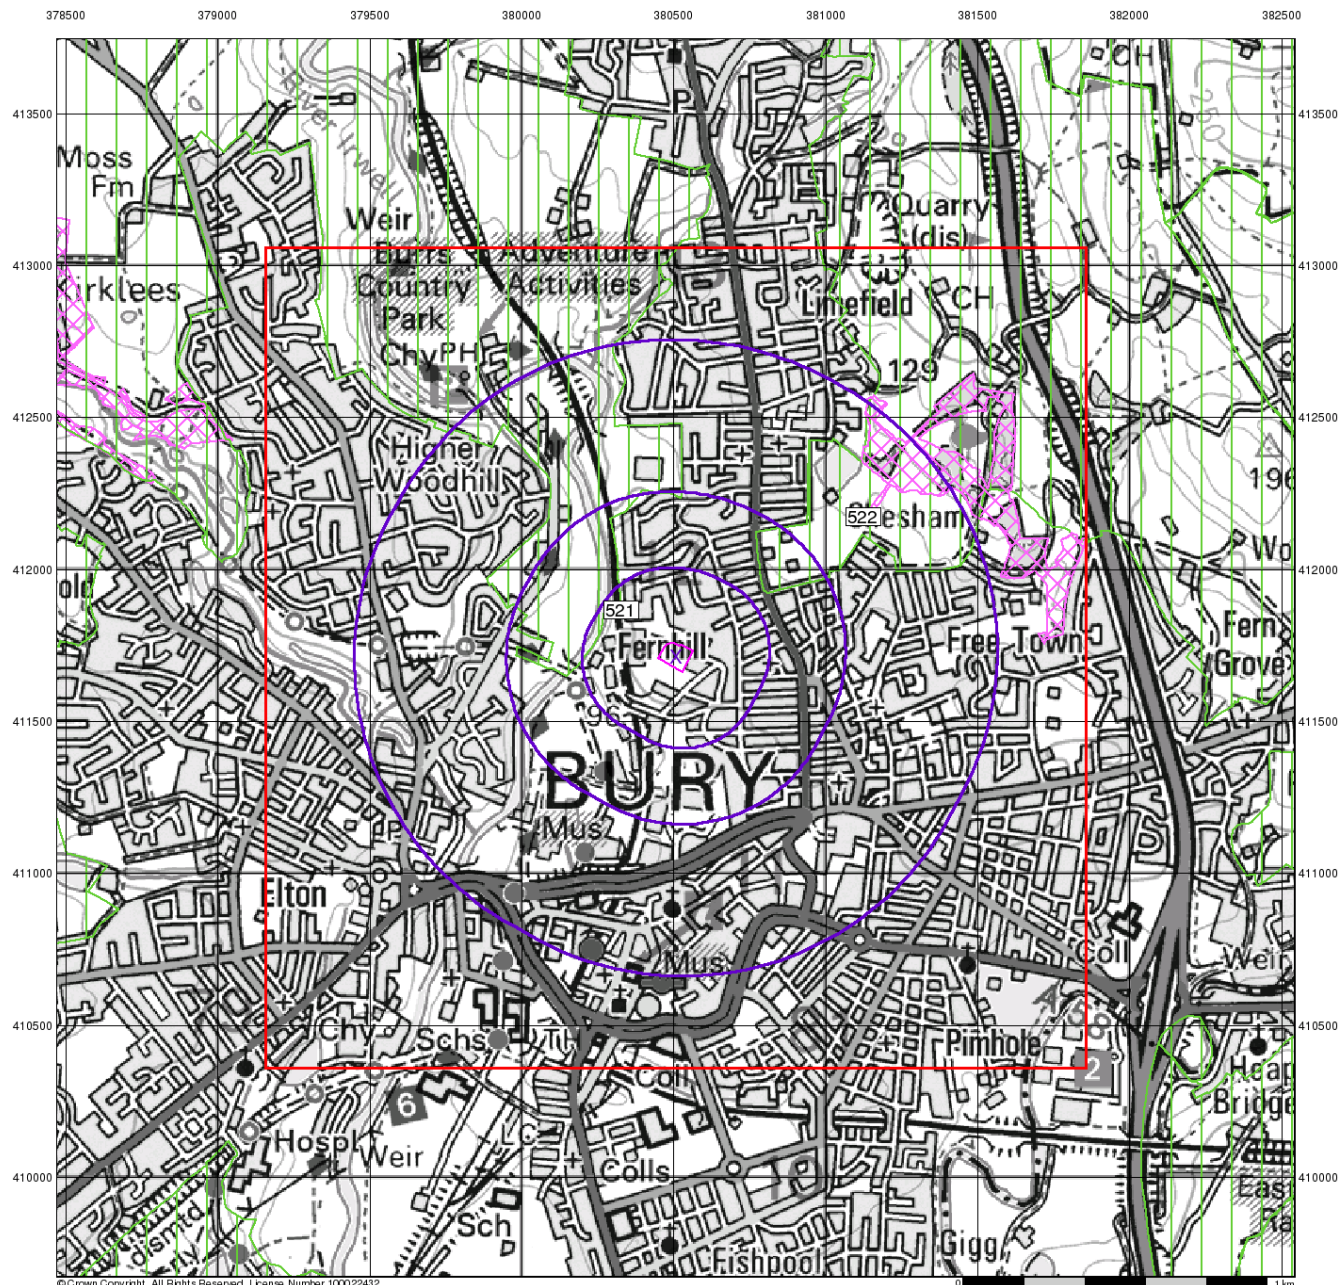

© Crown Copyright. All Rights Reserved. License Number 100022432.



Sensitive Land Uses


General

- ◇ Specified Site
- Specified Buffer(s)
- X Bearing Reference Point
- Slice
- 8 Map ID

Sensitive Land Uses

- Ancient Woodland
- Area of Adopted Green Belt
- Area of Unadopted Green Belt
- Area of Outstanding Natural Beauty
- Environmentally Sensitive Area
- Forest Park
- Local Nature Reserve
- Marine Nature Reserve
- National Nature Reserve
- N National Park
- Nitrate Sensitive Area
- Nitrate Vulnerable Zone
- Ramsar Site
- Site of Special Scientific Interest
- Special Area of Conservation
- Special Protection Area
- World Heritage Sites

Site Sensitivity Context Map - Slice A

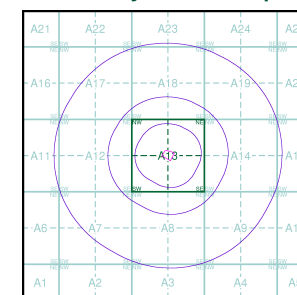

Order Details


Order Number: 269841542_1_1
 Customer Ref: 11542
 National Grid Reference: 380510, 411710
 Slice: A
 Site Area (Ha): 0.65
 Search Buffer (m): 1000

Site Details

Site at 380490, 411720

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

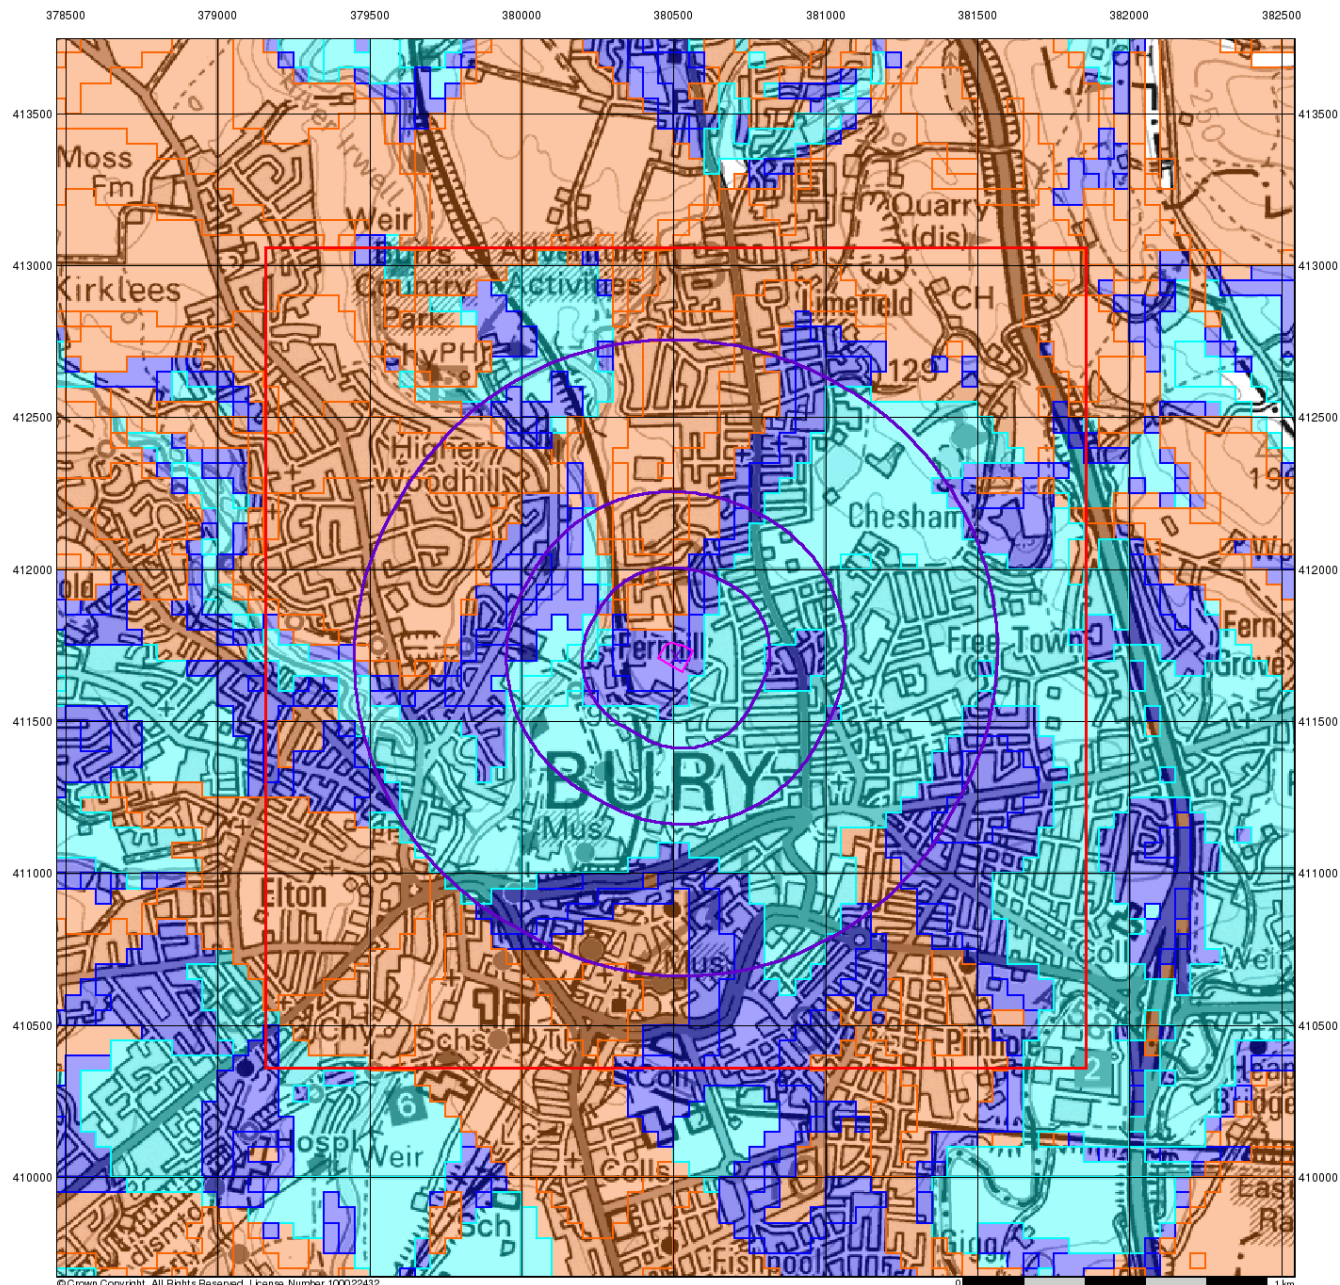

© Crown Copyright. All Rights Reserved. License Number 100022432.



BGS Flood GFS Data


General

- Specified Site
- Specified Buffer(s)
- Bearing Reference Point
- Slice

Agency and Hydrological (Flood)

- Limited Potential for Groundwater Flooding to Occur
- Potential for Groundwater Flooding of Property Situated Below Ground Level
- Potential for Groundwater Flooding to Occur at Surface

Site Sensitivity Context Map - Slice A

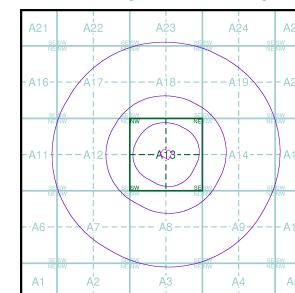

Order Details

Order Number: 269841542_1_1
 Customer Ref: 11542
 National Grid Reference: 380510, 411710
 Slice: A
 Site Area (Ha): 0.65
 Search Buffer (m): 1000

Site Details

Site at 380490, 411720



Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk



Envirocheck[®] Report:

Datasheet

Order Details:

Order Number:

269841542_1_1

Customer Reference:

11542

National Grid Reference:

380510, 411710

Slice:

A

Site Area (Ha):

0.65

Search Buffer (m):

1000

Site Details:

Site at 380490, 411720

Client Details:

Ms J Saddington
RSK Environment Ltd
Four Ways House
57 Hilton Street
Manchester
M1 2EJ

Report Section	Page Number
Summary	-
Agency & Hydrological	1
Waste	36
Hazardous Substances	50
Geological	51
Industrial Land Use	64
Sensitive Land Use	133
Data Currency	134
Data Suppliers	140
Useful Contacts	141

Introduction

The Environment Act 1995 has made site sensitivity a key issue, as the legislation pays as much attention to the pathways by which contamination could spread, and to the vulnerable targets of contamination, as it does the potential sources of contamination. For this reason, Landmark's Site Sensitivity maps and Datasheet(s) place great emphasis on statutory data provided by the Environment Agency/Natural Resources Wales and the Scottish Environment Protection Agency; it also incorporates data from Natural England (and the Scottish and Welsh equivalents) and Local Authorities; and highlights hydrogeological features required by environmental and geotechnical consultants. It does not include any information concerning past uses of land. The datasheet is produced by querying the Landmark database to a distance defined by the client from a site boundary provided by the client. In this datasheet the National Grid References (NGRs) are rounded to the nearest 10m in accordance with Landmark's agreements with a number of Data Suppliers.

Copyright Notice

© Landmark Information Group Limited 2020. The Copyright on the information and data and its format as contained in this Envirocheck® Report ("Report") is the property of Landmark Information Group Limited ("Landmark") and several other Data Providers, including (but not limited to) Ordnance Survey, British Geological Survey, the Environment Agency/Natural Resources Wales and Natural England, and must not be reproduced in whole or in part by photocopying or any other method. The Report is supplied under Landmark's Terms and Conditions accepted by the Customer. A copy of Landmark's Terms and Conditions can be found with the Index Map for this report. Additional copies of the Report may be obtained from Landmark, subject to Landmark's charges in force from time to time. The Copyright, design rights and any other intellectual rights shall remain the exclusive property of Landmark and /or other Data providers, whose Copyright material has been included in this Report. © Environment Agency & United Kingdom Research and Innovation 2020. © Natural Resources Wales & United Kingdom Research and Innovation 2020.

Natural England Copyright Notice

Site of Special Scientific Interest, National Nature Reserve, Ramsar, Special Protection Area, Special Conservation Area, Marine Nature Reserve data (derived from Ordnance Survey 1:10000 raster) is provided by, and used with the permission of, Natural England who retain the copyright and Intellectual Property Rights for the data.

Scottish Natural Heritage Copyright

Contains SNH information licensed under the Open Government Licence v3.0.

Ove Arup Copyright Notice

The Mining Instability data was obtained on licence from Ove Arup & Partners Limited (for further information, contact mining.review@arup.com). No reproduction or further use of such Data is to be made without the prior written consent of Ove Arup & Partners Limited. The supplied Mining Instability data is derived from publicly available records and other third party sources and neither Ove Arup & Partners nor Landmark warrant the accuracy or completeness of such information or data.

Stantec Copyright Notice

The cavity data presented has been extracted from the PBA (now Stantec UK Ltd) enhanced version of the original DEFRA national cavity databases. Stantec UK Ltd retain the copyright & intellectual property rights in the data. Whilst all reasonable efforts are made to check that the information contained in the cavity databases is accurate we do not warrant that the data is complete or error free. The information is based upon our own researches and those collated from a number of external sources and is continually being augmented and updated by Stantec UK Ltd. In no event shall Stantec UK Ltd or Landmark be liable for any loss or damage including, without limitation, indirect or consequential loss or damage arising from the use of this data.

Radon Potential dataset Copyright Notice

Information supplied from a joint dataset compiled by The British Geological Survey and Public Health England.

Natural Resources Wales Copyright Notice

Contains Natural Resources Wales information © Natural Resources Wales and Database Right. All rights Reserved. Contains Ordnance Survey Data. Ordnance Survey Licence number 100019741. Crown Copyright and Database Right. Contains Natural Resources Wales information © Natural Resources Wales and Database Right. All rights Reserved. Some features of this information are based on digital spatial data licensed from the Centre for Ecology & Hydrology © NERC (CEH). Defra, Met Office and DARD Rivers Agency © Crown copyright. © Cranfield University. © James Hutton Institute. Contains OS data © Crown copyright and database right 2020. Land & Property Services © Crown copyright and database right.

Report Version v53.0

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Agency & Hydrological					
BGS Groundwater Flooding Susceptibility	pg 1	Yes	Yes	Yes	n/a
Contaminated Land Register Entries and Notices					
Discharge Consents	pg 3			4	14
Prosecutions Relating to Controlled Waters			n/a	n/a	n/a
Enforcement and Prohibition Notices					
Integrated Pollution Controls	pg 7				4
Integrated Pollution Prevention And Control	pg 8		1	1	
Local Authority Integrated Pollution Prevention And Control					
Local Authority Pollution Prevention and Controls	pg 8	1	5	1	9
Local Authority Pollution Prevention and Control Enforcements					
Nearest Surface Water Feature	pg 10		Yes		
Pollution Incidents to Controlled Waters	pg 10		3	1	22
Prosecutions Relating to Authorised Processes					
Registered Radioactive Substances	pg 15				1
River Quality	pg 15		1		3
River Quality Biology Sampling Points					
River Quality Chemistry Sampling Points	pg 16				1
Substantiated Pollution Incident Register	pg 16		1		
Water Abstractions	pg 17		3		7 (*19)
Water Industry Act Referrals					
Groundwater Vulnerability Map	pg 24	Yes	n/a	n/a	n/a
Groundwater Vulnerability - Soluble Rock Risk			n/a	n/a	n/a
Groundwater Vulnerability - Local Information			n/a	n/a	n/a
Bedrock Aquifer Designations	pg 24	Yes	n/a	n/a	n/a
Superficial Aquifer Designations	pg 24	Yes	n/a	n/a	n/a
Source Protection Zones					
Extreme Flooding from Rivers or Sea without Defences	pg 24		Yes	n/a	n/a
Flooding from Rivers or Sea without Defences	pg 24		Yes	n/a	n/a
Areas Benefiting from Flood Defences				n/a	n/a
Flood Water Storage Areas				n/a	n/a
Flood Defences				n/a	n/a
OS Water Network Lines	pg 24		1	7	85

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Waste					
BGS Recorded Landfill Sites	pg 36			1	
Historical Landfill Sites	pg 36			1	5
Integrated Pollution Control Registered Waste Sites					
Licensed Waste Management Facilities (Landfill Boundaries)					
Licensed Waste Management Facilities (Locations)	pg 37		8	6	4
Local Authority Landfill Coverage	pg 41	1	n/a	n/a	n/a
Local Authority Recorded Landfill Sites					
Potentially Infilled Land (Non-Water)	pg 41		3	1	4
Potentially Infilled Land (Water)	pg 41			4	39
Registered Landfill Sites	pg 44				3
Registered Waste Transfer Sites	pg 45		3	1	1
Registered Waste Treatment or Disposal Sites	pg 48		1	1	3
Hazardous Substances					
Control of Major Accident Hazards Sites (COMAH)	pg 50				1
Explosive Sites					
Notification of Installations Handling Hazardous Substances (NIHHS)	pg 50				1
Planning Hazardous Substance Consents	pg 50				1
Planning Hazardous Substance Enforcements					

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Geological					
BGS 1:625,000 Solid Geology	pg 51	Yes	n/a	n/a	n/a
BGS Estimated Soil Chemistry	pg 51	Yes	Yes	Yes	Yes
BGS Recorded Mineral Sites	pg 61		1		3
BGS Urban Soil Chemistry					
BGS Urban Soil Chemistry Averages					
CBSCB Compensation District			n/a	n/a	n/a
Coal Mining Affected Areas	pg 61	Yes	n/a	n/a	n/a
Mining Instability	pg 61	Yes	n/a	n/a	n/a
Man-Made Mining Cavities					
Natural Cavities					
Non Coal Mining Areas of Great Britain				n/a	n/a
Potential for Collapsible Ground Stability Hazards	pg 62	Yes		n/a	n/a
Potential for Compressible Ground Stability Hazards	pg 62	Yes	Yes	n/a	n/a
Potential for Ground Dissolution Stability Hazards				n/a	n/a
Potential for Landslide Ground Stability Hazards	pg 62	Yes	Yes	n/a	n/a
Potential for Running Sand Ground Stability Hazards	pg 62	Yes	Yes	n/a	n/a
Potential for Shrinking or Swelling Clay Ground Stability Hazards	pg 62	Yes		n/a	n/a
Radon Potential - Radon Affected Areas			n/a	n/a	n/a
Radon Potential - Radon Protection Measures			n/a	n/a	n/a
Industrial Land Use					
Contemporary Trade Directory Entries	pg 64	1	58	75	323
Fuel Station Entries	pg 103				6
Points of Interest - Commercial Services	pg 103		26	22	102
Points of Interest - Education and Health					
Points of Interest - Manufacturing and Production	pg 116		27	24	96
Points of Interest - Public Infrastructure	pg 128		4	9	35
Points of Interest - Recreational and Environmental	pg 132		1	2	3
Gas Pipelines					
Underground Electrical Cables					

Data Type	Page Number	On Site	0 to 250m	251 to 500m	501 to 1000m (*up to 2000m)
Sensitive Land Use					
Ancient Woodland					
Areas of Adopted Green Belt	pg 133		1		
Areas of Unadopted Green Belt					
Areas of Outstanding Natural Beauty					
Environmentally Sensitive Areas					
Forest Parks					
Local Nature Reserves	pg 133				1
Marine Nature Reserves					
National Nature Reserves					
National Parks					
Nitrate Sensitive Areas					
Nitrate Vulnerable Zones					
Ramsar Sites					
Sites of Special Scientific Interest					
Special Areas of Conservation					
Special Protection Areas					
World Heritage Sites					

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NE (SW)	0	1	380508 411713
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13SE (S)	0	1	380508 411700
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13SE (SE)	25	1	380550 411650
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A13NW (N)	43	1	380500 411800
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A13NW (N)	93	1	380500 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A13NE (N)	94	1	380508 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NE (N)	101	1	380550 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NW (W)	108	1	380350 411750
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NE (NE)	122	1	380600 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NW (NW)	132	1	380350 411800
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13NW (W)	155	1	380300 411750
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A13NW (NW)	160	1	380350 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A13NW (NW)	176	1	380300 411800
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A13NW (NW)	195	1	380350 411900
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13NW (W)	199	1	380250 411713
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NW (NW)	201	1	380300 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13SW (SW)	226	1	380250 411600
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13NW (NW)	231	1	380300 411900
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NE (E)	236	1	380800 411713
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NW (NW)	244	1	380250 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13NW (W)	252	1	380200 411750
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13NW (NW)	265	1	380300 411950

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A18SW (N)	293	1	380500 412050
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A13NW (NW)	301	1	380250 411950
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A18SW (N)	305	1	380400 412050
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A18SE (N)	307	1	380600 412050
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NW (NW)	312	1	380200 411900
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A18SW (NW)	346	1	380300 412050
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A18SE (N)	370	1	380650 412100
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A13NW (NW)	372	1	380200 412000
	BGS Groundwater Flooding Susceptibility Flooding Type: Limited Potential for Groundwater Flooding to Occur	A18SW (NW)	389	1	380300 412100
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A12NE (NW)	399	1	380100 411900
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A18SW (NW)	407	1	380200 412050
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A12NE (NW)	424	1	380100 411950
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A12NE (W)	424	1	380050 411850
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A12SE (W)	449	1	380000 411700
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A12NE (W)	449	1	380000 411713
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A12NE (W)	451	1	380000 411750
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A12SE (W)	461	1	380000 411600
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding of Property Situated Below Ground Level	A14SW (E)	472	1	381000 411550
	BGS Groundwater Flooding Susceptibility Flooding Type: Potential for Groundwater Flooding to Occur at Surface	A12SE (W)	475	1	380000 411550

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
1	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Seedfield Secondary Modern Schl Cso 200m Sw Of 49-51 Wooded Close, .., Bury, BL9 6ny Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0010 Permit Version: 4 Effective Date: 6th November 2019 Issued Date: 6th November 2019 Revocation Date: Not Supplied Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Unnamed Trib Of River Irwell Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A18SW (N)	480	2	380367 412222
1	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Seedfield Secondary Modern Schl Cso 200m Sw Of 49-51 Wooded Close, .., Bury, BL9 6ny Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0010 Permit Version: 3 Effective Date: 5th February 2016 Issued Date: 5th February 2016 Revocation Date: 5th November 2019 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Unnamed Trib Of River Irwell Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A18SW (N)	480	2	380367 412222
1	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Seedfield Secondary Modern Schl Cso 200m Sw Of 49-51 Wooded Close, .., Bury, BL9 6ny Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0010 Permit Version: 2 Effective Date: 3rd September 2010 Issued Date: 3rd September 2010 Revocation Date: 4th February 2016 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Stream Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A18SW (N)	487	2	380370 412230
1	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Seedfield Secondary Modern Schl Cso 200m Sw Of 49-51 Wooded Close, .., Bury, BL9 6ny Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 01BRY0010 Permit Version: 1 Effective Date: 1st January 1995 Issued Date: Not Supplied Revocation Date: 2nd September 2010 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Stream Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 100m	A18SW (N)	487	2	380370 412230

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
2	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Tanpits Road Cso Harvard Road, Bury, ., Lancashire, B19 0nl Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 016982617 Permit Version: 2 Effective Date: 9th July 2018 Issued Date: 9th July 2018 Revocation Date: Not Supplied Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: River Irwell Status: Varied under EPR 2010 Positional Accuracy: Manually positioned to the road within the address or location	A8SW (S)	705	2	380262 411010
3	Discharge Consents Operator: John Maunders Group Plc Property Type: DOMESTIC PROPERTY (MULTIPLE) (INCL FARM HOUSES) Location: Residential Development, Woodhill Road, Bury, Greater Manchester Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 016991164 Permit Version: 1 Effective Date: 1st November 1994 Issued Date: Not Supplied Revocation Date: 1st November 1994 Discharge Type: Discharge Of Other Matter-Surface Water Discharge: Freshwater Stream/River Environment: Receiving Water: River Irwell Status: Lapsed (under Environment Act 1995, Schedule 23) Positional Accuracy: Located by supplier to within 100m	A12SW (SW)	718	2	379800 411400
4	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Badger St, Bury, Lancashire Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0015 Permit Version: 2 Effective Date: 3rd September 2010 Issued Date: 3rd September 2010 Revocation Date: 23rd March 2015 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Barn Brook Status: Surrendered under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A9NW (SE)	729	2	381160 411300
4	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Badger St, Bury, Lancashire Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 01BRY0015 Permit Version: 1 Effective Date: 1st January 1995 Issued Date: Not Supplied Revocation Date: 2nd September 2010 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Barn Brook Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 100m	A9NW (SE)	729	2	381160 411300

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
5	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Lower Woodhill Rd, Bury, Lancashire Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0013 Permit Version: 2 Effective Date: 3rd September 2010 Issued Date: 3rd September 2010 Revocation Date: 14th July 2014 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Woodhill Brook Status: Surrendered under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A7NW (SW)	813	2	379830 411180
5	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Lower Woodhill Rd, Bury, Lancashire Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 01BRY0013 Permit Version: 1 Effective Date: 1st January 1995 Issued Date: Not Supplied Revocation Date: 2nd September 2010 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Woodhill Brook Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 100m	A7NW (SW)	813	2	379830 411180
6	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Woodhill Road Cso 092jp Woodhill Road, ., Bury, Lancashire, B18 1ar Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0012 Permit Version: 2 Effective Date: 3rd September 2010 Issued Date: 3rd September 2010 Revocation Date: 4th February 2016 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Woodhill Brook Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A7NW (SW)	825	2	379710 411340
6	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Woodhill Road Cso 092jp Woodhill Road, ., Bury, Lancashire, B18 1ar Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 01BRY0012 Permit Version: 1 Effective Date: 1st January 1995 Issued Date: Not Supplied Revocation Date: 2nd September 2010 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Woodhill Brook Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 100m	A7NW (SW)	825	2	379710 411340

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
6	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Woodhill Road Cso 092jp Woodhill Road, ., Bury, Lancashire, BL8 1ar Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0012 Permit Version: 3 Effective Date: 5th February 2016 Issued Date: 5th February 2016 Revocation Date: 24th June 2018 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Woodhill Brook Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A7NW (SW)	830	2	379704 411341
6	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Woodhill Road Cso 092jp Woodhill Road, ., Bury, Lancashire, BL8 1ar Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0012 Permit Version: 4 Effective Date: 25th June 2018 Issued Date: 25th June 2018 Revocation Date: Not Supplied Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: Woodhill Brook Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A7NW (SW)	832	2	379702 411340
7	Discharge Consents Operator: Morris Homes Ltd Property Type: DOMESTIC PROPERTY (MULTIPLE) (INCL FARM HOUSES) Location: Morris Homes Development Swo, Salford Street/Falcon Close, Bury, Greater Manchester Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 016990600 Permit Version: 1 Effective Date: 16th May 1985 Issued Date: Not Supplied Revocation Date: 1st July 1991 Discharge Type: Discharge Of Other Matter-Surface Water Discharge: Freshwater Stream/River Environment: Receiving Water: Gipsy Brook Status: Authorisation revoked Positional Accuracy: Located by supplier to within 100m	A14NE (E)	916	2	381480 411730
8	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Walmersley Rd, Bury, Greater Manchester Authority: Environment Agency, North West Region Catchment Area: Not Supplied Reference: 01bry0009 Permit Version: 2 Effective Date: 3rd September 2010 Issued Date: 3rd September 2010 Revocation Date: 14th July 2014 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: River Irwell Status: Surrendered under EPR 2010 Positional Accuracy: Located by supplier to within 10m	A18NE (N)	994	2	380750 412720

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
8	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Walmersley Rd, Bury, Greater Manchester Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 01BRY0009 Permit Version: 1 Effective Date: 1st January 1995 Issued Date: Not Supplied Revocation Date: 2nd September 2010 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: River Irwell Status: Varied under EPR 2010 Positional Accuracy: Located by supplier to within 100m	A18NE (N)	994	2	380750 412720
9	Discharge Consents Operator: United Utilities Water Limited Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Location: Woodfield Catchment Area, Bury, Greater Manchester Authority: Environment Agency, North West Region Catchment Area: Not Given Reference: 016951239 Permit Version: 1 Effective Date: 5th February 1988 Issued Date: Not Supplied Revocation Date: 2nd July 2016 Discharge Type: Public Sewage: Storm Sewage Overflow Discharge: Freshwater Stream/River Environment: Receiving Water: River Irwell Status: Pre National Rivers Authority Legislation where issue date < 01/09/1989 Positional Accuracy: Located by supplier to within 10m	A7SW (SW)	995	2	379770 410980
10	Integrated Pollution Controls Name: Bury Cooper Whitehead Ltd Location: Hudcar Mills, Hudcar Lane, BURY, Lancashire, BL9 6HD Authority: Environment Agency, North West Region Permit Reference: AB4311 Dated: 18th May 1992 Process Type: IPC new application Description: 6.5 A (B) Coating processes and Printing within Miscellaneous Industries Status: Authorisation certificate surrendered by operator Positional Accuracy: Unknown	A14SW (E)	612	2	381174 411689
11	Integrated Pollution Controls Name: Mondi Holcombe Ltd Location: Holcombe Mill, Bridge Street, BURY, Lancashire, BL0 0BS Authority: Environment Agency, North West Region Permit Reference: BD4546 Dated: 24th November 1998 Process Type: IPC minor (non-substantial) variation to previous variation Description: 6.1 A (B) Paper and Pulp manufacturing processes within Miscellaneous Industries Status: Revoked - Now IPPC Positional Accuracy: Manually positioned to the address or location	A14SW (E)	647	2	381172 411510
11	Integrated Pollution Controls Name: Scandura Textiles Location: Porritt Street, BURY, Lancashire, BL9 6HJ Authority: Environment Agency, North West Region Permit Reference: AU2107 Dated: 9th July 1996 Process Type: IPC new application Description: 3.3 A Mineral Fibres (non-Asbestos) within the Mineral Industry Status: Authorisation superseded by a substantial or non substantial variation Positional Accuracy: Unknown	A14SE (E)	690	2	381213 411498
11	Integrated Pollution Controls Name: Scandura Textiles Location: P And S Textiles, Porrit Street, BURY, Lancashire, BL9 6HJ Authority: Environment Agency, North West Region Permit Reference: BD3698 Dated: 24th November 1998 Process Type: IPC minor (non-substantial) variation to previous variation Description: 3.3 A Mineral Fibres (non-Asbestos) within the Mineral Industry Status: Authorisation revoked Positional Accuracy: Unknown	A14SE (E)	691	2	381213 411493

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
12	Integrated Pollution Prevention And Control Name: Irwell Power Limited Location: Unit 28,29,30, Peel Mills Industrial Estate, Unit 28,29,30, Peel Mills Industrial Estate, Chamberhall Street,,, Bury, Lancashire, BL9 0JU Authority: Environment Agency, North West Region Permit Reference: RP3931QZ Original Permit Ref: Rp3931qz Effective Date: 3rd April 2020 Status: Effective Application Type: Application App. Sub Type: New Positional Accuracy: Located by supplier to within 10m Activity Code: 25B (3)(1)(a) Activity Description: Tranche B SG permitting date 1st January 2019 Primary Activity: Y	A13SW (SW)	211	2	380280 411580
13	Integrated Pollution Prevention And Control Name: Bury Power Limited Location: Chamberhall Street, Bury Power Limited, Chamberhall Street,,, Bury, Lancashire, BL9 0JU Authority: Environment Agency, North West Region Permit Reference: AP3031QS Original Permit Ref: Ap3031qs Effective Date: 3rd April 2020 Status: Effective Application Type: Application App. Sub Type: New Positional Accuracy: Located by supplier to within 10m Activity Code: 25B (3)(1)(a) Activity Description: Tranche B SG permitting date 1st January 2019 Primary Activity: Y	A13SW (SW)	308	2	380240 411480
14	Local Authority Pollution Prevention and Controls Name: Bettamix Concrete Ltd Location: Unit 1 Every Street Industrial Estate, Old Towns Yard, Every Street, Bury, BL9 5be Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC07-04 Dated: 1st March 2008 Process Type: Local Authority Pollution Prevention and Control Description: PG3/1Blending, packing, loading and use of bulk cement Status: Permitted Positional Accuracy: Located by supplier to within 100m	A13SW (SW)	0	3	380500 411700
15	Local Authority Pollution Prevention and Controls Name: Every Street Garage Location: Every Street, Fernhill, Bury, BL9 5BE Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC11-04 Dated: 1st February 2012 Process Type: Local Authority Pollution Prevention and Control Description: PG1/1Waste oil burners, less than 0.4MW net rated thermal input Status: Permitted Positional Accuracy: Manually positioned to the address or location	A13SE (SE)	120	3	380620 411585
15	Local Authority Pollution Prevention and Controls Name: Bardon Concrete Location: Every Street, Fernhill, BURY, Lancashire, BL9 Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: Lappc03-10 Dated: 1st November 2003 Process Type: Local Authority Pollution Prevention and Control Description: PG3/1Blending, packing, loading and use of bulk cement Status: Authorisation certificate surrendered by operator Positional Accuracy: Manually positioned to the road within the address or location	A13SE (SE)	141	3	380631 411566
16	Local Authority Pollution Prevention and Controls Name: A1 Independent Landrover Specialists Limited Location: Unit 4, Fernhill Street, Bury, BL9 5bg Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC13-04 Dated: Not Supplied Process Type: Local Authority Pollution Prevention and Control Description: PG1/1Waste oil burners, less than 0.4MW net rated thermal input Status: Permitted Positional Accuracy: Located by supplier to within 10m	A13SE (S)	172	3	380559 411494

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
17	Local Authority Pollution Prevention and Controls Name: The Timber Centre Location: Fernhill Street, BURY, Lancashire, BL9 5BH Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: Lappc03-06 Dated: 1st August 1992 Process Type: Local Authority Pollution Prevention and Control Description: PG6/2 Manufacture of timber and wood-based products Status: Site Closed Positional Accuracy: Automatically positioned to the address	A13SW (S)	178	3	380504 411487
18	Local Authority Pollution Prevention and Controls Name: P & S Textiles Ltd Location: Hornby Street, Bury, BL9 5bl Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC06-18 Dated: 1st April 2007 Process Type: Local Authority Pollution Prevention and Control Description: PG6/8 Textile and fabric coating of finishing processes Status: Authorised Positional Accuracy: Located by supplier to within 100m	A13SE (SE)	182	3	380700 411600
19	Local Authority Pollution Prevention and Controls Name: Wilcox Drums Ltd Location: Tile Street, BURY, Lancashire, BL9 5BQ Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: 10 Dated: 1st March 1993 Process Type: Local Authority Air Pollution Control Description: PG6/15 Coating in drum manufacturing and reconditioning processes Status: Authorisation revoked Positional Accuracy: Manually positioned to the road within the address or location	A13SE (S)	280	3	380601 411392
20	Local Authority Pollution Prevention and Controls Name: Geldards Dry Cleaners Location: 60 Walmersley Road, Bury, BL9 6dp Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC06-12 Dated: 1st January 2007 Process Type: Local Authority Pollution Prevention and Control Description: PG6/46 Dry cleaning Status: Authorised Positional Accuracy: Manually positioned to the address or location	A9NW (SE)	516	3	380933 411343
21	Local Authority Pollution Prevention and Controls Name: Tesco Stores Location: Peel Way, Woodfields Retail Park, BURY, Lancashire, BL9 5BY Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC05-15 Dated: Not Supplied Process Type: Local Authority Pollution Prevention and Control Description: PG1/14 Petrol filling station Status: Authorised Positional Accuracy: Manually positioned to the address or location	A8NE (S)	593	3	380525 411070
22	Local Authority Pollution Prevention and Controls Name: Moorside Garage Location: Brook Street, BURY, Lancashire, BL9 6AH Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: Ps24 Dated: Not Supplied Process Type: Local Authority Air Pollution Control Description: PG1/14 Petrol filling station Status: Authorised Positional Accuracy: Manually positioned to the address or location	A9NW (SE)	697	3	381108 411277
23	Local Authority Pollution Prevention and Controls Name: Beldam Lascar Location: Tan Pits Lane, BURY, Lancashire, BL9 0LY Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: 21 Dated: 1st March 1995 Process Type: Local Authority Air Pollution Control Description: PG3/13 Asbestos processes Status: Authorised Positional Accuracy: Manually positioned to the road within the address or location	A8SW (S)	707	3	380262 411008

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
24	Local Authority Pollution Prevention and Controls Name: Scandura Textiles Location: Porritt Street, BURY, BL9 6HJ Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: 20 Dated: 1st February 1996 Process Type: Local Authority Air Pollution Control Description: PG6/8 Textile and fabric coating of finishing processes Status: Authorisation revoked Positional Accuracy: Manually positioned to the road within the address or location	A14SE (E)	750	3	381287 411531
25	Local Authority Pollution Prevention and Controls Name: Bp Prospect Location: Brandleshome Road, BURY, BL8 1AU Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC05-25 Dated: 1st September 2004 Process Type: Local Authority Pollution Prevention and Control Description: PG1/14 Petrol filling station Status: Authorised Positional Accuracy: Manually positioned to the address or location	A12SW (W)	825	3	379629 411613
26	Local Authority Pollution Prevention and Controls Name: H & J Quick Ltd Location: Derby Street, BURY, Lancashire, BL9 0NW Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: 6 Dated: 1st August 1992 Process Type: Local Authority Air Pollution Control Description: PG6/34 Respraying of road vehicles Status: Authorised Positional Accuracy: Manually positioned to the road within the address or location	A9SW (SE)	853	3	380935 410913
27	Local Authority Pollution Prevention and Controls Name: Alenco Dry Cleaners Location: 44 Bolton Street, Bury, BL9 0ll Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC06-11 Dated: 1st February 2007 Process Type: Local Authority Pollution Prevention and Control Description: PG6/46 Dry cleaning Status: Permitted Positional Accuracy: Manually positioned to the address or location	A8SW (S)	877	3	380225 410840
28	Local Authority Pollution Prevention and Controls Name: Bcc Citreon Location: Tottington Road, Bury, BL8 1SW Authority: Bury Metropolitan Borough Council, Environmental Health Department Permit Reference: LAPPC12-01 Dated: Not Supplied Process Type: Local Authority Pollution Prevention and Control Description: PG1/1Waste oil burners, less than 0.4MW net rated thermal input Status: Permitted Positional Accuracy: Manually positioned to the road within the address or location	A7NW (SW)	989	3	379602 411196
	Nearest Surface Water Feature	A13NW (W)	209	-	380258 411793
29	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Greater Manchester Authority: Environment Agency, North West Region Pollutant: Unknown Note: None Affected; No Pollution Found Incident Date: 26th September 1996 Incident Reference: 96622087 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Other Incident/Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A13SW (W)	144	2	380305 411695

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
29	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Location Description Not Available Authority: Environment Agency, North West Region Pollutant: Miscellaneous - Other Note: River Irwell; Drums Incident Date: 3rd July 1995 Incident Reference: 95621618 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Vandalism Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A13SW (W)	149	2	380300 411695
30	Pollution Incidents to Controlled Waters Property Type: Industrial: Other Location: River Irwell, Castle Croft Street, BURY Authority: Environment Agency, North West Region Pollutant: Miscellaneous - Other Note: Drums In River Incident Date: 2nd May 1998 Incident Reference: SO980770 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: Vandalism Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A13NW (NW)	166	2	380400 411900
31	Pollution Incidents to Controlled Waters Property Type: Water Company Sewage: Combined Sewer Overflow Location: BURY Authority: Environment Agency, North West Region Pollutant: Sewage - Storm Overflow Note: Crude Sewage; Seedfield Brook; Crude Sewage Incident Date: 21st April 1997 Incident Reference: 97620688 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: CSO Normal Operation Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18SW (N)	452	2	380400 412200
32	Pollution Incidents to Controlled Waters Property Type: Private Sewage (Non-PLC): Sewerage Systems Location: Location Description Not Available Authority: Environment Agency, North West Region Pollutant: Unknown Sewage Note: Tributary River Irwell Incident Date: 16th August 1991 Incident Reference: 91621318 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18SW (N)	544	2	380500 412300
33	Pollution Incidents to Controlled Waters Property Type: Private Sewage (Non-PLC): Sewerage Systems Location: Location Description Not Available Authority: Environment Agency, North West Region Pollutant: Sewage Debris/Litter Note: Tributary River Irwell; Storm Sewage Incident Date: 22nd November 1994 Incident Reference: 94622549 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Miscellaneous/Other Pollution Type Incident Severity: Category 2 - Significant Incident Positional Accuracy: Located by supplier to within 100m	A18SW (N)	551	2	380400 412300
34	Pollution Incidents to Controlled Waters Property Type: Connection To Surface Drains Location: Location Description Not Available Authority: Environment Agency, North West Region Pollutant: Crude Sewage Note: River Irwell Incident Date: 20th April 1994 Incident Reference: 94620875 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Wrong Connection Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18SW (NW)	613	2	380200 412300

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
35	Pollution Incidents to Controlled Waters Property Type: Private Sewage (Non-PLC): Combined Sewer Overflow Location: Seedfield , BURY Authority: Environment Agency, North West Region Pollutant: Sewage - Storm Overflow Note: Storm Sewage; Tributary Of Irwell; Storm Sewage Incident Date: 28th April 1997 Incident Reference: 97620749 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: High Flow Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18NW (N)	663	2	380305 412395
35	Pollution Incidents to Controlled Waters Property Type: Water Company Sewage: Combined Sewer Overflow Location: Sewage Entering Stream From, Pipe Near West Drive Authority: Environment Agency, North West Region Pollutant: Sewage - Storm Overflow Note: Tributary Of Irwell; Crude Sewage Incident Date: 27th September 1997 Incident Reference: 97621711 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: Blocked Sewer Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18NW (N)	665	2	380300 412395
35	Pollution Incidents to Controlled Waters Property Type: Private Sewage (Non-PLC): Combined Sewer Overflow Location: West Dr , BURY Authority: Environment Agency, North West Region Pollutant: Sewage - Storm Overflow Note: Tributary River Irwell; Crude Sewage Incident Date: 13th April 1997 Incident Reference: 97620611 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: Blocked Sewer Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18NW (N)	669	2	380300 412400
36	Pollution Incidents to Controlled Waters Property Type: WSC Sewage, Sewerage & Supply: Southern Water Ltd Location: William Hair, Castlecroft, CASTLECROFT, Greater Manchester Authority: Environment Agency, North West Region Pollutant: Crude Sewage Note: Not Supplied Incident Date: 5th August 1999 Incident Reference: 31030 Catchment Area: Irwell Receiving Water: River Stretch (Freshwater) Cause of Incident: Climatic Conditions : Localised High Rainfall Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A7NE (SW)	676	2	380001 411201
37	Pollution Incidents to Controlled Waters Property Type: Manufacturing: Other Manufacturing Location: Panpits Road, Greater Manchester Authority: Environment Agency, North West Region Pollutant: Contaminated Material : Fire Fighting Run Off Note: Not Supplied Incident Date: 27th September 1999 Incident Reference: 32815 Catchment Area: Irwell Receiving Water: River Stretch (Freshwater) Cause of Incident: Other Cause Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A8SW (S)	701	2	380300 411000
38	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Greater Manchester Authority: Environment Agency, North West Region Pollutant: Unknown Note: None Affected; Foam Reported Incident Date: 19th January 1996 Incident Reference: 96620131 Catchment Area: Roch Receiving Water: Not Given Cause of Incident: Other Incident/Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A19SW (NE)	717	2	381000 412300

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
39	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Greater Manchester Authority: Environment Agency, North West Region Pollutant: Unknown Note: None Affected; Dyes Incident Date: 28th July 1996 Incident Reference: 96621681 Catchment Area: Roch Receiving Water: Not Given Cause of Incident: Not Given Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A14SE (E)	737	2	381300 411700
40	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Brook Behind , 35 Oakham Close Authority: Environment Agency, North West Region Pollutant: Algae Note: Green Slime In Brook Incident Date: 5th October 1998 Incident Reference: SO981805 Catchment Area: Manchester; Bolton; Bury Canal Receiving Water: Canal Cause of Incident: Natural Causes Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A17NE (NW)	804	2	380001 412401
41	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Location Description Not Available Authority: Environment Agency, North West Region Pollutant: Oils - Gas Oil Note: Kirklees Brook Incident Date: 9th November 1995 Incident Reference: 95622752 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Leaking Tank Incident Severity: Category 2 - Significant Incident Positional Accuracy: Located by supplier to within 100m	A7NW (SW)	852	2	379700 411300
42	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Greater Manchester Authority: Environment Agency, North West Region Pollutant: Unknown Note: River Irwell; No Pollution Found Incident Date: 19th June 1995 Incident Reference: 95621464 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Other Incident/Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A9SW (SE)	875	2	381100 411000
43	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Location Description Not Available Authority: Environment Agency, North West Region Pollutant: Miscellaneous - Natural Note: River Irwell; Blue Green Algae Incident Date: 15th September 1995 Incident Reference: 95622330 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Miscellaneous/Other Pollution Type Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A17NE (NW)	887	2	380001 412501
44	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Greater Manchester Authority: Environment Agency, North West Region Pollutant: Unknown Note: Kirklees Brook; None Pollution Found Incident Date: 20th September 1995 Incident Reference: 95622368 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Other Incident/Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A7NW (SW)	888	2	379800 411100

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
45	Pollution Incidents to Controlled Waters Property Type: Private Sewage (Non-PLC): Combined Sewer Overflow Location: River Irwell, BURY Authority: Environment Agency, North West Region Pollutant: Sewage - Storm Overflow Note: Grey Liquid Incident Date: 4th June 1998 Incident Reference: SO981013 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: Blocked Sewer Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A7SE (SW)	895	2	379900 411000
46	Pollution Incidents to Controlled Waters Property Type: Water Company Sewage: Storm Overflow Location: Crude Sewage Overflow Operating, West Drive, BURY Authority: Environment Agency, North West Region Pollutant: Sewage - Storm Overflow Note: Not Supplied Incident Date: 24th November 1998 Incident Reference: SO982090 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: Blocked Sewer Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18NW (N)	948	2	380400 412700
47	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Dead Fish In Physlee Brook Up Stream, River Authority: Environment Agency, North West Region Pollutant: Not Given Note: Pigs Lee Brook; Unknown Incident Date: 24th August 1997 Incident Reference: 97621558 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A18NW (N)	962	2	380300 412700
48	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Greater Manchester Authority: Environment Agency, North West Region Pollutant: Unknown Note: None Affected; No Pollution Found Incident Date: 10th July 1996 Incident Reference: 96621792 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Other Incident/Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A12SW (W)	971	2	379500 411500
49	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Foam & Oil In Irwell, BURY Authority: Environment Agency, North West Region Pollutant: Miscellaneous - Foam Note: Factories Upstream Incident Date: 9th September 1998 Incident Reference: SO981644 Catchment Area: Irwell Receiving Water: Freshwater Stream/River Cause of Incident: High Flow Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A17NE (NW)	972	2	380001 412601
50	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Location Description Not Available Authority: Environment Agency, North West Region Pollutant: Oils - Unknown Note: Gypsy Brook Incident Date: 17th February 1995 Incident Reference: 95620330 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Other Incident/Unknown Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A14NE (E)	974	2	381500 412000

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
51	Pollution Incidents to Controlled Waters Property Type: Not Given Location: Greater Manchester Authority: Environment Agency, North West Region Pollutant: Miscellaneous - Other Note: Kirklees Brook; Paper Mill Effluent Incident Date: 6th September 1996 Incident Reference: 96621976 Catchment Area: Irwell Receiving Water: Not Given Cause of Incident: Not Given Incident Severity: Category 3 - Minor Incident Positional Accuracy: Located by supplier to within 100m	A12SW (W)	997	2	379500 411400
52	Registered Radioactive Substances Name: Bury Health Care Nhs Trust Location: Bury General Hospital, Walmersley Road, BURY, Lancashire, BL9 6PG Authority: Environment Agency, North West Region Permit Reference: AU4762 Dated: 23rd July 1996 Process Type: Authorisation under S13 RSA for the disposal of Radioactive waste (was RSA60 S7) Description: Authorisation under RSA Status: Authorisation either revoked or cancelled Positional Accuracy: Unknown	A18NE (N)	781	2	380818 412476
	River Quality Name: Irwell GQA Grade: River Quality C Reach: Chest Wheel Bridge To Roch Estimated Distance (km): 10.3 Flow Rate: Flow less than 5 cumecs Flow Type: River Year: 2000	A13NW (W)	205	2	380253 411772
	River Quality Name: Kirklees Bk GQA Grade: River Quality C Reach: Olives Paper Mill To Irwell Estimated Distance (km): .7 Flow Rate: Flow less than 0.31 cumecs Flow Type: River Year: 2000	A7NW (SW)	837	2	379803 411173
	River Quality Name: Pigs Lee Bk GQA Grade: River Quality D Reach: Qsl At A56 To Irwell Estimated Distance (km): .9 Flow Rate: Flow less than 0.31 cumecs Flow Type: River Year: 2000	A18NW (N)	851	2	380231 412569
	River Quality Name: Kirklees Bk GQA Grade: River Quality B Reach: Qsl At Brookhouse Bridge To Olives Paper Estimated Distance (km): 3.8 Flow Rate: Flow less than 0.31 cumecs Flow Type: River Year: 2000	A11SE (W)	985	2	379469 411610

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
53	River Quality Chemistry Sampling Points Name: Kirklees Brook Reach: Olives Paper Mill To Irwell Estimated Distance: 0.70 Objective: Not Supplied Positional Accuracy: Located by supplier to within 10m Year: 1990 GQA Grade: River Quality Chemistry GQA Grade C - Fairly Good Compliance: Not Supplied Year: 1993 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 1994 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 1995 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 1996 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 1997 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 1998 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 1999 GQA Grade: River Quality Chemistry GQA Grade B - Good Compliance: Not Supplied Year: 2000 GQA Grade: River Quality Chemistry GQA Grade B - Good Compliance: Not Supplied Year: 2001 GQA Grade: River Quality Chemistry GQA Grade B - Good Compliance: Not Supplied Year: 2002 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 2003 GQA Grade: River Quality Chemistry GQA Grade B - Good Compliance: Not Supplied Year: 2004 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 2005 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 2006 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 2007 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 2008 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied Year: 2009 GQA Grade: River Quality Chemistry GQA Grade A - Very Good Compliance: Not Supplied	A7NE (SW)	820	2	379832 411166
54	Substantiated Pollution Incident Register Authority: Environment Agency - North West Region, South Area Incident Date: 6th June 2007 Incident Reference: 500798 Water Impact: Category 3 - Minor Incident Air Impact: Category 3 - Minor Incident Land Impact: Category 2 - Significant Incident Positional Accuracy: Located by supplier to within 10m Pollutant: Inert : Construction / Demolition Material Pollutant: Specific Waste Materials: Commercial Waste Pollutant: Specific Waste Materials: Household Waste	A13SW (W)	161	2	380306 411633

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
55	Water Abstractions Operator: P & S Textiles Ltd Licence Number: 2569001015 Permit Version: Not Supplied Location: Fernhill Mill, Shornby Street, BURY, Lancashire Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: Groundwater Daily Rate (m3): 227 Yearly Rate (m3): 81828 Details: Not Supplied Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A13SE (E)	140	2	380700 411700
56	Water Abstractions Operator: Wilcox Drums Ltd Licence Number: 2569001014 Permit Version: 100 Location: Borehole At Premises, Bury Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: General Cooling (Existing Licences Only) (Low Loss) Abstraction Type: Water may be abstracted from a single point Source: Groundwater Daily Rate (m3): 114 Yearly Rate (m3): 27276 Details: Premises At Bury, Lancs Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 1st April 1993 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A13SW (W)	149	2	380300 411700
56	Water Abstractions Operator: Wilcox Drums Ltd Licence Number: 2569001014 Permit Version: 100 Location: Borehole At Premises, Bury Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: Process Water Abstraction Type: Water may be abstracted from a single point Source: Groundwater Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Premises At Bury, Lancs Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 1st April 1993 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SW (W)	149	2	380300 411700
57	Water Abstractions Operator: Bury Council Licence Number: Nw/069/0001/007 Permit Version: 1 Location: River Irwell At Chamber Hall Weir Authority: Environment Agency, North West Region Abstraction: Production Of Energy: Hydroelectric Power Generation Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Chamber Hall Weir, Bury Authorised Start: 01 April Authorised End: 31 March Permit Start Date: 10th June 2016 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A12SE (SW)	529	2	380014 411406

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
58	Water Abstractions Operator: Bury Cooper Whitehead Ltd. Licence Number: 2569002211 Permit Version: Not Supplied Location: Bury, BURY, Lancashire Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: River Daily Rate (m3): 546 Yearly Rate (m3): 50006 Details: Green Brook A Tributary Of Barn Brook Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A14SE (E)	637	2	381200 411700
59	Water Abstractions Operator: Bury Cooper Whitehead Ltd Licence Number: 2569002212 Permit Version: Not Supplied Location: Springfield Mills, BURY Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: River Daily Rate (m3): 9728 Yearly Rate (m3): 86400 Details: Gypsy Brook A Tributary Of Barn Brook Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A14SE (E)	748	2	381300 411600
60	Water Abstractions Operator: Bury Cooper Whitehead Ltd. Licence Number: 2569001107 Permit Version: Not Supplied Location: Borehole, Hudcar Mills, BURY Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: Groundwater Daily Rate (m3): 86 Yearly Rate (m3): 9092 Details: Licence Status: Revoked Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A14SE (E)	772	2	381300 411500
61	Water Abstractions Operator: Bury Metropolitan Borough Council Licence Number: 2569001289r01 Permit Version: 1 Location: Tributary Of The River Irwell, At Clarence Park Lido Authority: Environment Agency, North West Region Abstraction: Amenity: Lake And Pond Throughflow Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Not Supplied Authorised Start: 01 April Authorised End: 31 March Permit Start Date: 1st April 2015 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A19SE (NE)	876	2	381211 412322

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
61	Water Abstractions Operator: Bury Metropolitan Borough Council Licence Number: 2569001289 Permit Version: 1 Location: Tributary Of The River Irwell, At Clarence Park Lido Authority: Environment Agency, North West Region Abstraction: Amenity: Lake And Pond Throughflow Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Not Supplied Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 22nd December 2008 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A19SE (NE)	876	2	381211 412322
62	Water Abstractions Operator: Activecraft Limited; Papermakers Licence Number: 2569001170 Permit Version: Not Supplied Location: Kirklees Brk And Reservoir Fed By Kirkle, Woolford Paper Mills Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: River Daily Rate (m3): 0 Yearly Rate (m3): 0 Details: Licence Status : Current Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A12SW (W)	972	2	379500 411495
	Water Abstractions Operator: Dorron Roller Ltd Licence Number: 2569001211 Permit Version: Not Supplied Location: Un-Named Tributary Of River Irwell, BURY Authority: Environment Agency, North West Region Abstraction: Cooling Abstraction Type: Not Supplied Source: Surface Daily Rate (m3): 145 Yearly Rate (m3): 45460 Details: Licence Status: Revoked Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A7SW (SW)	1242	2	379600 410800
	Water Abstractions Operator: Cemex Uk Materials Ltd Licence Number: 2569001285r01 Permit Version: 2 Location: River Irwell At Rmc Northernt Bury Canal Wharf Authority: Environment Agency, North West Region Abstraction: Construction: General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Not Supplied Authorised Start: 01 April Authorised End: 31 March Permit Start Date: 21st December 2018 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A2NW (SW)	1255	2	379706 410696

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Water Abstractions Operator: Cemex Uk Materials Ltd Licence Number: 2569001285r01 Permit Version: 1 Location: River Irwell At Rmc Northernt Bury Canal Wharf Authority: Environment Agency, North West Region Abstraction: Construction: General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Not Supplied Authorised Start: 01 April Authorised End: 31 March Permit Start Date: 1st April 2015 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A2NW (SW)	1255	2	379706 410696
	Water Abstractions Operator: Cemex Uk Materials Ltd Licence Number: 2569001285 Permit Version: 2 Location: River Irwell At Rmc Northernt Bury Canal Wharf Authority: Environment Agency, North West Region Abstraction: Construction: General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Land At Rmc Northern Bury Canal Wharf Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 1st April 2008 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A2NW (SW)	1255	2	379706 410696
	Water Abstractions Operator: Rmc Materials Ltd Licence Number: 2569001285 Permit Version: 1 Location: River Irwell At Rmc Northernt Bury Canal Wharf Authority: Environment Agency, North West Region Abstraction: Construction: General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Land At Rmc Northern Bury Canal Wharf Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 23rd March 2005 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A2NW (SW)	1255	2	379706 410696
	Water Abstractions Operator: J R Crompton P.L.C. Licence Number: 2569001140 Permit Version: Not Supplied Location: Premises, BURY Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: Surface Daily Rate (m3): 4787 Yearly Rate (m3): 1436536 Details: River Irwell Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A2NW (SW)	1336	2	379700 410600

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Water Abstractions Operator: R Fitton Licence Number: 2569001123 Permit Version: 100 Location: Well At Irwell View Farm, Walmesley, Bury, Lancashire Authority: Environment Agency, North West Region Abstraction: General Agriculture; General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Groundwater Daily Rate (m3): 3 Yearly Rate (m3): 1214 Details: Irwell View Farm, Walmesley, Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 19th January 1966 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A22NE (N)	1397	2	380100 413100
	Water Abstractions Operator: Activecraft Ltd Papermakers Licence Number: 2569001170 Permit Version: 100 Location: Reservoir Fed By Kirkless Brook And Surface Drainage Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: Process Water Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): 3182 Yearly Rate (m3): 850102 Details: Premises, Woolfold Paper Mills, Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 16th June 1995 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A11NW (W)	1462	2	379000 411900
	Water Abstractions Operator: Activecraft Ltd Papermakers Licence Number: 2569001017 Permit Version: 100 Location: Borehole At Premises, Olives Papermills, Bury Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: Process Water Abstraction Type: Water may be abstracted from a single point Source: Groundwater Daily Rate (m3): 1591 Yearly Rate (m3): 154564 Details: Premises, Olives Paper Mills, Woolfold Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 16th June 1995 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A11NW (W)	1478	2	379000 412000
	Water Abstractions Operator: Bury Cooper Whitehead Ltd. Licence Number: 2569001116 Permit Version: Not Supplied Location: Bury, BURY Authority: Environment Agency, North West Region Abstraction: Transfer Water Abstraction Type: Not Supplied Source: River Daily Rate (m3): 2618 Yearly Rate (m3): 27276 Details: Pigs Lee Stream Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	(N)	1690	2	380900 413400

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Water Abstractions Operator: The Elton Cop Dyeing Co Ltd Licence Number: 2569001160 Permit Version: 100 Location: Reservoirs Fed By Elton Brk At Bury [10 Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: Process Water Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): 0 Yearly Rate (m3): 0 Details: Premises At Walshaw Road, Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 25th February 1975 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	(SW)	1794	2	378800 411000
	Water Abstractions Operator: J R Crompton P.L.C. Licence Number: 2569001138 Permit Version: Not Supplied Location: Known As Deardens Lodge, BURY Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: River Daily Rate (m3): 1091 Yearly Rate (m3): 136380 Details: Reservoir Fed By Surface Drainage Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A1SE (SW)	1816	2	379300 410300
	Water Abstractions Operator: Raymond Taylor Licence Number: 2569001284 Permit Version: 1 Location: Borehole At Sillinghurst Farm Birtle Bury Authority: Environment Agency, North West Region Abstraction: General Farming And Domestic Abstraction Type: Water may be abstracted from a single point Source: Groundwater Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Sillinghurst Farm, Birtle, Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 1st April 2008 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	A25SE (NE)	1861	2	382080 412810
	Water Abstractions Operator: J R Crompton P.L.C. Licence Number: 2569001139 Permit Version: Not Supplied Location: Bury Authority: Environment Agency, North West Region Abstraction: Manufacturing Abstraction Type: Not Supplied Source: Groundwater Daily Rate (m3): 391 Yearly Rate (m3): 118196 Details: Borehole Near Premises Authorised Start: Not Supplied Authorised End: Not Supplied Permit Start Date: Not Supplied Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A1SE (SW)	1881	2	379200 410300

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Water Abstractions Operator: Activecraft Ltd Papermakers Licence Number: 2569001170 Permit Version: 100 Location: Kirklees Brk At Woolfold, Bury Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: Process Water Abstraction Type: Water may be abstracted from a river or stream reach, or a row of wellpoints Source: Surface Daily Rate (m3): 0 Yearly Rate (m3): 0 Details: Premises, Woolfold Paper Mills, Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 16th June 1995 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	(NW)	1920	2	378700 412500
	Water Abstractions Operator: Mr & Mrs J G Moore Licence Number: 2569001178 Permit Version: 100 Location: Borehole At Premises, Ninevah Farm, Bury Authority: Environment Agency, North West Region Abstraction: General Agriculture; General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Groundwater Daily Rate (m3): 14 Yearly Rate (m3): 5001 Details: Premises, Ninevah Farm, Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 14th January 1969 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A25NW (NE)	1920	2	381800 413200
	Water Abstractions Operator: Mr R R Taylor Licence Number: 2569001196 Permit Version: 100 Location: Spring Fed Collecting Tank At Birtle, Bury Authority: Environment Agency, North West Region Abstraction: General Agriculture; General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Groundwater Daily Rate (m3): 14 Yearly Rate (m3): 5001 Details: Sillinghurst Farm, Birtle, Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 25th November 1974 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	A25SE (NE)	1930	2	382100 412900
	Water Abstractions Operator: Curtain Styling Ltd Licence Number: 2569001155 Permit Version: 100 Location: Reservoir Fed By Surface Drainage Atbury, (Known As Parkers) Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: Boiler Feed Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): 20 Yearly Rate (m3): 8300 Details: Elton Vale Bleachworks At Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 3rd January 1975 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 100m	(W)	1979	2	378600 411000

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Water Abstractions Operator: Curtain Styling Ltd Licence Number: 2569001155 Permit Version: 100 Location: Reservoir Fed By Surface Drainage Atbury, (Known As Parkers Authority: Environment Agency, North West Region Abstraction: Other Industrial/Commercial/Public Services: General Use (Medium Loss) Abstraction Type: Water may be abstracted from a single point Source: Surface Daily Rate (m3): Not Supplied Yearly Rate (m3): Not Supplied Details: Elton Vale Bleachworks At Bury Authorised Start: 01 January Authorised End: 31 December Permit Start Date: 3rd January 1975 Permit End Date: Not Supplied Positional Accuracy: Located by supplier to within 10m	(W)	1979	2	378600 411000
	Groundwater Vulnerability Map Combined Secondary Superficial Aquifer - Low Vulnerability Classification: Low Combined Vulnerability: Productive Bedrock Aquifer, Productive Superficial Aquifer Pollutant Speed: Low Bedrock Flow: Well Connected Fractures Dilution: >550 mm/year Baseflow Index: <40% Superficial >90% Patchiness: 3-10m Superficial Thickness: Medium Superficial Recharge:	A13NE (SW)	0	4	380508 411713
	Groundwater Vulnerability - Soluble Rock Risk None				
	Bedrock Aquifer Designations Aquifer Designation: Secondary Aquifer - A	A13NE (SW)	0	4	380508 411713
	Superficial Aquifer Designations Aquifer Designation: Secondary Aquifer - Undifferentiated	A13NE (SW)	0	4	380508 411713
	Extreme Flooding from Rivers or Sea without Defences Type: Extent of Extreme Flooding from Rivers or Sea without Defences Flood Plain Type: Fluvial Models Boundary Accuracy: As Supplied	A13NW (NW)	194	2	380282 411812
	Flooding from Rivers or Sea without Defences Type: Extent of Flooding from Rivers or Sea without Defences Flood Plain Type: Fluvial Models Boundary Accuracy: As Supplied	A13NW (NW)	194	2	380282 411812
	Areas Benefiting from Flood Defences None				
	Flood Water Storage Areas None				
	Flood Defences None				
63	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 375.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A13NW (W)	222	5	380245 411796
64	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 711.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A12SE (W)	312	5	380140 411666

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
65	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 23.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12SE (W)	312	5	380140 411666
66	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 22.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A13NW (NW)	317	5	380280 412000
67	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 160.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A13NW (NW)	323	5	380269 411999
68	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 225.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A18SW (NW)	454	5	380290 412168
69	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 12.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A18SW (NW)	467	5	380250 412162
70	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 137.8 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18SW (NW)	468	5	380239 412156
71	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 40.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A7NE (SW)	517	5	380147 411287
72	OS Water Network Lines Watercourse Form: Lake Watercourse Length: 119.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A7NE (SW)	548	5	380151 411247
73	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 360.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A17SE (NW)	566	5	380076 412151

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
74	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 589.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A14NW (E)	595	5	381159 411750
75	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 51.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18SW (NW)	603	5	380195 412287
76	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 13.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18SW (NW)	603	5	380195 412287
77	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 15.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 2	A18SW (NW)	610	5	380183 412288
78	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 14.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18SW (NW)	610	5	380183 412288
79	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 20.4 Watercourse Level: Underground Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NE (NW)	619	5	379890 411973
80	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 195.8 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A14SW (E)	622	5	381168 411582
81	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 102.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Gipsy Brook Catchment Name: Mersey Primacy: 1	A14SW (E)	622	5	381168 411582
82	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 2.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A17SE (NW)	624	5	380100 412249

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
83	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 23.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18SW (NW)	624	5	380176 412299
84	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 518.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A17SE (NW)	625	5	380097 412249
85	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 10.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NE (NW)	639	5	379874 411984
86	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 86.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A17SE (NW)	647	5	380161 412317
87	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 12.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 2	A17SE (NW)	647	5	380161 412317
88	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 56.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NE (NW)	648	5	379863 411984
89	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 247.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A17SE (NW)	654	5	380166 412329
90	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 294.5 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NW (W)	670	5	379806 411897
91	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 3.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NW (W)	670	5	379806 411897

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
92	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 3.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NW (W)	671	5	379806 411900
93	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 59.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NW (W)	671	5	379824 411953
94	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 64.2 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12NW (W)	673	5	379803 411898
95	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 9.8 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A14SW (SE)	686	5	381158 411387
96	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 4.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A14SW (SE)	692	5	381159 411377
97	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 9.2 Watercourse Level: On ground surface Permanent: True Watercourse Name: Gipsy Brook Catchment Name: Mersey Primacy: 1	A14SE (E)	692	5	381251 411641
98	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 46.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A14SW (SE)	695	5	381161 411373
99	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 13.1 Watercourse Level: Underground Permanent: True Watercourse Name: Gipsy Brook Catchment Name: Mersey Primacy: 1	A14SE (E)	699	5	381258 411647
100	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 13.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: Gipsy Brook Catchment Name: Mersey Primacy: 1	A14SE (E)	705	5	381265 411658

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
101	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 493.9 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A14SE (E)	717	5	381277 411663
102	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 70.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Gipsy Brook Catchment Name: Mersey Primacy: 1	A14SE (E)	717	5	381277 411663
103	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 286.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A19SW (NE)	720	5	381135 412170
104	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 227.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A9NW (SE)	724	5	381095 411213
105	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 1.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A9NW (SE)	724	5	381171 411330
106	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 6.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A9NW (SE)	726	5	381172 411328
107	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 124.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12SW (W)	736	5	379719 411615
108	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 18.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A9NW (SE)	770	5	381087 411133
109	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 98.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Gipsy Brook Catchment Name: Mersey Primacy: 1	A14SE (E)	783	5	381346 411680

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
110	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 7.7 Watercourse Level: Underground Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A9NW (SE)	787	5	381101 411123
111	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 106.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 2	A18NW (N)	792	5	380256 412515
112	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 112.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18NW (N)	792	5	380256 412515
113	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 42.2 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A9NW (SE)	795	5	381105 411116
114	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 1040.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Barn Brook Catchment Name: Mersey Primacy: 1	A9NW (SE)	819	5	381098 411075
115	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 13.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A7NW (SW)	820	5	379817 411183
116	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 54.2 Watercourse Level: Underground Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A7NW (SW)	820	5	379817 411183
117	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 144.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A7NW (SW)	823	5	379782 411225
118	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 57.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A7NW (SW)	826	5	379821 411170

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
119	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 5.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A7NW (SW)	826	5	379821 411170
120	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 119.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A7NE (SW)	828	5	379924 411067
121	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 231.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A7NW (SW)	833	5	379700 411343
122	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 4.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A7NW (SW)	833	5	379700 411343
123	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 132.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A12SW (W)	845	5	379620 411541
124	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 65.2 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A7NE (SW)	857	5	379835 411108
125	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 11.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A7NE (SW)	857	5	379835 411108
126	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 10.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A14SE (E)	864	5	381427 411705
127	OS Water Network Lines Watercourse Form: Reservoir Watercourse Length: 18.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A14SE (E)	864	5	381427 411705

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
128	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 182.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: Gipsy Brook Catchment Name: Mersey Primacy: 1	A14SE (E)	867	5	381430 411696
129	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 53.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18NW (N)	887	5	380251 412612
130	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 561.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A7NW (SW)	917	5	379813 411047
131	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 212.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A18NW (N)	931	5	380211 412646
132	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 76.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Pigs Lee Brook Catchment Name: Mersey Primacy: 1	A18NW (N)	931	5	380211 412646
133	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 12.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A12SW (W)	947	5	379531 411474
134	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 2.1 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A12SW (W)	958	5	379518 411476
135	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 167.3 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 2	A12SW (W)	960	5	379516 411477
136	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 2.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A12SW (W)	960	5	379516 411477

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
137	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 12.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A12SW (W)	962	5	379514 411477
138	OS Water Network Lines Watercourse Form: Lake Watercourse Length: 26.2 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A11SE (W)	963	5	379489 411624
139	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 53.1 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A19NE (NE)	965	5	381264 412396
140	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 183.9 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A19NE (NE)	965	5	381264 412396
141	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 89.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 2	A7NW (SW)	970	5	379584 411268
142	OS Water Network Lines Watercourse Form: Lake Watercourse Length: 86.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A11SE (W)	970	5	379485 411600
143	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 151.6 Watercourse Level: On ground surface Permanent: True Watercourse Name: Kirklees Brook Catchment Name: Mersey Primacy: 1	A12SW (W)	973	5	379502 411480
144	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 301.6 Watercourse Level: Underground Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 2	A7NW (SW)	978	5	379585 411247
145	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 13.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Pigs Lee Brook Catchment Name: Mersey Primacy: 1	A18NW (N)	985	5	380247 412713

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
146	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 24.7 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A18NW (N)	985	5	380247 412713
147	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 131.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 2	A17NE (NW)	985	5	379936 412576
148	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 68.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A17NE (NW)	989	5	379914 412566
149	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 95.9 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A17NE (NW)	989	5	379914 412566
150	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 151.1 Watercourse Level: Not Supplied Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A18NW (N)	995	5	380225 412717
151	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 99.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: Pigs Lee Brook Catchment Name: Mersey Primacy: 1	A23SW (N)	998	5	380248 412726
152	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 74.0 Watercourse Level: On ground surface Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 1	A23SW (N)	998	5	380248 412726
153	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 191.4 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 2	A17NE (NW)	999	5	379854 412534
154	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 189.5 Watercourse Level: On ground surface Permanent: True Watercourse Name: River Irwell Catchment Name: Mersey Primacy: 1	A17NE (NW)	999	5	379850 412531

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
155	OS Water Network Lines Watercourse Form: Inland river Watercourse Length: 6.8 Watercourse Level: Underground Permanent: True Watercourse Name: Not Supplied Catchment Name: Mersey Primacy: 2	A7NW (W)	999	5	379529 411315

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
156	BGS Recorded Landfill Sites Site Name: Woodfields Location: BURY, Gt Manchester Authority: British Geological Survey, National Geoscience Information Service Ground Water: Information not available Surface Water: Information not available Geology: N/A Positional Accuracy: Positioned by the supplier Boundary Accuracy: Good	A8NE (S)	409	-	380620 411264
157	Historical Landfill Sites Licence Holder: Not Supplied Location: Bury, Greater Manchester Name: Woodfields Operator Location: Not Supplied Boundary Accuracy: As Supplied Provider Reference: EAHLD15774 First Input Date: 31st October 1971 Last Input Date: Not Supplied Specified Waste Type: Deposited Waste included Industrial, Commercial and Household Waste, and Liquid Sludge EA Waste Ref: 0 Regis Ref: Not Supplied WRC Ref: Not Supplied BGS Ref: 1084 Other Ref: C079	A8NE (S)	383	2	380526 411279
158	Historical Landfill Sites Licence Holder: Not Supplied Location: Hudcar Lane, Bury, Greater Manchester Name: Mill Lodges Operator Location: Not Supplied Boundary Accuracy: As Supplied Provider Reference: EAHLD15756 First Input Date: 31st December 1976 Last Input Date: Not Supplied Specified Waste Type: Not Supplied EA Waste Ref: 0 Regis Ref: Not Supplied WRC Ref: Not Supplied BGS Ref: Not Supplied Other Ref: C118	A14NW (E)	537	2	381101 411713
159	Historical Landfill Sites Licence Holder: Not Supplied Location: Woolfold, Bury Name: Land South of Cricket Ground Operator Location: Not Supplied Boundary Accuracy: As Supplied Provider Reference: EAHLD17869 First Input Date: Not Supplied Last Input Date: Not Supplied Specified Waste Type: Not Supplied EA Waste Ref: 0 Regis Ref: Not Supplied WRC Ref: Not Supplied BGS Ref: Not Supplied Other Ref: WML/0451	A12NW (W)	670	2	379779 411742
160	Historical Landfill Sites Licence Holder: Bury Metropolitan Borough Council Location: Woodhill Road, Burrs, Bury Name: Land Off Woodhill Road Operator Location: Not Supplied Boundary Accuracy: As Supplied Provider Reference: EAHLD15732 First Input Date: 31st July 1990 Last Input Date: 31st October 1990 Specified Waste Type: Deposited Waste included Inert Waste EA Waste Ref: 0 Regis Ref: Not Supplied WRC Ref: 4200/9327 BGS Ref: Not Supplied Other Ref: RD/LIC/594/90, C088	A17NE (NW)	845	2	379999 412449

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
161	Historical Landfill Sites Licence Holder: Olives Paper Mill Company Limited Location: Tottington, Bury Name: Woolfold Paper Mills Operator Location: Not Supplied Boundary Accuracy: As Supplied Provider Reference: EAHLD15768 First Input Date: 31st December 1950 Last Input Date: 2nd April 1986 Specified Waste: Deposited Waste included Inert and Industrial Waste, and Liquid Sludge Type: EA Waste Ref: 0 Regis Ref: Not Supplied WRC Ref: 4200/9206 BGS Ref: Not Supplied Other Ref: C005b, RD/LIC/080/77 ,0226	A12SW (W)	936	2	379531 411523
162	Historical Landfill Sites Licence Holder: Olives Paper Mill Company Limited Location: Tottington Road, Bury Name: Woolfold paper Mills Operator Location: Not Supplied Boundary Accuracy: As Supplied Provider Reference: EAHLD15758 First Input Date: 31st December 1950 Last Input Date: 2nd April 1986 Specified Waste: Deposited Waste included Inert and Industrial Waste, and Liquid Sludge Type: EA Waste Ref: 0 Regis Ref: Not Supplied WRC Ref: 4200/9206 BGS Ref: Not Supplied Other Ref: 0226, RD/LIC/080/77	A12SW (W)	957	2	379494 411638
163	Licensed Waste Management Facilities (Locations) Licence Number: 53653 Location: Every Street, Bury, Lancashire, BL9 5BE Operator Name: G M Waste Ltd Operator Location: Po Box 151, Higher Swan Lane, Bolton, Manchester, BL3 3WW Authority: Environment Agency - North West Region, South Area Site Category: Household, Commercial And Industrial Transfer Stations Licence Status: Issued Issued: 1st February 1995 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13NE (E)	62	2	380625 411722
164	Licensed Waste Management Facilities (Locations) Licence Number: 100338 Location: Fernhill H W R C, T L S & Green Waste Processing Facility, Every Street, Fernhill, Bury, Lancashire, BL9 5BE Operator Name: S U E Z Recycling And Recovery U K Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Household, Commercial And Industrial Transfer Stations Licence Status: Transferred Issued: 12th June 2008 Last Modified: 4th September 2012 Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13NW (NW)	79	2	380400 411780

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
164	Licensed Waste Management Facilities (Locations) Licence Number: 50218 Location: Fernhill Depot, Every Street F, Fernhill, Bury, Lancashire, BL9 5BY Operator Name: Viridor Waste (Greater Manchester) Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Special Waste Transfer Stations Licence Status: Revoked Issued: 2nd June 2004 Last Modified: 28th May 2009 Expires: Not Supplied Suspended: Not Supplied Revoked: 7th August 2014 Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13NW (NW)	79	2	380400 411780
164	Licensed Waste Management Facilities (Locations) Licence Number: 53653 Location: Fernhill Depot, Every Street, Fernhill, Bury, Lancashire, BL9 5BJ Operator Name: G M Waste Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Household, Commercial And Industrial Transfer Stations Licence Status: Revoked Issued: 1st February 1995 Last Modified: 1st June 2004 Expires: Not Supplied Suspended: Not Supplied Revoked: 6th August 2014 Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13NW (NW)	79	2	380400 411780
165	Licensed Waste Management Facilities (Locations) Licence Number: 403495 Location: Unit 6, Park Road, Fernhill, Bury, Lancashire, BL9 5BQ Operator Name: Abbey Skip Hire Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: HCl Waste TS + treatment Licence Status: Issued Issued: 30th September 2016 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SW (SW)	121	2	380358 411627
166	Licensed Waste Management Facilities (Locations) Licence Number: 50053 Location: Fernhill Works, Park Road, Bury, Lancashire, BL9 5BQ Operator Name: Davenport Sam Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Household, Commercial And Industrial Transfer Stations Licence Status: Transferred Issued: 28th September 2001 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SW (W)	168	2	380300 411629

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
167	Licensed Waste Management Facilities (Locations) Licence Number: 102616 Location: Auto Spares World, Park Road, Bury, Lancashire, BL9 5BQ Operator Name: Autospares World Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Vehicle depollution facility Licence Status: Revoked Issued: 8th September 2011 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SW (S)	182	2	380473 411489
167	Licensed Waste Management Facilities (Locations) Licence Number: 101913 Location: Gate 2, Tile Street, Bury, Lancashire, BL9 5BR Operator Name: M & A Skip Hire Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: HCl Waste TS + treatment Licence Status: Revoked Issued: 26th January 2011 Last Modified: 11th April 2012 Expires: Not Supplied Suspended: Not Supplied Revoked: 1st June 2015 Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SW (S)	211	2	380468 411461
168	Licensed Waste Management Facilities (Locations) Licence Number: 53713 Location: Peel Mills, Gordon Street, Bury, Lancashire, BL9 0LS Operator Name: Dearden Bernard Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Household, Commercial And Industrial Transfer Stations Licence Status: Issued Issued: 15th September 1994 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SW (SW)	252	2	380320 411490
169	Licensed Waste Management Facilities (Locations) Licence Number: 53469 Location: 2 Tile Street, Bury, Lancashire, BL9 5BR Operator Name: Recycle Motor Spares Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Metal Recycling Sites (Mixed) Licence Status: Transferred Issued: 20th September 1996 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SE (S)	282	2	380573 411384
170	Licensed Waste Management Facilities (Locations) Licence Number: 104296 Location: Gate 2, Tile Street, Bury, Lancashire, BL9 5BR Operator Name: M60 Skip Hire Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: HCl Waste TS + treatment Licence Status: Issued Issued: 15th August 2012 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A8NW (S)	307	2	380502 411357

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
170	Licensed Waste Management Facilities (Locations) Licence Number: 50372 Location: Gate 2, Tile Street, Woodfields, Bury, Lancashire, BL9 5BR Operator Name: Smith Ian Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: End of Life Vehicles Licence Status: Issued Issued: 25th April 2005 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A8NE (S)	317	2	380547 411346
171	Licensed Waste Management Facilities (Locations) Licence Number: 101963 Location: Gate 3, Tile St, Bury, Lancashire, BL9 5BR Operator Name: Laycock Christopher Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Vehicle depollution facility Licence Status: Issued Issued: 28th September 2010 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A8NW (S)	309	2	380465 411360
172	Licensed Waste Management Facilities (Locations) Licence Number: 404508 Location: Birch Street, Bury, Lancashire, BL9 5AL Operator Name: Recycling Lives Limited Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Metal Recycling Sites (Mixed) Licence Status: Issued Issued: 21st May 2018 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A13SE (SE)	361	2	380775 411399
173	Licensed Waste Management Facilities (Locations) Licence Number: 50290 Location: Unit 4, Freetown Business Park, Hudcar Lane, Bury, Lancashire, BL9 6HD Operator Name: North West Transits Limited Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: End of Life Vehicles Licence Status: Revoked Issued: 7th June 2004 Last Modified: Not Supplied Expires: Not Supplied Suspended: Not Supplied Revoked: 22nd September 2015 Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A14NE (E)	635	2	381199 411739
174	Licensed Waste Management Facilities (Locations) Licence Number: 53473 Location: Land/premises At, Bridge Street, Bury, Lancashire, BL9 6HH Operator Name: Sims Group U K Limited Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Metal Recycling Sites (Mixed) Licence Status: Surrendered Issued: 13th November 1998 Last Modified: 1st July 2015 Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: 24th June 2020 IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A14SW (E)	677	2	381179 411448

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
175	Licensed Waste Management Facilities (Locations) Licence Number: 53921 Location: York Street Mill, York Street, Bury, Lancashire, BL9 7AR Operator Name: Swinnerton Bros Ltd Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: Household, Commercial And Industrial Transfer Stations Licence Status: Revoked Issued: 22nd September 1983 Last Modified: 17th May 2002 Expires: Not Supplied Suspended: Not Supplied Revoked: 23rd January 2006 Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A9SW (SE)	938	2	381158 410968
176	Licensed Waste Management Facilities (Locations) Licence Number: 102063 Location: York Street Recycling Centre, York Street, Bury, Lancashire, BL9 7AR Operator Name: Mr Richard Roberts & Mr Ian Marshall Operator Location: Not Supplied Authority: Environment Agency - North West Region, South Area Site Category: HCI Waste TS + treatment Licence Status: Modified Issued: 21st October 2010 Last Modified: 7th March 2011 Expires: Not Supplied Suspended: Not Supplied Revoked: Not Supplied Surrendered: Not Supplied IPPC Reference: Not Supplied Positional Accuracy: Located by supplier to within 10m	A9SW (SE)	998	2	381135 410870
	Local Authority Landfill Coverage Name: Bury Metropolitan Borough Council - Has not been able to supply Landfill data		0	6	380508 411713
177	Potentially Infilled Land (Non-Water) Bearing Ref: W Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A13NW (W)	4	-	380456 411726
178	Potentially Infilled Land (Non-Water) Bearing Ref: S Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A13SE (S)	54	-	380535 411608
179	Potentially Infilled Land (Non-Water) Bearing Ref: W Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A13NW (W)	210	-	380241 411732
180	Potentially Infilled Land (Non-Water) Bearing Ref: NE Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A18SE (NE)	453	-	380777 412131
181	Potentially Infilled Land (Non-Water) Bearing Ref: NW Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A17SE (NW)	596	-	380164 412260
182	Potentially Infilled Land (Non-Water) Bearing Ref: E Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A14SE (E)	889	-	381418 411482
183	Potentially Infilled Land (Non-Water) Bearing Ref: NE Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A19NW (NE)	907	-	381045 412500
184	Potentially Infilled Land (Non-Water) Bearing Ref: SE Use: Unknown Filled Ground (Pit, quarry etc) Date of Mapping: 1984	A9NE (SE)	922	-	381214 411047
185	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A14NW (E)	405	-	380959 411821

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
186	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A12SE (SW)	429	-	380125 411425
187	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A8NE (S)	444	-	380670 411242
188	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A14NW (E)	497	-	381049 411837
189	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A8NW (S)	520	-	380332 411181
190	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A7NE (SW)	529	-	380103 411307
191	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1911	A14SW (E)	533	-	381095 411684
192	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A14NW (E)	548	-	381112 411723
193	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A14SW (SE)	560	-	381043 411438
194	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1931	A14NW (E)	567	-	381131 411734
195	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A14NW (NE)	581	-	381079 412000
196	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A9NW (SE)	600	-	381001 411293
197	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A14NW (E)	604	-	381161 411822
198	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A14SW (E)	611	-	381150 411557
199	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1931	A14NW (E)	615	-	381179 411714
200	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A17SE (NW)	622	-	380027 412180
201	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A14SW (E)	625	-	381172 411584
202	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A12NW (W)	641	-	379815 411799
203	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A14SW (SE)	652	-	381144 411435
204	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A12NE (NW)	660	-	379865 412014
205	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A14SW (SE)	676	-	381166 411424
206	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A12SW (W)	685	-	379816 411444

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
207	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A9NW (SE)	706	-	380945 411093
208	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A17NE (NW)	777	-	380142 412455
209	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A7NE (SW)	792	-	379928 411110
210	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1931	A9NW (SE)	805	-	381062 411060
211	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A9NW (SE)	805	-	381081 411078
212	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A14NE (E)	809	-	381373 411711
213	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A9SW (SE)	811	-	380914 410949
214	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A9SW (SE)	817	-	381034 411021
215	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A9SW (SE)	855	-	381052 410987
216	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A18NW (N)	862	-	380369 412610
217	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1911	A18NW (N)	865	-	380393 412616
218	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A14SE (E)	869	-	381420 411581
219	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A18NE (N)	878	-	380645 412622
220	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A17SW (NW)	887	-	379727 412228
221	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A19NW (NE)	899	-	380956 412541
222	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A7SE (SW)	907	-	379885 410997
223	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A9NE (SE)	929	-	381404 411334
224	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A17SW (NW)	937	-	379744 412336
225	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1851	A9NE (SE)	964	-	381380 411213
226	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1956	A12SW (W)	972	-	379529 411395
227	Potentially Infilled Land (Water) Use: Unknown Filled Ground (Pond, marsh, river, stream, dock etc) Date of Mapping: 1894	A18NW (N)	974	-	380225 412696

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
228	Registered Landfill Sites Licence Holder: Mone Bros (Civil Engineering) Ltd Licence Reference: 00621/90 Site Location: Brandlesholme Road / Woodhill Way, Bury, Lancashire Licence Easting: 379700 Licence Northing: 411730 Operator Location: Albert Road, MORLEY, West Yorkshire, LS27 8RU Authority: Environment Agency - North West Region, South Area Site Category: Landfill - Railway cutting Max Input Rate: Very Large (Equal to or greater than 250,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Status: Licence lapsed/cancelled/defunct/not applicable/surrenderedCancelled Dated: 1st March 1992 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the road within the address or location Boundary Accuracy: Not Applicable Authorised Waste: Gmwd Group 1 - Non/V.Slow Decomp.Wast Prohibited Waste: Asbestos Ash, Clinker Boiler Scale, Slag Concrete Waste Liquid/Sludge Wastes Malodorous Waste Mineral Processing Wastes Pretreated Waste Not Permitted By Lic. Silica, Carbon, Kieselguhr Skip Waste Special Wastes Waste In Drums Waste N.O.S. Weathered Tar/Bitumen	A12NW (W)	749	2	379700 411730
229	Registered Landfill Sites Licence Holder: Bury M.B.C. Licence Reference: 00594/90 Site Location: Woodhill Road, Burrs, Bury, Lancashire Licence Easting: 379980 Licence Northing: 412500 Operator Location: Craig House, BURY, Lancashire, BL9 0DN Authority: Environment Agency - North West Region, South Area Site Category: Landfill Max Input Rate: Very Large (Equal to or greater than 250,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Status: Licence lapsed/cancelled/defunct/not applicable/surrenderedCancelled Dated: 1st July 1990 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the address or location Boundary Accuracy: Not Applicable Authorised Waste: Brick, Concrete, Slate, Ceramic Mat'Ls Max.Waste Permitted By Licence-Stated Similar Non-Leachate Forming Waste Soil, Clay, Sand, Stone Prohibited Waste: Animal Flesh Chemical Waste Of Any Nature Fibreglass Foodstuffs Glass Mat'L Giving Rise To Polluting Leachat Metal Paper/Cardboard Waste Plasterboard Plastics Sawdust Textiles Vegetable Matter Waste From Demolition Work Waste In Liquid Or Sludge Form Waste In Skips Wood	A17NE (NW)	897	2	379980 412500

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
230	Registered Landfill Sites Licence Holder: Olives Paper Mill Co Ltd Licence Reference: 00080 Site Location: Woodfold Paper Mill, Tottington Road, BURY, Lancashire, BL8 1SL Licence Easting: Not Supplied Licence Northing: Not Supplied Operator Location: As Site Address Authority: Environment Agency - North West Region, South Area Site Category: Landfill - with lagoon Max Input Rate: Large (Equal to or greater than 75,000 and less than 250,000 tonnes per year) Waste Source: Waste produced/controlled by licence holder Restrictions: Status: Licence lapsed/cancelled/defunct/not applicable/surrenderedCancelled Dated: 6th November 1979 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Positioned by the supplier Boundary Accuracy: Good Authorised Waste: Construction And Demolition Wastes Incinerator Residues Ind. Non-Haz. Waste Industrial Effluent Treatment Sludge	A12SW (W)	933	2	379524 411582
231	Registered Waste Transfer Sites Licence Holder: Greater Manchester Waste Ltd Licence Reference: 01013 Site Location: Fernhill Transfer & C.A.Site, Every Street, Bury, Lancashire Operator Location: PO Box 151, Higher Swan Lane, BOLTON, Lancashire, BL3 3WW Authority: Environment Agency - North West Region, South Area Site Category: Civic Amenity - with transfer Max Input Rate: Large (Equal to or greater than 75,000 and less than 250,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Operational as far as is knownOperational Dated: 1st February 1995 Preceded By: 01013/93 (R/056/85) Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the address or location Boundary Quality: Not Supplied Authorised Waste: Asbestos Gmwda Group 1 - Non/V.Slow Decomp.Wast Gmwda Group 2 - Slow Decomp./Slight So Gmwda Group 3 - Decomp./Sol.Waste = No Gmwda Group 5 - Chemical/Toxic Waste Max.Waste Permitted By Licence Prohibited Waste: Acid Tars Clinical - Grp A As In Hse '92 Distillation Residues Dyestuffs Waste Foundry Sand Incinerator Residues Industrial Effluent Treatment Sludge Interceptor Pit Wastes Laboratory Chemicals Pharmaceuticals Polymeric Material, Products/Scrap Printing Industry Wastes/Ink Prod'Ts Of Incomplete Polymerisation Sewage Tank Cleaning Sludge Used Filter Mat'Ls/Cake/Screenings	A13NW (NW)	79	2	380400 411780

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
231	Registered Waste Transfer Sites Licence Holder: G.M.W.D.A. Licence Reference: 01013/93 (R/056/85) Site Location: Fernhill Transfer Station, Every Street, Bury, Lancashire Operator Location: Blackfriars House, Parsonage, MANCHESTER, Greater Manchester, M3 2JA Authority: Environment Agency - North West Region, South Area Site Category: Civic Amenity - with transfer Max Input Rate: Large (Equal to or greater than 75,000 and less than 250,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Record supersededSuperseded Dated: 11th April 1985 Preceded By: Not Given Licence: Superseded By: 01013 Licence: Positional Accuracy: Manually positioned to the address or location Boundary Quality: Not Supplied Authorised Waste Carcasses And Flesh Construction And Demolition Wastes Gully Emptyings (R20) House. + Com. Baled Waste House. + Com. Pulverised Waste House. + Com. Untreated Waste Ind. Non-Haz. Inert, Non-Flammable Ind. Non-Haz. Potentially Combustible Medical, Surgical, Veterinary Wastes Sewage	A13NW (NW)	79	2	380400 411780
232	Registered Waste Transfer Sites Licence Holder: M Ford T/A J & M Skip & Plant Hire Licence Reference: Eawm150053 Site Location: Fernhill Works, Park Road, Fernhill, Bury, Lancashire, B19 5bq Operator Location: Gorse Hill Farm, Starling Road, Ainsworth, Bury, Lancashire, B18 2hj Authority: Environment Agency - North West Region, South Area Site Category: Transfer Max Input Rate: Very Small (Less than 10,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Operational as far as is knownOperational Dated: 1st October 2001 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Located by supplier to within 100m Boundary Quality: Not Supplied Authorised Waste Household/Commercial/Industrial Waste (Inferred From Regis Listing) New Licence, Wastes Not To Hand	A13SW (W)	190	2	380280 411620

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
233	Registered Waste Transfer Sites Licence Holder: B Dearden Licence Reference: 00901 Site Location: Peel Mills, Gordon Street, Castlecroft Road, Bury, Lancashire Operator Location: 19 Walnut Avenue, BURY, Lancashire, BL9 7QR Authority: Environment Agency - North West Region, South Area Site Category: Transfer Max Input Rate: Small (Equal to or greater than 10,000 and less than 25,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Operational as far as is knownOperational Dated: 1st September 1994 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Approximate location provided by supplier Boundary Quality: Not Supplied Authorised Waste Elect. Fittings/Fixtures/Appliances Empty Used Containers Glass,Pottery,China,Enamel,Ceram.Mica Gmwda Group 2 - Slow Decomp./Slight So Max.Waste Permitted By Licence Rubble,Harcore,Stone,Brickwvk,Concrete Scrap Mach'Y/Equip. - Ferrous Scrap Mach'Y/Equip. - Non-Ferrous Soil Weathered Tar/Bitumen Aggregate Prohibited Waste Explosive Waste Liquid Wastes Press'D Containers Or Waste Therein Putrescible Waste Sludge Wastes Special Wastes N.O.S. Waste In Drums Waste N.O.S Whether/Not Pack./Pre-Trt Waste Reacting Violently With Water	A13SW (SW)	341	2	380300 411400
234	Registered Waste Transfer Sites Licence Holder: Auto-Col Ltd Licence Reference: 00656/90 Site Location: Badger Street, BURY, Lancashire, BL9 6AD Operator Location: Norfield Works, Richmond Street, ACCRINGTON, Lancashire, BB5 0RH Authority: Environment Agency - North West Region, South Area Site Category: Transfer Max Input Rate: Very Small (Less than 10,000 tonnes per year) Waste Source: Some restriction on source of waste Restrictions: Licence Status: Site exempt from licenceExempt Dated: 1st May 1993 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the road within the address or location Boundary Quality: Not Supplied Authorised Waste Max.Storage In Licence Solvents & Thinners Prohibited Waste Explosive Waste Malodorous Waste Pressurized Contain. Or Waste Therein Violently Reactive Wastes Waste N.O.S.	A9NW (SE)	715	2	381150 411310

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
235	Registered Waste Treatment or Disposal Sites Licence Holder: G.M.W.D.A. Licence Reference: R/008 Site Location: Bury Incinerator, Fernhill Depot, Bury, Lancashire Operator Location: Blackfriars House, Parsonage, MANCHESTER, Greater Manchester, M3 2JA Authority: Environment Agency - North West Region, South Area Site Category: Incineration Max Input Rate: Small (Equal to or greater than 10,000 and less than 25,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Licence lapsed/cancelled/defunct/not applicable/surrenderedCancelled Dated: 22nd June 1979 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the address or location Boundary Quality: Not Supplied Authorised Waste: House, Com + Ind.Waste Household + Commercial Waste Environment Agency Controlled Wastes must give specific authorisation for this waste to be acceptedWaste requires prior approval	A13SW (W)	49	2	380400 411700
236	Registered Waste Treatment or Disposal Sites Licence Holder: R & M Stansfield Enterprises Ltd Licence Reference: 01007/T01 Site Location: The Yard; Tile Street, Woodsfield Street, Fernhill, Bury, Lancashire, BL9 5bu Operator Location: Tile Street, BURY, Lancashire, BL6 5BU Authority: Environment Agency - North West Region, South Area Site Category: Scrapyard Max Input Rate: Very Small (Less than 10,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Operational as far as is knownOperational Dated: 1st September 1996 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the road within the address or location Boundary Quality: Not Supplied Authorised Waste: Associated Non-Scrap Max.Storage Pre-Sorted Scrap Metal Incl. Scrap Vehicles Prohibited Waste: Asbestos (Other Than Integral To Veh.) Bulk Powders Clinical Wastes Explosive Waste Highly Reactive Wastes Pcbs And Analogues Pressurised Wastes Or Cont'Rs Special Wastes N.O.S. Waste Drums (Unless Pre-Cleaned) Waste N.O.S.	A8NE (S)	314	2	380550 411350

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
237	Registered Waste Treatment or Disposal Sites Licence Holder: Brook Street Metal Co Ltd Licence Reference: 00561 Site Location: Bridge Street, BURY, Lancashire, BL9 6HH Operator Location: As Site Address Authority: Environment Agency - North West Region, South Area Site Category: Scrapyard Max Input Rate: Very Small (Less than 10,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Operational as far as is knownOperational Dated: 1st November 1998 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the address or location Boundary Quality: Not Supplied Authorised Waste: Any Non-Haz. Ferrous Metal Scrap Any Non-Haz. Non-Ferrous Metal Scrap Clean Drums Max.Waste Permitted By Licence Scrap Vehicles Prohibited Waste: Pcb's/Pc'ts Spec.Waste (Epa'90:S62/1996 Regs)N.O.S Waste N.O.S.	A14SW (SE)	646	2	381140 411440
238	Registered Waste Treatment or Disposal Sites Licence Holder: Swinnerton Bros Ltd Licence Reference: 00166/M04 Site Location: York Street, BURY, Lancashire, BL9 7AR Operator Location: As Site Address Authority: Environment Agency - North West Region, South Area Site Category: Baling - Compaction Max Input Rate: Very Large (Equal to or greater than 250,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Operational as far as is knownOperational Dated: 22nd September 1983 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the address or location Boundary Quality: Not Supplied Authorised Waste: Construction And Demolition Wastes Empty Used Containers Household + Commercial Waste Ind. Non-Haz. Waste Metal Scrap Polymeric Material, Products/Scrap	A9SW (SE)	938	2	381160 410970
239	Registered Waste Treatment or Disposal Sites Licence Holder: Bury M.B.C. Licence Reference: 00071/CO1 Site Location: Market Hall, Princess, Bury, Lancashire Operator Location: Town Hall, BURY, Lancashire, BL9 0SW Authority: Environment Agency - North West Region, South Area Site Category: Incineration Max Input Rate: Small (Equal to or greater than 10,000 and less than 25,000 tonnes per year) Waste Source: No known restriction on source of waste Restrictions: Licence Status: Licence has completion certificateSurrendered Dated: 13th June 1978 Preceded By: Not Given Licence: Superseded By: Not Given Licence: Positional Accuracy: Manually positioned to the road within the address or location Boundary Quality: Not Supplied Authorised Waste: House. + Com. Untreated Waste Medical, Surgical, Veterinary Wastes	A3NE (S)	977	2	380620 410690

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
240	Control of Major Accident Hazards Sites (COMAH) Name: T W Tyson Location: Calor House, Webb Street, BURY, Lancashire, BL8 1AF Reference: Not Supplied Type: Lower Tier Status: Record Ceased To Be Supplied Under COMAH Regulations Positional Accuracy: Manually positioned to the road within the address or location	A7NW (SW)	880	7	379736 411191
241	Notification of Installations Handling Hazardous Substances (NIHHS) Name: T W Tyson Location: Calor House, Webb Street, BURY, Lancashire, BL8 1AF Status: Not Active Positional Accuracy: Automatically positioned in the proximity of the address	A7NW (SW)	882	7	379736 411187
242	Planning Hazardous Substance Consents Name: T W Tyson Location: Webb Street, BURY, Lancashire, BL8 1AK Authority: Bury Metropolitan Borough Council Application Ref: C/27664/92 Hazardous: Part C, Flammable Substance (Not in Parts A&B), Liquefied petroleum gas Substance: held at >1.4 bar where amount held is greater than or equal to 25 tonnes Maximum Quantity: 25 Application date: Not Supplied Decision: Deemed consent granted between June 1992 and November 1992 Granted Positional Accuracy: Manually positioned to the road within the address or location	A7NW (SW)	877	8	379740 411191

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS 1:625,000 Solid Geology Description: Pennine Lower Coal Measures Formation And South Wales Lower Coal Measures Formation (Undifferentiated)	A13NE (SW)	0	1	380508 411713
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: <15 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A13NE (SW)	0	1	380508 411713
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A13SE (S)	0	1	380512 411689
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A13NW (N)	5	1	380496 411765
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 30 - 45 mg/kg Concentration:	A13SW (W)	103	1	380348 411685
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: <15 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A13NW (W)	187	1	380280 411790
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 30 - 45 mg/kg Concentration:	A13NW (W)	187	1	380275 411776

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A13SE (S)	190	1	380551 411474
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A13NW (W)	198	1	380266 411784
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 90 - 120 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A13NW (W)	215	1	380233 411715
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A13SW (S)	233	1	380428 411453
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A13NW (W)	248	1	380203 411735
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12SE (W)	289	1	380166 411647

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A8NE (S)	303	1	380540 411359
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A12SE (W)	325	1	380126 411665
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: <15 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A14NW (NE)	359	1	380862 411932
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: <15 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A18SE (NE)	359	1	380684 412073
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel: 30 - 45 mg/kg Concentration:	A14NW (E)	436	1	381000 411738
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: <15 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A14NW (E)	436	1	381000 411713

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12NE (W)	449	1	380000 411713
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12SE (W)	449	1	380000 411691
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12NE (W)	453	1	380000 411768
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel 30 - 45 mg/kg Concentration:	A14NW (E)	456	1	381000 411866
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel 30 - 45 mg/kg Concentration:	A14SW (E)	488	1	381000 411513
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 90 - 120 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12SE (SW)	500	1	380042 411417

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel 15 - 30 mg/kg Concentration:	A14NW (NE)	512	1	381000 412000
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12SE (SW)	513	1	380003 411453
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12SE (SW)	514	1	380000 411455
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A18SW (NW)	516	1	380241 412212
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A18SW (NW)	517	1	380236 412211
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel 15 - 30 mg/kg Concentration:	A14NW (NE)	537	1	381000 412045

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel 15 - 30 mg/kg Concentration:	A14SW (SE)	542	1	381000 411396
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12SE (SW)	548	1	380000 411392
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A7NE (SW)	562	1	380061 411301
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A18SW (N)	574	1	380298 412300
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A7NE (SW)	584	1	380006 411326
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 15 - 30 mg/kg Concentration:	A7NE (SW)	584	1	380000 411332

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A17SE (NW)	646	1	380060 412246
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 30 - 45 mg/kg Concentration:	A7NE (SW)	652	1	380000 411234
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A8SE (S)	663	1	380508 411000
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 15 - 30 mg/kg Concentration:	A17SE (NW)	686	1	380000 412245
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12NW (W)	715	1	379735 411752
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A18NW (N)	722	1	380248 412439

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A8SW (S)	722	1	380472 410942
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel: 30 - 45 mg/kg Concentration:	A9NW (SE)	730	1	381037 411140
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A18NE (N)	744	1	380508 412500
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel: 30 - 45 mg/kg Concentration:	A17SE (NW)	751	1	379986 412320
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: <15 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: <100 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A18NE (N)	766	1	380690 412500
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel: 15 - 30 mg/kg Concentration:	A18NW (N)	770	1	380208 412475

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 15 - 30 mg/kg Concentration:	A17NE (NW)	801	1	380000 412397
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 300 - 600 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12SW (W)	949	1	379500 411706
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 300 - 600 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12NW (W)	949	1	379500 411713
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 300 - 600 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12NW (W)	953	1	379500 411798
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 90 - 120 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12SW (W)	955	1	379515 411506
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12SW (W)	955	1	379512 411520

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 200 - 300 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12SW (W)	957	1	379514 411503
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A18NW (N)	959	1	380351 412705
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 300 - 600 mg/kg Nickel 30 - 45 mg/kg Concentration:	A12SW (W)	962	1	379500 411547
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 90 - 120 mg/kg Concentration: Lead Concentration: 300 - 600 mg/kg Nickel 15 - 30 mg/kg Concentration:	A12SW (W)	967	1	379500 411520
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic <15 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 15 - 30 mg/kg Concentration:	A23SW (N)	969	1	380424 412723
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic 15 - 25 mg/kg Concentration: Cadmium <1.8 mg/kg Concentration: Chromium 60 - 90 mg/kg Concentration: Lead Concentration: 100 - 200 mg/kg Nickel 30 - 45 mg/kg Concentration:	A17NE (NW)	987	1	379871 412531

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	BGS Estimated Soil Chemistry Source: British Geological Survey, National Geoscience Information Service Soil Sample Type: Sediment Arsenic: 15 - 25 mg/kg Concentration: Cadmium: <1.8 mg/kg Concentration: Chromium: 60 - 90 mg/kg Concentration: Lead Concentration: 300 - 600 mg/kg Nickel: 30 - 45 mg/kg Concentration:	A11SE (W)	991	1	379458 411708
243	BGS Recorded Mineral Sites Site Name: Fern Mill Location: Fernmill, Bury, Lancashire Source: British Geological Survey, National Geoscience Information Service Reference: 96526 Type: Opencast Status: Ceased Operator: Unknown Operator Operator Location: Not Supplied Periodic Type: Carboniferous Geology: Pennine Lower Coal Measures Formation Commodity: Sandstone Positional Accuracy: Located by supplier to within 10m	A13NW (W)	215	1	380235 411732
244	BGS Recorded Mineral Sites Site Name: Woodlands Quarry Location: Fernmill, Bury, Lancashire Source: British Geological Survey, National Geoscience Information Service Reference: 243052 Type: Opencast Status: Ceased Operator: Unknown Operator Operator Location: Not Supplied Periodic Type: Carboniferous Geology: Old Lawrence Rock Commodity: Sandstone Positional Accuracy: Located by supplier to within 10m	A17SE (NW)	602	1	380156 412262
245	BGS Recorded Mineral Sites Site Name: Lowes Brick Works Location: Little Wood Cross, Bury, Greater Manchester Source: British Geological Survey, National Geoscience Information Service Reference: 106030 Type: Opencast Status: Ceased Operator: Unknown Operator Operator Location: Not Supplied Periodic Type: Quaternary, Devensian Geology: Till, Devensian Commodity: Common Clay and Shale Positional Accuracy: Located by supplier to within 10m	A19NW (NE)	978	1	381096 412552
246	BGS Recorded Mineral Sites Site Name: Lowes Brick Works Location: Little Wood Cross, Bury, Greater Manchester Source: British Geological Survey, National Geoscience Information Service Reference: 106029 Type: Opencast Status: Ceased Operator: Unknown Operator Operator Location: Not Supplied Periodic Type: Quaternary, Devensian Geology: Till, Devensian Commodity: Common Clay and Shale Positional Accuracy: Located by supplier to within 10m	A19NW (NE)	983	1	381163 412511
	BGS Measured Urban Soil Chemistry No data available				
	BGS Urban Soil Chemistry Averages No data available				
	Coal Mining Affected Areas Description: In an area which may be affected by coal mining activity. It is recommended that a coal mining report is obtained from the Coal Authority. Contact details are included in the Useful Contacts section of this report.	A13NE (SW)	0	9	380508 411713
	Mining Instability Mining Evidence: Inconclusive Coal Mining Source: Ove Arup & Partners Boundary Quality: As Supplied	A13NE (SW)	0	-	380508 411713

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Non Coal Mining Areas of Great Britain No Hazard				
	Potential for Collapsible Ground Stability Hazards Hazard Potential: Very Low Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713
	Potential for Collapsible Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	177	1	380284 411776
	Potential for Collapsible Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	239	1	380238 411820
	Potential for Compressible Ground Stability Hazards Hazard Potential: Very Low Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713
	Potential for Compressible Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NE (NE)	15	1	380537 411763
	Potential for Compressible Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13SW (SW)	174	1	380399 411535
	Potential for Compressible Ground Stability Hazards Hazard Potential: Moderate Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	178	1	380282 411769
	Potential for Compressible Ground Stability Hazards Hazard Potential: Moderate Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	239	1	380238 411820
	Potential for Ground Dissolution Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713
	Potential for Landslide Ground Stability Hazards Hazard Potential: Very Low Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713
	Potential for Landslide Ground Stability Hazards Hazard Potential: Low Source: British Geological Survey, National Geoscience Information Service	A13NW (NW)	162	1	380319 411805
	Potential for Landslide Ground Stability Hazards Hazard Potential: Moderate Source: British Geological Survey, National Geoscience Information Service	A13NW (NW)	198	1	380288 411824
	Potential for Running Sand Ground Stability Hazards Hazard Potential: Very Low Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713
	Potential for Running Sand Ground Stability Hazards Hazard Potential: Low Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	178	1	380282 411769
	Potential for Running Sand Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	192	1	380271 411784
	Potential for Running Sand Ground Stability Hazards Hazard Potential: Low Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	239	1	380238 411820
	Potential for Running Sand Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NW (N)	241	1	380436 411992
	Potential for Shrinking or Swelling Clay Ground Stability Hazards Hazard Potential: Very Low Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713
	Potential for Shrinking or Swelling Clay Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13SW (SW)	152	1	380355 411577
	Potential for Shrinking or Swelling Clay Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	193	1	380265 411766

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
	Potential for Shrinking or Swelling Clay Ground Stability Hazards Hazard Potential: No Hazard Source: British Geological Survey, National Geoscience Information Service	A13NW (W)	196	1	380275 411795
	Radon Potential - Radon Affected Areas Affected Area: The property is in a Lower probability radon area (less than 1% of homes are estimated to be at or above the Action Level). Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713
	Radon Potential - Radon Protection Measures Protection Measure: No radon protective measures are necessary in the construction of new dwellings or extensions Source: British Geological Survey, National Geoscience Information Service	A13NE (SW)	0	1	380508 411713

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
247	Contemporary Trade Directory Entries Name: Performance Autopoint Location: Unit 31 Fernhill Mills, Hornby Street, Bury, Lancashire, BL9 5BE Classification: Car Dealers - Used Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A13NE (NE)	0	-	380538 411734
248	Contemporary Trade Directory Entries Name: Johnston Industries Inc Location: Fern Hill Business Centre, Todd Street, Bury, Lancashire, BL9 5BJ Classification: Clothing & Fabrics - Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	46	-	380554 411625
249	Contemporary Trade Directory Entries Name: T & C Transport Ltd Location: Unit A, Fernhill Industrial Estate, Every Street, Bury, Lancashire, BL9 5BE Classification: Road Haulage Services Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (E)	53	-	380596 411679
249	Contemporary Trade Directory Entries Name: Bricktec Location: Fern Hill Business Centre, Todd Street, Bury, Lancashire, BL9 5BJ Classification: Blast Cleaning Equipment Manufacturers Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	81	-	380599 411622
249	Contemporary Trade Directory Entries Name: Barbe Uk Ltd Location: Fern Hill Business Centre, Todd Street, Bury, Lancashire, BL9 5BJ Classification: Chemicals & Allied Products Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	91	-	380618 411639
249	Contemporary Trade Directory Entries Name: Prep-Tec Systems Location: Fern Hill Business Centre, Todd Street, BURY, Lancashire, BL9 5BJ Classification: Sheet Metal Work Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	91	-	380618 411639
249	Contemporary Trade Directory Entries Name: Aggregate Industries Ltd Location: Every St, Bury, Lancashire, BL9 5BE Classification: Concrete Contractors Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (SE)	116	-	380649 411644
250	Contemporary Trade Directory Entries Name: Greater Manchester Waste Ltd Location: Every Street, Bury, Lancashire, BL9 5BE Classification: Recycling Centres Status: Inactive Positional Accuracy: Automatically positioned to the address	A13NE (E)	62	-	380625 411722
250	Contemporary Trade Directory Entries Name: Bettamix Concrete Location: Old Towns Yard, Every Street, Bury, BL9 5BE Classification: Concrete & Mortar Ready Mixed Status: Active Positional Accuracy: Automatically positioned to the address	A13NE (E)	62	-	380625 411722
251	Contemporary Trade Directory Entries Name: Super Poly Ltd Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Classification: Polythene & Plastic Sheetting Supplies Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	80	-	380595 411620
251	Contemporary Trade Directory Entries Name: North West Catering Engineers Location: Suite 1, Fernhill Business Centre, Todd Street, Bury, BL9 5BJ Classification: Catering Equipment - Servicing & Repairs Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	80	-	380595 411620
251	Contemporary Trade Directory Entries Name: Sioen (UK) Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Classification: Waterproof Clothing & Rainwear Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	80	-	380595 411620

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
251	Contemporary Trade Directory Entries Name: Shack Wrap Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Classification: Insulation Materials Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	109	-	380611 411592
251	Contemporary Trade Directory Entries Name: Every Street Garage Location: Every Street, Bury, Lancashire, BL9 5BE Classification: Tyre Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	120	-	380620 411585
251	Contemporary Trade Directory Entries Name: Falcon Asphalt Construction Co Ltd Location: Town Gate, Every Street, Bury, Lancashire, BL9 5BE Classification: Asphalt & Coated Macadam Laying Contractors Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	121	-	380610 411573
251	Contemporary Trade Directory Entries Name: R Platt & Son (Building Contractors) Ltd Location: Town Gate, Every Street, Bury, Lancashire, BL9 5BE Classification: Concrete & Mortar Ready Mixed Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	121	-	380610 411573
251	Contemporary Trade Directory Entries Name: Bettamix Concrete Ltd Location: Town Gate, Every Street, Bury, Lancashire, BL9 5BE Classification: Concrete Products Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	121	-	380610 411573
251	Contemporary Trade Directory Entries Name: Lj Motors Location: Town Gate, Every Street, Bury, Lancashire, BL9 5BE Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the address or location	A13SE (SE)	121	-	380610 411573
251	Contemporary Trade Directory Entries Name: Britmix Ltd Location: Unit 1, Town Gate, Every St, Bury, Lancashire, BL9 5BE Classification: Concrete & Mortar Ready Mixed Status: Inactive Positional Accuracy: Manually positioned to the address or location	A13SE (SE)	122	-	380610 411572
251	Contemporary Trade Directory Entries Name: T'S Autosolutions Location: Town Gate, Every Street, Bury, BL9 5BE Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	122	-	380610 411573
252	Contemporary Trade Directory Entries Name: Whitefield Accident Repair Centre Location: Unit 3, Park Road, Bury, BL9 5BQ Classification: Car Body Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	116	-	380507 411548
252	Contemporary Trade Directory Entries Name: Whitefield Accident Repairs Location: Unit 3, Park Road, Bury, BL9 5BQ Classification: Car Body Repairs Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (S)	116	-	380507 411548
252	Contemporary Trade Directory Entries Name: Rainbow International Location: Unit 6, Park Road, Bury, Lancashire, BL9 5BQ Classification: Carpet, Curtain & Upholstery Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	126	-	380531 411536
252	Contemporary Trade Directory Entries Name: M J Howard Technical Services Ltd Location: Unit 6 Birch Business Park, Todd Street, Bury, Lancashire, BL9 5BQ Classification: Engineers - General Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (S)	127	-	380531 411536

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
252	Contemporary Trade Directory Entries Name: Apex Auto Repairs Location: Unit 5 Park Road, Bury, Lancashire, BL9 5BQ Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A13SE (S)	129	-	380552 411536
252	Contemporary Trade Directory Entries Name: G & M Venditti Compressors Ltd Location: Unit 1, Park Road, Bury, BL9 5BQ Classification: Air Compressors Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	129	-	380552 411536
252	Contemporary Trade Directory Entries Name: Re Build Location: Unit 4, Park Road, Bury, Lancashire, BL9 5BQ Classification: Furniture - Reproduction Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	142	-	380507 411522
253	Contemporary Trade Directory Entries Name: Thomas Hardman & Sons Ltd Location: Fernhill Mill, Hornby St, Bury, Lancashire, BL9 5BD Classification: Textile Manufacturing Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	137	-	380670 411639
253	Contemporary Trade Directory Entries Name: Arville Location: Fernhill Mills, Hornby Street, Bury, Lancashire, BL9 5BL Classification: Textile Manufacturing Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	137	-	380670 411639
253	Contemporary Trade Directory Entries Name: Bury M O T Centre Ltd Location: Bury, BL9 5BL Classification: Mot Testing Centres Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	137	-	380670 411639
253	Contemporary Trade Directory Entries Name: Bury Autobodies Location: Bury, BL9 5BL Classification: Car Body Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	137	-	380670 411639
253	Contemporary Trade Directory Entries Name: Hmr Autos Location: Unit 2-5, Hornby Street, Bury, Lancashire, BL9 5EF Classification: Car Dealers - Used Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	157	-	380670 411596
253	Contemporary Trade Directory Entries Name: Rdx Sports Location: Unit 2-5, Hornby Street, Bury, Lancashire, BL9 5EF Classification: Sports Equipment Manufacturers & Distributors Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	157	-	380670 411596
253	Contemporary Trade Directory Entries Name: Hmr Auto Solutions Location: Unit 2-5, Hornby Street, Bury, Lancashire, BL9 5EF Classification: Car Body Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	157	-	380670 411596
253	Contemporary Trade Directory Entries Name: Northwest Landrovers Location: Unit 8, Hornby St, Bury, Lancashire, BL9 5EF Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A13SE (SE)	157	-	380670 411596
254	Contemporary Trade Directory Entries Name: Bury Van Breakers Location: Unit 13, Hornby St, Bury, Lancashire, BL9 5EF Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A13NE (NE)	143	-	380656 411841

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
255	Contemporary Trade Directory Entries Name: Scrap Your Car Bury Location: 4, Fernhill Street, Bury, BL9 5BG Classification: Car Breakers & Dismantlers Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (S)	171	-	380558 411495
255	Contemporary Trade Directory Entries Name: N W T Service Centre Location: Unit 3 Fernhill Street, Bury, Lancashire, BL9 5BG Classification: Garage Services Status: Active Positional Accuracy: Manually positioned within the geographical locality	A13SE (S)	187	-	380564 411479
255	Contemporary Trade Directory Entries Name: Wilcox Drums Ltd Location: Fernhill Works, Park Road, Bury, Lancashire, BL9 5BQ Classification: Drums, Kegs, Barrels & Casks Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	190	-	380580 411480
255	Contemporary Trade Directory Entries Name: J & M Location: Fernhill Works, Park Road, Bury, Lancashire, BL9 5BQ Classification: Waste Disposal Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	190	-	380580 411480
255	Contemporary Trade Directory Entries Name: J Clemishaw 1870 Ltd Location: 2 Fernhill Street, Bury, Lancashire, BL9 5BG Classification: Tarpaulins Status: Active Positional Accuracy: Manually positioned to the road within the address or location	A13SE (S)	220	-	380597 411454
256	Contemporary Trade Directory Entries Name: Auto Spares World Location: Park Road, Bury, Lancashire, BL9 5BQ Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (S)	179	-	380498 411487
257	Contemporary Trade Directory Entries Name: Cts Location: Unit 6-7, Hornby St, Bury, Lancashire, BL9 5EF Classification: Tyre Disposal Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (SE)	181	-	380695 411592
257	Contemporary Trade Directory Entries Name: Ace High Customs Location: 154, Hornby Street, Bury, Lancashire, BL9 5BB Classification: Motor Cycle Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	215	-	380710 411548
258	Contemporary Trade Directory Entries Name: Isc Seals Location: Unit 31, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Mechanical Engineers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	191	-	380281 411615
258	Contemporary Trade Directory Entries Name: Chipsaway Location: Unit 28, Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Classification: Car Breakdown & Recovery Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	215	-	380286 411567
259	Contemporary Trade Directory Entries Name: Heritage Gates & Railings Location: 14, Regent Street, Bury, Lancashire, BL9 5AT Classification: Wrought Ironwork Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (E)	217	-	380763 411645

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
259	Contemporary Trade Directory Entries Name: Superior Fire Surrounds Location: Unit 1 Excel Works, Regent St, Bury, Lancashire, BL9 5AT Classification: Fireplaces & Mantelpieces Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (E)	253	-	380798 411636
260	Contemporary Trade Directory Entries Name: Decor8 Location: Unit 36-37, Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Classification: Painting & Decorating Supplies Status: Active Positional Accuracy: Automatically positioned to the address	A13SW (W)	223	-	380227 411687
261	Contemporary Trade Directory Entries Name: Deeply Vale Brewery Ltd Location: Unit 25, Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Classification: Brewers Status: Active Positional Accuracy: Automatically positioned to the address	A13SW (SW)	231	-	380309 411524
261	Contemporary Trade Directory Entries Name: G & M Venditti Compressors Ltd Location: Unit 24, Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Classification: Air Compressors Status: Active Positional Accuracy: Automatically positioned to the address	A13SW (SW)	235	-	380312 411515
261	Contemporary Trade Directory Entries Name: Andrew'S Courier Services Ltd Location: Unit 23, Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Classification: Freight Forwarders Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	237	-	380315 411511
261	Contemporary Trade Directory Entries Name: S P Air Ltd Location: Unit 21, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Pneumatic Systems & Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	239	-	380323 411504
261	Contemporary Trade Directory Entries Name: Insulslab Location: Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Classification: Insulation Materials Status: Active Positional Accuracy: Automatically positioned to the address	A13SW (SW)	257	-	380304 411495
261	Contemporary Trade Directory Entries Name: Mayplas Location: Bury, BL9 0LU Classification: Insulation Materials Status: Active Positional Accuracy: Automatically positioned to the address	A13SW (SW)	257	-	380304 411495
262	Contemporary Trade Directory Entries Name: Mr Clean Location: 5, Porter Street, Bury, Lancashire, BL9 5DZ Classification: Dry Cleaners Status: Active Positional Accuracy: Automatically positioned to the address	A13NE (NE)	232	-	380745 411876
263	Contemporary Trade Directory Entries Name: A1 4x4 Breakers Location: Tile St, Bury, Lancashire, BL9 5BR Classification: Commercial Vehicle Servicing, Repairs, Parts & Accessories Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A13SE (S)	250	-	380575 411417
263	Contemporary Trade Directory Entries Name: Ian Smith A 1 Vans Location: Woodfield Mill, 2, Tile Street, Bury, BL9 5BR Classification: Salvage Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (S)	250	-	380574 411417

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
263	Contemporary Trade Directory Entries Name: Peel Garage Location: Woodfield Mill, 2, Tile Street, Bury, Lancashire, BL9 5BR Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the address or location	A13SE (S)	250	-	380575 411417
263	Contemporary Trade Directory Entries Name: Origin Printing Ltd Location: 6, Fernhill Street, Bury, Lancashire, BL9 5BG Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	250	-	380575 411417
263	Contemporary Trade Directory Entries Name: A1 British 4x4 Specialists Location: Unit 4 Fernhill Street, Bury, Lancashire, BL9 5BG Classification: Garage Services Status: Active Positional Accuracy: Manually positioned within the geographical locality	A13SE (S)	250	-	380575 411417
263	Contemporary Trade Directory Entries Name: A1 Landrover Breakers Location: Tile St, Bury, Lancashire, BL9 5BR Classification: Scrap Yards Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A13SE (S)	250	-	380575 411417
263	Contemporary Trade Directory Entries Name: Recycle Motor Spares Ltd Location: Unit 2, Tile Street, Bury, BL9 5BR Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	258	-	380567 411407
263	Contemporary Trade Directory Entries Name: Recycled Motor Salvage Ltd Location: Tile Street, Bury, Lancashire, BL9 5BR Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	272	-	380564 411393
263	Contemporary Trade Directory Entries Name: Autospare Location: Tile St, Bury, Lancashire, BL9 5BR Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (S)	272	-	380607 411402
263	Contemporary Trade Directory Entries Name: Agfachrome Processing Location: Tile St, Bury, Lancashire, BL9 5BR Classification: Photographic Processors Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (S)	274	-	380606 411400
263	Contemporary Trade Directory Entries Name: Autospare Location: Woodfield Mill, 2, Tile Street, Bury, Lancashire, BL9 5BR Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A13SE (S)	276	-	380593 411395
263	Contemporary Trade Directory Entries Name: A1 4x4 Breakers Location: Yard 3, Tile St, Bury, Lancashire, BL9 5BR Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (S)	281	-	380597 411390
263	Contemporary Trade Directory Entries Name: A1 Van Breakers Location: Tile Street, Bury, Lancashire, BL9 5BR Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	286	-	380594 411384
263	Contemporary Trade Directory Entries Name: Autospare Location: Tile Street, Bury, Lancashire, BL9 5BR Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (S)	287	-	380594 411384

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
264	Contemporary Trade Directory Entries Name: D B Cellular Products Ltd Location: Unit 18, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Distribution Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	255	-	380353 411468
264	Contemporary Trade Directory Entries Name: Rainbow International Location: Unit 18, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Carpet, Curtain & Upholstery Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	255	-	380353 411468
264	Contemporary Trade Directory Entries Name: H Y Ram Engineering Ltd Location: Unit 18, Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Classification: Engineers - General Status: Active Positional Accuracy: Automatically positioned to the address	A13SW (SW)	260	-	380348 411466
264	Contemporary Trade Directory Entries Name: Fairway Products Location: Unit 17, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Sports Equipment Manufacturers & Distributors Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	263	-	380358 411457
264	Contemporary Trade Directory Entries Name: Callaghan'S Classics Location: Unit 17, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Classic Car Specialists Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	263	-	380358 411457
264	Contemporary Trade Directory Entries Name: Edma Location: Unit 16, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Builders' Tools & Equipment Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (SW)	296	-	380344 411427
265	Contemporary Trade Directory Entries Name: Mayfield Garage Location: Eldon Street, Bury, Lancashire, BL9 5AZ Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A13NE (E)	270	-	380834 411730
266	Contemporary Trade Directory Entries Name: Punctureseal Manchester Location: 15, Argyle Street, BURY, Lancashire, BL9 5DX Classification: Tyre Repairs & Retreading Status: Active Positional Accuracy: Automatically positioned to the address	A13NE (NE)	284	-	380696 411983
267	Contemporary Trade Directory Entries Name: T S H Garden Machinery Location: 104, Hornby Street, Bury, BL9 5BB Classification: Lawnmowers & Garden Machinery - Sales & Service Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	311	-	380716 411415
267	Contemporary Trade Directory Entries Name: Re-Trac Services Location: 40, Birch Street, Bury, Lancashire, BL9 5AL Classification: Waste Disposal Services Status: Inactive Positional Accuracy: Manually positioned to the address or location	A13SE (SE)	333	-	380752 411416
267	Contemporary Trade Directory Entries Name: Qualisure Location: Birch St, Bury, Lancashire, BL9 5AL Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (SE)	357	-	380774 411404

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
268	Contemporary Trade Directory Entries Name: Reaction Design Location: Unit 10, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Tile Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (S)	315	-	380378 411385
268	Contemporary Trade Directory Entries Name: Jg Fabrications Location: Unit 10, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Wrought Ironwork Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SW (S)	315	-	380378 411385
268	Contemporary Trade Directory Entries Name: Chips Away Location: Unit 8, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Car Body Repairs Status: Active Positional Accuracy: Automatically positioned to the address	A8NW (S)	338	-	380379 411359
269	Contemporary Trade Directory Entries Name: Scrap Cars Vans Caravans Buyer Location: Imperial House, 79-81, Hornby Street, Bury, Lancashire, BL9 5BN Classification: Car Breakers & Dismantlers Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	317	-	380657 411373
269	Contemporary Trade Directory Entries Name: Simarco International Location: 79-81, Hornby Street, Bury, BL9 5BN Classification: Freight Forwarders Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	317	-	380657 411373
269	Contemporary Trade Directory Entries Name: Kodak Location: Tile Street, Bury, Lancashire, BL9 5BR Classification: Photographic Processors Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	317	-	380657 411373
269	Contemporary Trade Directory Entries Name: D M C Media Solutions Location: Charles Taylor General Adjusting Services Ltd, Imperial House, 79-81, Hornby Street, Bury, BL9 5BN Classification: Office Equipment Servicing & Maintenance Status: Active Positional Accuracy: Automatically positioned to the address	A13SE (SE)	325	-	380675 411373
269	Contemporary Trade Directory Entries Name: Meggitt Electronics Location: Barcroft St, Bury, Lancashire, BL9 5BT Classification: Electronic Equipment - Manufacturers & Assemblers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A8NE (SE)	349	-	380670 411344
269	Contemporary Trade Directory Entries Name: Kast Installations Location: Barcroft St, Bury, Lancashire, BL9 5BT Classification: Telecommunications Equipment & Systems Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A8NE (SE)	351	-	380676 411344
270	Contemporary Trade Directory Entries Name: Carpet Cleaning Bury Location: 12, Vernon Street, Bury, Lancashire, BL9 5AR Classification: Carpet, Curtain & Upholstery Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (SE)	344	-	380849 411536
271	Contemporary Trade Directory Entries Name: Axel Christiernsson Location: Walmersley Rd, Bury, Lancashire, BL9 5JH Classification: Lubricant Manufacturers & Distributors Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14SW (E)	345	-	380903 411667

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
272	Contemporary Trade Directory Entries Name: Advanced Building & Damp Solutions Location: 84, The Drive, Bury, Lancashire, BL9 5DP Classification: Damp & Dry Rot Control Status: Inactive Positional Accuracy: Automatically positioned to the address	A18SE (N)	348	-	380579 412096
273	Contemporary Trade Directory Entries Name: Robs Autos Location: Hornby Street, Bury, Lancashire, BL9 5AB Classification: Garage Services Status: Active Positional Accuracy: Manually positioned within the geographical locality	A8NE (SE)	357	-	380722 411363
273	Contemporary Trade Directory Entries Name: Washington Garage Location: Hornby Street, Bury, BL9 5AB Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A8NE (SE)	357	-	380722 411363
274	Contemporary Trade Directory Entries Name: Bury Optical Services Ltd Location: Unit 4, Peel Ind Est, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Optical Goods - Manufacturers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8NW (S)	360	-	380381 411334
274	Contemporary Trade Directory Entries Name: Highgrove Contract Furniture Location: Unit 3, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Seating Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (S)	393	-	380384 411298
274	Contemporary Trade Directory Entries Name: Bainbridge G R P Location: Unit 3, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Glass Fibre Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (S)	393	-	380384 411298
274	Contemporary Trade Directory Entries Name: Excel Trade Frames Ltd Location: Unit 3, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Window Frame Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (S)	393	-	380384 411298
274	Contemporary Trade Directory Entries Name: P M Hardware Ltd Location: Unit 2, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Builders' Merchants Status: Active Positional Accuracy: Automatically positioned to the address	A8NW (S)	396	-	380376 411297
274	Contemporary Trade Directory Entries Name: Alfred W Perry (Printers) Ltd Location: Unit 1, Peel Industrial Estate, Chamberhall Street, Bury, Lancashire, BL9 0LU Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (S)	397	-	380369 411299
275	Contemporary Trade Directory Entries Name: United Global Services Ltd Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Freight Forwarders Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	362	-	380616 411311
275	Contemporary Trade Directory Entries Name: The Moseley Rubber Co Ltd Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Rubber & Plastic Products - Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	362	-	380616 411311
275	Contemporary Trade Directory Entries Name: Global Telecom & Technology Ltd Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Telecommunications Equipment & Systems Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	362	-	380616 411311

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
275	Contemporary Trade Directory Entries Name: Wells Water Treatment Services Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Hygiene & Cleansing Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	362	-	380616 411311
275	Contemporary Trade Directory Entries Name: Easy Care Ltd Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Cleaning Services - Domestic Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8NE (S)	362	-	380616 411311
275	Contemporary Trade Directory Entries Name: Haywood Materials Handling Ltd Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Plastics - Machinery & Equipment Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	362	-	380616 411311
275	Contemporary Trade Directory Entries Name: Dealerprint Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	362	-	380616 411311
275	Contemporary Trade Directory Entries Name: D2d Xpress Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Freight Forwarders Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8NE (S)	363	-	380616 411311
275	Contemporary Trade Directory Entries Name: John Caunt Scientific Ltd Location: Europa House, 79-81, Barcroft Street, Bury, BL9 5BT Classification: Scientific Apparatus & Instruments - Manufacturers Status: Active Positional Accuracy: Automatically positioned to the address	A8NE (S)	363	-	380616 411311
275	Contemporary Trade Directory Entries Name: Brand Idol Location: Europa House, 79-81, Barcroft Street, Bury, BL9 5BT Classification: Printers Status: Active Positional Accuracy: Automatically positioned to the address	A8NE (S)	363	-	380616 411311
275	Contemporary Trade Directory Entries Name: American & Efird (Gb) Ltd Location: Suite 34, Europa House, 79-81, Barcroft Street, Bury, BL9 5BT Classification: Sewing Thread Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	363	-	380616 411311
275	Contemporary Trade Directory Entries Name: Spectrum Automation Ltd Location: Europa House, Barcroft Street, Bury, Lancashire, BL9 5BT Classification: Automation Systems & Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	363	-	380616 411311
276	Contemporary Trade Directory Entries Name: L Mortimer (Bury) Ltd Location: Birch Street, Bury, BL9 5AL Classification: Crane Hire, Sales & Service Status: Inactive Positional Accuracy: Automatically positioned to the address	A13SE (SE)	372	-	380788 411396
276	Contemporary Trade Directory Entries Name: Recycling Lives Location: Birch Street, Bury, Lancashire, BL9 5AL Classification: Recycling Services Status: Active Positional Accuracy: Manually positioned to the address or location	A13SE (SE)	378	-	380793 411392
276	Contemporary Trade Directory Entries Name: D W Fabrications Ltd Location: Charles Street, Bury, Lancashire, BL9 5AJ Classification: Sheet Metal Work Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (SE)	400	-	380777 411349

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
276	Contemporary Trade Directory Entries Name: Advanced Automotive Location: Charles Street, Bury, Lancashire, BL9 5AJ Classification: Commercial Vehicle Servicing, Repairs, Parts & Accessories Status: Active Positional Accuracy: Manually positioned within the geographical locality	A8NE (SE)	401	-	380777 411349
276	Contemporary Trade Directory Entries Name: L Mortimer (Bury) Ltd Location: Birch St, Bury, Lancs, BL9 5AL Classification: Crane Hire, Sales & Service Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8NE (SE)	401	-	380776 411348
277	Contemporary Trade Directory Entries Name: L & D Mortimer Location: Birch St, Bury, Lancashire, BL9 5AL Classification: Scrap Metal Merchants Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A13SE (SE)	375	-	380802 411406
278	Contemporary Trade Directory Entries Name: Donisthorpe & Co Ltd Location: Peel Mills, Gordon Street, Bury, Lancashire, BL9 0LS Classification: Sewing Thread Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (SW)	393	-	380299 411340
278	Contemporary Trade Directory Entries Name: Astro Ltd Location: Peel Mills, Gordon Street, Bury, Lancashire, BL9 0LS Classification: Electronic Engineers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (SW)	393	-	380299 411340
278	Contemporary Trade Directory Entries Name: Astro Medical Systems Ltd Location: Peel Mills, Gordon Street, Bury, Lancashire, BL9 0LS Classification: X-Ray Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (SW)	393	-	380299 411340
278	Contemporary Trade Directory Entries Name: Mayplas Ltd Location: Peel Mills, Gordon Street, Bury, Lancashire, BL9 0LS Classification: Insulation Materials Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NW (SW)	393	-	380299 411340
279	Contemporary Trade Directory Entries Name: Tesco Garage Location: Woodfields Retail Park, Peel Way, Bury, Lancashire, BL9 5BY Classification: Petrol Filling Stations - 24 Hour Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	409	-	380570 411256
280	Contemporary Trade Directory Entries Name: Kih Design Location: Flat 9, Ferndale Mews, 1, Marsden Street, Bury, Lancashire, BL9 5BX Classification: Greeting Card Publishers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (SE)	420	-	380714 411286
280	Contemporary Trade Directory Entries Name: Wickes Location: Moor Street, Bury, Lancashire, BL9 5AQ Classification: Builders' Merchants Status: Active Positional Accuracy: Automatically positioned to the address	A8NE (SE)	424	-	380740 411295
281	Contemporary Trade Directory Entries Name: Burgaflex Location: Block C Chamberhall Business Park, Harvard Road, Bury, Lancashire, BL9 0FU Classification: Air Conditioning Equipment & Systems Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SE (SW)	439	-	380132 411403

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
282	Contemporary Trade Directory Entries Name: Lancashire P V C Location: Lancashire House, Woodhill Road, Bury, Lancashire, BL8 1BD Classification: PVC-U Products - Manufacturers & Suppliers Status: Active Positional Accuracy: Automatically positioned to the address	A12NE (W)	462	-	379992 411773
283	Contemporary Trade Directory Entries Name: Heselwood Garage Location: Buckley St, Bury, Lancashire, BL9 5BZ Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A8NE (SE)	463	-	380832 411314
284	Contemporary Trade Directory Entries Name: Walmersley Trade Centre Location: Buckley Street, Bury, BL9 5AF Classification: Car Dealers - Used Status: Active Positional Accuracy: Automatically positioned to the address	A9NW (SE)	469	-	380869 411340
284	Contemporary Trade Directory Entries Name: Rs Commercial Location: Washington Street, Bury, Lancashire, BL9 5BZ Classification: Commercial Vehicle Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	487	-	380890 411338
284	Contemporary Trade Directory Entries Name: Charisma Shades Location: 55-57, Walmersley Road, Bury, Lancashire, BL9 5AE Classification: Blinds, Awnings & Canopies Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	494	-	380903 411341
284	Contemporary Trade Directory Entries Name: Geldard'S Location: 60, Walmersley Road, Bury, Lancashire, BL9 6DP Classification: Dry Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	520	-	380937 411343
284	Contemporary Trade Directory Entries Name: Geldard'S Location: 60, Walmersley Road, Bury, Lancashire, BL9 6DP Classification: Dry Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	520	-	380937 411343
284	Contemporary Trade Directory Entries Name: Belec Location: 39, Walmersley Road, Bury, Lancashire, BL9 5AE Classification: Domestic Appliances - Servicing, Repairs & Parts Status: Active Positional Accuracy: Automatically positioned to the address	A9NW (SE)	529	-	380908 411294
285	Contemporary Trade Directory Entries Name: Currys Location: Woodfields Retail Park, Peel Way, BURY, Lancashire, BL9 5BY Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	480	-	380545 411183
286	Contemporary Trade Directory Entries Name: Currys Pc World Location: Unit 5, Woodfields Retail Park, Peel Way, BURY, Lancashire, BL9 5BY Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Active Positional Accuracy: Manually positioned to the address or location	A8NW (S)	498	-	380438 411173
287	Contemporary Trade Directory Entries Name: Hi Tech Diesel Location: Unit 29a Chesham Road, Bury, Lancashire, BL9 6LY Classification: Diesel Fuel Injection Services Status: Active Positional Accuracy: Automatically positioned to the address	A14NW (E)	512	-	381064 411840
287	Contemporary Trade Directory Entries Name: Bubbles Launderette Location: 32, Chesham Road, BURY, Lancashire, BL9 6LY Classification: Dry Cleaners Status: Active Positional Accuracy: Automatically positioned to the address	A14NW (E)	531	-	381087 411819

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
288	Contemporary Trade Directory Entries Name: Truslit (Bury) Ltd Location: Canon Street, Bury, Lancashire, BL9 6ED Classification: Packaging & Wrapping Equipment & Supplies Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	515	-	381070 411632
289	Contemporary Trade Directory Entries Name: Kadant Uk Ltd Location: Woodhill Road, Bury, Lancashire, BL8 1BD Classification: Engineers - General Status: Active Positional Accuracy: Automatically positioned to the address	A12SE (W)	521	-	379929 411678
290	Contemporary Trade Directory Entries Name: Cleansafe Location: Remar House, Geoffrey Street, Bury, Lancashire, BL9 6FT Classification: Cleaning Materials & Equipment Status: Active Positional Accuracy: Automatically positioned to the address	A14SW (E)	524	-	381039 411511
290	Contemporary Trade Directory Entries Name: Gourmet Food Co Ltd Location: Taylor Street, Bury, Lancashire, BL9 6DW Classification: Food Products - Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (SE)	538	-	381045 411491
290	Contemporary Trade Directory Entries Name: Arla Foods Location: Taylor Street, Bury, Lancashire, BL9 6DT Classification: Dairies Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (SE)	538	-	381045 411491
290	Contemporary Trade Directory Entries Name: Hi Way Motors Location: Taylor Street, Bury, BL9 6DT Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A14SW (SE)	572	-	381062 411449
291	Contemporary Trade Directory Entries Name: Sparkling Bee Cleaning Ltd Location: 26, Orwell Close, Bury, Lancashire, BL8 1UU Classification: Cleaning Services - Domestic Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SE (W)	529	-	379953 411523
292	Contemporary Trade Directory Entries Name: Spur Petroleum Ltd Location: Walmersley Road, BURY, Lancashire, BL9 5JH Classification: Oil Fuel Distributors Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A18SE (NE)	530	-	380759 412227
293	Contemporary Trade Directory Entries Name: Northwest Clutch Location: Unit 6, Freetown Business Park, Hudcar Lane, Bury, Lancashire, BL9 6HD Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	545	-	381107 411692
293	Contemporary Trade Directory Entries Name: Seedfield Autos Location: Unit 5, Freetown Business Park, Hudcar Lane, Bury, Lancashire, BL9 6HD Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	556	-	381118 411677
293	Contemporary Trade Directory Entries Name: D & E Motors Location: Unit 7/A, Freetown Business Park, Hudcar Lane, Bury, Lancashire, BL9 6HD Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A14SW (E)	556	-	381118 411677
293	Contemporary Trade Directory Entries Name: Seedfield Autos Location: Unit 5, Freetown Business Park, Hudcar Lane, Bury, Lancashire, BL9 6HD Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the address or location	A14SW (E)	556	-	381118 411677

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
293	Contemporary Trade Directory Entries Name: Auto Direct (Uk) Ltd Location: Gail House, Hudcar Lane, Bury, Lancashire, BL9 6EX Classification: Car Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	556	-	381118 411677
293	Contemporary Trade Directory Entries Name: Seedfield Autos Location: Unit 5, Freetown Business Park, Hudcar Lane, Bury, Lancashire, BL9 6HD Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	556	-	381118 411677
293	Contemporary Trade Directory Entries Name: Dust Fairy Location: 37, Clarence Close, Bury, Lancashire, BL9 6HE Classification: Commercial Cleaning Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (E)	556	-	381120 411724
294	Contemporary Trade Directory Entries Name: Tim Howarth Commercials Ltd Location: Richard Burch St, Bury, Lancashire, BL9 6DU Classification: Commercial Vehicle Dealers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14SW (SE)	545	-	381014 411416
295	Contemporary Trade Directory Entries Name: Coloured Glass Location: Unit 2 Remar Industrial Estate, Geoffrey Street, Bury, Lancashire, BL9 6FT Classification: Spraying - Paint & Coatings Status: Active Positional Accuracy: Manually positioned to the address or location	A14SW (E)	551	-	381077 411531
296	Contemporary Trade Directory Entries Name: Century Sill Windows Location: 2, Canon Street, Bury, Lancashire, BL9 6ED Classification: Window Frame Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	556	-	381101 411585
296	Contemporary Trade Directory Entries Name: Rain Seal Trade Windows Location: 2, Canon Street, Bury, Lancashire, BL9 6ED Classification: Window Frame Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	556	-	381101 411585
297	Contemporary Trade Directory Entries Name: W Rowlands Location: 29, Oakham Close, Bury, Lancashire, BL8 1XJ Classification: Mechanical Engineers Status: Inactive Positional Accuracy: Automatically positioned to the address	A17SE (NW)	584	-	380038 412137
298	Contemporary Trade Directory Entries Name: Brook Street Motors Location: Taylor Street, Bury, Lancashire, BL9 6DT Classification: Garage Services Status: Active Positional Accuracy: Manually positioned within the geographical locality	A14SW (SE)	586	-	381048 411392
298	Contemporary Trade Directory Entries Name: Wyko Industrial Services Location: 1-7, Taylor Street, Bury, Lancashire, BL9 6DT Classification: Power Transmission Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	620	-	381069 411359
298	Contemporary Trade Directory Entries Name: Pest-Man.Com Location: Alexandra House, Suite 2, 1-7 Taylor St, Bury, Lancashire, BL9 6DT Classification: Pest & Vermin Control Status: Inactive Positional Accuracy: Manually positioned to the address or location	A9NW (SE)	627	-	381075 411357
299	Contemporary Trade Directory Entries Name: Norwest Environmental Ltd Location: Peter Street, Bury, Lancashire, BL9 6AB Classification: Air Conditioning & Refrigeration Contractors Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	591	-	380968 411268

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
299	Contemporary Trade Directory Entries Name: Craffity Location: 5-7 Peter Street, Bury, Lancashire, BL9 6AB Classification: Ceramic Manufacturers, Supplies & Services Status: Active Positional Accuracy: Manually positioned within the geographical locality	A9NW (SE)	618	-	381009 411274
300	Contemporary Trade Directory Entries Name: J S T Fabrication Location: Unit 3 Kenyon Street, Bury, Lancashire, BL9 6DQ Classification: Sheet Metal Work Status: Active Positional Accuracy: Manually positioned to the road within the address or location	A14SW (SE)	593	-	381082 411442
301	Contemporary Trade Directory Entries Name: Tesco Petrol Station Location: Petrol Station, Woodfields Retail Park, Peel Way, Bury, BL9 5BY Classification: Petrol Filling Stations Status: Active Positional Accuracy: Automatically positioned to the address	A8NE (S)	595	-	380526 411068
302	Contemporary Trade Directory Entries Name: W H Tracey Location: Paradise Mill, John Street, Bury, Lancashire, BL9 0NH Classification: Recycling Centres Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (SE)	596	-	380804 411134
303	Contemporary Trade Directory Entries Name: Webuyscrapcars Location: Unit 9, Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Classification: Car Breakdown & Recovery Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (E)	598	-	381162 411753
304	Contemporary Trade Directory Entries Name: Ats Euromaster Ltd Location: John Street, Bury, BL9 0NH Classification: Tyre Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A8NE (S)	599	-	380728 411098
304	Contemporary Trade Directory Entries Name: Ats Euromaster Ltd Location: John Street, Bury, Lancashire, BL9 0NH Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	599	-	380728 411098
304	Contemporary Trade Directory Entries Name: Ats Euromaster Ltd Location: John Street, Bury, Lancashire, BL9 0NH Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	599	-	380728 411098
304	Contemporary Trade Directory Entries Name: Kwik Fit Location: John Street, Bury, BL9 0NH Classification: Tyre Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A8NE (S)	617	-	380739 411083
304	Contemporary Trade Directory Entries Name: Kwik-Fit Location: John Street, Bury, Lancashire, BL9 0NH Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	617	-	380739 411083
304	Contemporary Trade Directory Entries Name: Kwik-Fit Location: John Street, Bury, Lancashire, BL9 0NH Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8NE (S)	617	-	380739 411083
305	Contemporary Trade Directory Entries Name: R E Performance Centre Location: Power House, Bridge Street, Bury, Lancashire, BL9 6HH Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A14SW (E)	603	-	381136 411539

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
305	Contemporary Trade Directory Entries Name: R.E Performance Centre Location: Power House, Bridge Street, Bury, Lancashire, BL9 6HH Classification: Car Engine Tuning & Diagnostic Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SW (E)	603	-	381136 411539
306	Contemporary Trade Directory Entries Name: Regency Gates & Railings Location: Badger St, Bury, Lancashire, BL9 6AD Classification: Gate Manufacturers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9NW (SE)	606	-	381018 411306
307	Contemporary Trade Directory Entries Name: Jewson Location: Higher Mills, Bridge Street, Bury, BL9 6HH Classification: Builders' Merchants Status: Active Positional Accuracy: Automatically positioned to the address	A14SW (E)	621	-	381126 411467
308	Contemporary Trade Directory Entries Name: The Garden Gate Co Location: 7, Riverbank Drive, Bury, Lancashire, BL8 1UR Classification: Gate Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SE (W)	625	-	379856 411507
308	Contemporary Trade Directory Entries Name: The Garden Gate Co Location: 7, Riverbank Drive, Bury, Lancashire, BL8 1UR Classification: Gate Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SE (W)	625	-	379856 411507
309	Contemporary Trade Directory Entries Name: Dumbor Packaging Ltd Location: Unit 1-2, Freetown Business Park, Hudcar Lane, Bury, Lancashire, BL9 6HD Classification: Packaging Materials Manufacturers & Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	627	-	381191 411724
309	Contemporary Trade Directory Entries Name: Rayner Foods Location: Unit 5-6, Portland Industrial Estate, Portland Street, Bury, BL9 6EY Classification: Meat Product Manufacturers & Wholesalers Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	655	-	381219 411708
309	Contemporary Trade Directory Entries Name: J B M Location: Unit 1, Portland Street, Bury, BL9 6EY Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	657	-	381221 411736
309	Contemporary Trade Directory Entries Name: C S Broaching Services Location: Unit 7, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Engineering Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	661	-	381225 411707
309	Contemporary Trade Directory Entries Name: Sudal Location: Unit 8/9, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Precision Engineers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	684	-	381248 411712
310	Contemporary Trade Directory Entries Name: Trident Fluid Technology International Location: Trident House, Greenbrook Street, Bury, Lancashire, BL9 6LZ Classification: Lubricant Manufacturers & Distributors Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (E)	632	-	381180 411874

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
310	Contemporary Trade Directory Entries Name: Phoenix Fans Location: Greenbrook Mill, Greenbrook Street, Bury, Lancashire, BL9 6LZ Classification: Ventilators & Ventilation Systems Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (E)	632	-	381180 411874
310	Contemporary Trade Directory Entries Name: Squirrel Manufacturing Ltd Location: Greenbrook Mill, Greenbrook Street, Bury, Lancashire, BL9 6LZ Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (E)	632	-	381180 411874
310	Contemporary Trade Directory Entries Name: Portwood Colour Location: Greenbrook Mill, Greenbrook Street, Bury, Lancashire, BL9 6LZ Classification: Colour Manufacturers & Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NW (E)	632	-	381180 411874
311	Contemporary Trade Directory Entries Name: Kinsey Jones Ltd Location: 181-183, The Rock, Bury, Lancashire, BL9 0NE Classification: Car Dealers Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A8NE (SE)	651	-	380805 411074
312	Contemporary Trade Directory Entries Name: S B T Gears Location: Barnbrook Gear Works, Bury, Lancashire, BL9 6AF Classification: Electronic Component Manufacturers & Distributors Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	658	-	381049 411262
312	Contemporary Trade Directory Entries Name: D G Steel & Son Ltd Location: Barnbrook Boiler Works, Brook Street, Bury, Lancashire, BL9 6AF Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	658	-	381059 411275
312	Contemporary Trade Directory Entries Name: J & J Industrial Location: Barnbrook Boiler Works, Brook Street, Bury, Lancashire, BL9 6AF Classification: Gearboxes Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	658	-	381059 411275
313	Contemporary Trade Directory Entries Name: Rushton & Sons Ltd Location: Unit 2, Portland Industrial Estate, Portland Street, Bury, BL9 6EY Classification: Engineers - General Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	662	-	381226 411736
313	Contemporary Trade Directory Entries Name: J D Finance Location: 1-3, Haslam Street, Bury, Lancashire, BL9 6EQ Classification: Car Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	666	-	381224 411819
313	Contemporary Trade Directory Entries Name: Hartford Commercial Windows Location: Unit 3, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Horse Boxes & Transporting Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	670	-	381234 411739
313	Contemporary Trade Directory Entries Name: Duckworth & Jepson Location: Unit 1, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Electrical Engineers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	679	-	381241 411784
313	Contemporary Trade Directory Entries Name: Jack Gibson & Sons Location: Unit 2, Portland Street, Bury, Lancashire, BL9 6EY Classification: Ice Cream Manufacturers & Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	694	-	381255 411787

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
313	Contemporary Trade Directory Entries Name: Cs Broaching Services Location: Unit 2, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Engineering Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	694	-	381255 411787
313	Contemporary Trade Directory Entries Name: Major Uk Location: Portland Ind Est, Portland St, Bury, Lancashire, BL9 6EY Classification: Catering Equipment Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14NE (E)	700	-	381264 411754
313	Contemporary Trade Directory Entries Name: Elton Decorating Supplies Location: Unit 4, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	715	-	381277 411791
313	Contemporary Trade Directory Entries Name: Parkland Machines Ltd Location: Unit 5, Portland Street, Bury, Lancashire, BL9 6EY Classification: Machinery - Industrial & Commercial Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	726	-	381287 411794
313	Contemporary Trade Directory Entries Name: Parkland International Location: Bury, BL9 6EY Classification: Machinery - Industrial & Commercial Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	726	-	381287 411794
314	Contemporary Trade Directory Entries Name: Newtons Of Bury Location: 149-151, The Rock, Bury, Lancashire, BL9 0ND Classification: Furniture - Reproduction Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	666	-	380746 411033
314	Contemporary Trade Directory Entries Name: Wilds Table Care Location: 151, The Rock, Bury, Lancashire, BL9 0ND Classification: Tableware Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	666	-	380746 411033
314	Contemporary Trade Directory Entries Name: Adams Fireplaces Location: 159, The Rock, Bury, Lancashire, BL9 0ND Classification: Fireplaces & Mantelpieces Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A8SE (S)	671	-	380732 411023
315	Contemporary Trade Directory Entries Name: West Coast Racing Ltd Location: Power House, Bridge St, Bury, Lancashire, BL9 6HH Classification: Car Dealers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14SW (E)	666	-	381181 411480
315	Contemporary Trade Directory Entries Name: Ironing Board Location: 48, Bridge Street, Bury, Lancashire, BL9 6HH Classification: Ironing & Home Laundry Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	676	-	381193 411484
315	Contemporary Trade Directory Entries Name: Marsh & Jeffrey Location: Bridge St, Bury, Lancashire, BL9 6HH Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14SE (E)	676	-	381185 411464
315	Contemporary Trade Directory Entries Name: Heap Bridge Garage Location: Power Ho, Bridge St, Bury, Lancashire, BL9 6HH Classification: Engine Rebuilding & Reconditioning Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14SE (E)	678	-	381186 411462

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
315	Contemporary Trade Directory Entries Name: Rally Equipe Location: Power House, Bridge Street, Bury, BL9 6HH Classification: Car Engine Tuning & Diagnostic Services Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A14SE (E)	693	-	381203 411463
315	Contemporary Trade Directory Entries Name: A C Packaging Co Ltd Location: Porritt Street, BURY, Lancashire, BL9 6HJ Classification: Packaging & Wrapping Equipment & Supplies Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	707	-	381216 411458
316	Contemporary Trade Directory Entries Name: Ryalux Group Location: Oxford Mill, Bridge Street, Bury, Lancashire, BL9 6HH Classification: Textile Manufacturing Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	675	-	381221 411576
317	Contemporary Trade Directory Entries Name: Greenbrook Engineering Location: Rear Of Haslam St, Bury, Lancashire, BL9 6EQ Classification: Wrought Ironwork Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14NE (E)	680	-	381222 411902
317	Contemporary Trade Directory Entries Name: Artys Auto Engineers Location: 31, Oram Street, Bury, Lancashire, BL9 6EN Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	725	-	381266 411913
317	Contemporary Trade Directory Entries Name: L J Print & Design Location: 11, Oram Street, Bury, Lancashire, BL9 6EN Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	725	-	381276 411866
318	Contemporary Trade Directory Entries Name: John Hesketh & Son Ltd Location: Castlecroft Ironworks, Bury Ground, Bury, Lancashire, BL9 0HU Classification: Blacksmiths & Forgemasters Status: Inactive Positional Accuracy: Automatically positioned to the address	A7NE (SW)	695	-	379985 411188
318	Contemporary Trade Directory Entries Name: James Cage Location: Castlecroft Ironworks, Bury Ground, Bury, Lancashire, BL9 0HU Classification: Road Haulage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A7NE (SW)	695	-	379985 411188
319	Contemporary Trade Directory Entries Name: Bury'S Finest Bin Cleaning Location: 14 Brook Street, Bury, Lancashire, BL9 6AH Classification: Hygiene & Cleansing Services Status: Active Positional Accuracy: Automatically positioned to the address	A9NW (SE)	695	-	381110 411283
319	Contemporary Trade Directory Entries Name: Reece Autobodies Location: Unit 1-2, Albert Works, Brook Street, Bury, Lancashire, BL9 6AH Classification: Car Body Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	705	-	381098 411249
319	Contemporary Trade Directory Entries Name: Moorside Garage Location: Moorside Garage, Brook Street, Bury, Lancashire, BL9 6AH Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	706	-	381120 411278
319	Contemporary Trade Directory Entries Name: Krupa Bros & Son Location: 14, Brook Street, Bury, Lancashire, BL9 6AH Classification: Wrought Ironwork Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	706	-	381120 411278

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
319	Contemporary Trade Directory Entries Name: C & M Engineering Location: Workshop, Brook Street, Bury, BL9 6AH Classification: Precision Engineers Status: Active Positional Accuracy: Automatically positioned to the address	A9NW (SE)	733	-	381097 411200
319	Contemporary Trade Directory Entries Name: M & M Auto Centre Ltd Location: Unit 3, Albert Works, Brook Street, Bury, Lancashire, BL9 6AH Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	734	-	381125 411236
320	Contemporary Trade Directory Entries Name: A T L Dunbar Location: Unit 2, Hudcar Mill, Hudcar Lane, Bury, BL9 6HD Classification: Packaging Materials Manufacturers & Suppliers Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	698	-	381246 411586
320	Contemporary Trade Directory Entries Name: Bdm Surface Coatings Ltd Location: Unit 2, Hudcar Mill, Hudcar Lane, Bury, BL9 6HD Classification: Powder Coatings Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	698	-	381246 411586
320	Contemporary Trade Directory Entries Name: A T L Packaging Ltd Location: Unit 2, Hudcar Mill, Hudcar Lane, Bury, BL9 6HD Classification: Packaging Materials Manufacturers & Suppliers Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	698	-	381246 411586
320	Contemporary Trade Directory Entries Name: Sitemech Utilities Ltd Location: Porritt Street, Bury, Lancashire, BL9 6HJ Classification: Stainless Steel Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	730	-	381272 411553
321	Contemporary Trade Directory Entries Name: Beldam Lascar Seals Ltd Location: Lascar Works, Tanpits Road, Bury, Lancashire, BL9 0LX Classification: Seal & Joint Manufacturers Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A8SW (S)	701	-	380285 411005
322	Contemporary Trade Directory Entries Name: S Brown Location: 2, Ely Drive, BURY, Lancashire, BL8 1BH Classification: Boilers - Servicing, Replacements & Repairs Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	702	-	379772 411522
323	Contemporary Trade Directory Entries Name: Fosters Blinds Location: 48, Moorgate, Bury, Lancashire, BL9 7AF Classification: Blinds, Awnings & Canopies Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	702	-	381040 411182
324	Contemporary Trade Directory Entries Name: Brighthouse Location: 101, The Rock, Bury, Lancashire, BL9 0NB Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	714	-	380641 410958
324	Contemporary Trade Directory Entries Name: R M C Systems Location: 73, The Rock, Bury, Lancashire, BL9 0NB Classification: Computer Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	737	-	380603 410930
325	Contemporary Trade Directory Entries Name: Stanlan Roller Engineering (1987) Ltd Location: Badger Street, Bury, Lancashire, BL9 6AD Classification: Precision Engineers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	714	-	381136 411288

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
326	Contemporary Trade Directory Entries Name: Kr Oberflächentechnik (UK) Ltd Location: Unit 11 & 13, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Plastics - Machinery & Equipment Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	717	-	381281 411746
326	Contemporary Trade Directory Entries Name: Aquasure UK Location: Unit 13, Portland Industrial Estate, Portland Street, Bury, Lancashire, BL9 6EY Classification: Swimming Pool Contractors, Repairers & Service Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	718	-	381282 411737
327	Contemporary Trade Directory Entries Name: Auto Electrical Repairs Location: 1, Littlewood Avenue, Bury, Lancashire, BL9 6PE Classification: Car Engine Tuning & Diagnostic Services Status: Active Positional Accuracy: Automatically positioned to the address	A18NE (N)	719	-	380719 412444
328	Contemporary Trade Directory Entries Name: The Perfume Shop Location: 9, Central Street, Bury, Lancashire, BL9 0JN Classification: Perfume Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	722	-	380767 410982
328	Contemporary Trade Directory Entries Name: The Perfume Shop Location: Unit 13b The Rock, Bury, Lancashire, BL9 0JN Classification: Perfume Suppliers Status: Active Positional Accuracy: Manually positioned to the address or location	A8SE (S)	745	-	380807 410972
329	Contemporary Trade Directory Entries Name: R E Performance Centre Location: Bridge St, Bury, Lancs, BL9 6HH Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9NE (SE)	736	-	381204 411368
330	Contemporary Trade Directory Entries Name: Comet Group Plc Location: Unit D, Moorgate Retail Park, Bury, Lancashire, BL9 7AQ Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	739	-	381001 411095
330	Contemporary Trade Directory Entries Name: Comet Location: Unit D, Moorgate Retail Park, Bury, Lancashire, BL9 7AQ Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	739	-	381001 411095
331	Contemporary Trade Directory Entries Name: Millennium Blinds Location: 124, The Rock, Bury, Lancashire, BL9 0PJ Classification: Blinds, Awnings & Canopies Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	743	-	380670 410933
332	Contemporary Trade Directory Entries Name: G A P Location: Unit 4, Kay Street, Bury, Lancashire, BL9 6BU Classification: PVC-U Products - Manufacturers & Suppliers Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	744	-	381249 411441
332	Contemporary Trade Directory Entries Name: Gap Ltd Location: Unit 4, Kay Street, Bury, Lancashire, BL9 6BU Classification: Cladding Suppliers & Installers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	744	-	381249 411441

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
332	Contemporary Trade Directory Entries Name: Rola Cylinder Manufacturers Ltd Location: Porritt Street, Bury, Lancashire, BL9 6HJ Classification: Engineers - General Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	763	-	381285 411483
332	Contemporary Trade Directory Entries Name: Central Motors Location: Unit 7, Kay Street, Bury, BL9 6BU Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	770	-	381281 411452
333	Contemporary Trade Directory Entries Name: R H Ritchings Ltd Location: Clarendon Street, Bury, Lancashire, BL9 6EZ Classification: Stationery Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	744	-	381307 411694
334	Contemporary Trade Directory Entries Name: Hygiene Express Location: Unit 20, Portland Industrial Estate, Portland St, Bury, Lancashire, BL9 6EY Classification: Cleaning Materials & Equipment Status: Inactive Positional Accuracy: Manually positioned to the address or location	A14NE (E)	746	-	381310 411740
334	Contemporary Trade Directory Entries Name: P G A Fabrications Location: Unit 13-14, Chesham Industrial Estate, Oram Street, BURY, Lancashire, BL9 6EN Classification: Sheet Metal Work Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	770	-	381334 411741
335	Contemporary Trade Directory Entries Name: Cadworks Uk Location: Unit 1, Woodhill Street, Bury, BL8 1AT Classification: Printers Textile Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	747	-	379713 411579
335	Contemporary Trade Directory Entries Name: Wingspan Plastics Ltd Location: Woodhill Works, Woodhill Street, Bury, Lancashire, BL8 1AT Classification: Plastics - Extrusion Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A12SW (W)	747	-	379720 411540
336	Contemporary Trade Directory Entries Name: Beldite Location: Puma House, Lower Woodhill Rd, Bury, Lancashire, BL8 1AA Classification: Toiletries Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A7NE (SW)	747	-	379844 411268
337	Contemporary Trade Directory Entries Name: Bury Auto Centres Ltd Location: Barlow Street, Bury, Lancashire, BL9 7AA Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	760	-	380912 411007
338	Contemporary Trade Directory Entries Name: Robert Daniels Jewellery Location: 47, The Rock, Bury, BL9 0JP Classification: Jewellery Manufacturers & Repairers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	770	-	380550 410893
338	Contemporary Trade Directory Entries Name: Why Pay More Location: 58, The Rock, Bury, Lancashire, BL9 0PB Classification: Toiletries Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8SE (S)	800	-	380560 410863

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
339	Contemporary Trade Directory Entries Name: Premier Stairlifts Location: Unit 7, Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Classification: Stairlifts - Manufacturers & Installers Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	773	-	381336 411782
339	Contemporary Trade Directory Entries Name: J D Gates & Railings Location: Unit 7, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Gate Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	773	-	381336 411782
339	Contemporary Trade Directory Entries Name: Rotating Equipment Services Location: Unit 5, Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Classification: Engineers - General Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	787	-	381349 411784
339	Contemporary Trade Directory Entries Name: Martin Lord Engineer Location: Unit 5, Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	787	-	381349 411784
339	Contemporary Trade Directory Entries Name: J T Autos Location: Unit 12, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	789	-	381351 411778
339	Contemporary Trade Directory Entries Name: Roche Electrical Engineering Location: Unit 15, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Electrical Engineers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	796	-	381359 411745
339	Contemporary Trade Directory Entries Name: H Dickinson Location: Unit 1/2, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Window Frames - Sales & Service Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	811	-	381373 411780
339	Contemporary Trade Directory Entries Name: Car Care Location: Unit 25/26, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Car Body Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	812	-	381376 411748
339	Contemporary Trade Directory Entries Name: Aluvents Ltd Location: Unit 22, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Air Conditioning Equipment & Systems Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	824	-	381388 411750
339	Contemporary Trade Directory Entries Name: Bury Lpg Location: Unit 27, Chesham Ind Est, Oram St, Bury, Lancashire, BL9 6EN Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the address or location	A14NE (E)	824	-	381388 411750
339	Contemporary Trade Directory Entries Name: Oram Street Motors Location: Unit 28, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Car Radiator Servicing & Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	830	-	381394 411751

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
339	Contemporary Trade Directory Entries Name: Pennine Telecom Ltd Location: Pennine House, Salford Street, Bury, Lancashire, BL9 6YA Classification: Telecommunications Equipment & Systems Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	830	-	381389 411822
339	Contemporary Trade Directory Entries Name: Interquartz Uk Ltd Location: Pennine House, Salford Street, Bury, Lancashire, BL9 6YA Classification: Telecommunications Equipment & Systems Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	830	-	381389 411822
339	Contemporary Trade Directory Entries Name: Pressure Point Steam Cleaning & Valeting Equipment Location: Unit 30, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Cleaning Materials & Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	843	-	381407 411754
339	Contemporary Trade Directory Entries Name: Bolton Enamellers Location: Unit 22, Chesham Ind Est, Oram St, Bury, Lancashire, BL9 6EN Classification: Enamelling Status: Inactive Positional Accuracy: Manually positioned to the address or location	A14NE (E)	845	-	381407 411786
339	Contemporary Trade Directory Entries Name: Cardroom Location: Unit 21/23, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Greeting Card Publishers & Wholesalers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A14NE (E)	845	-	381406 411795
339	Contemporary Trade Directory Entries Name: The Gleaming Oven Cleaning Co Location: Unit 31, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Oven cleaning Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	848	-	381411 411755
339	Contemporary Trade Directory Entries Name: The Professional Cleaning Co Location: Unit 31, Chesham Industrial Estate, Oram Street, Bury, Lancashire, BL9 6EN Classification: Oven cleaning Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	848	-	381411 411755
339	Contemporary Trade Directory Entries Name: Shaftesbury Motor Company Location: Unit 32, Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A14NE (E)	851	-	381415 411755
340	Contemporary Trade Directory Entries Name: Auto Privacy Glass Location: 4a, Samuel Street, Bury, Lancashire, BL9 6AG Classification: Window Tinting Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	773	-	381248 411372
340	Contemporary Trade Directory Entries Name: Motor Restore Ltd Location: 4a, Samuel Street, Bury, Lancashire, BL9 6AG Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	773	-	381248 411372
340	Contemporary Trade Directory Entries Name: Silver Street Brewery Ltd Location: Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Brewers Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	777	-	381232 411332

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
340	Contemporary Trade Directory Entries Name: I S I Location: 31 Samuel Street, Bury, Lancashire, BL9 6AG Classification: Catering Equipment Status: Active Positional Accuracy: Manually positioned to the road within the address or location	A9NE (SE)	784	-	381254 411359
340	Contemporary Trade Directory Entries Name: D B A Location: Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Washing Machines - Servicing & Repairs Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Gk Bio Products Ltd Location: Unit 12b, Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Laboratories Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Tasklake Ltd Location: Unit 14a Britannia Mill, Cobden St, Bury, Lancashire, BL9 6AW Classification: Bags, Belts & Accessories - Manufacturers & Suppliers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Aspect Glass Location: Unit 7, Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Glass Products - Manufacturers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Diamond Product Uk Ltd Location: Unit 15, Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Textile Manufacturing Status: Inactive Positional Accuracy: Manually positioned to the address or location	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: N J F Grinding Location: Unit 15, Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Tool Sharpening, Repairing & Servicing Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: D A S Bury Ltd Location: Unit 1, Britannia Mill, Samuel Street, Bury, Lancashire, BL9 6AG Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Carrera 2000 Location: Unit 9a, Britannia Mill, Cobden Street, Bury, BL9 6AW Classification: Screen Process Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Outstanding Beers Location: Unit 4/B, Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Brewers Status: Active Positional Accuracy: Manually positioned to the address or location	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Auto Privacy Glass Location: Unit 4/A, Britannia Mill, Cobden Street, Bury, Lancashire, BL9 6AW Classification: Window Tinting Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	792	-	381254 411342
340	Contemporary Trade Directory Entries Name: Auto Privacy Glass Location: 4 Samuel st, Bury, Lancashire, BL9 6AG Classification: Window Tinting Status: Inactive Positional Accuracy: Manually positioned to the address or location	A14SE (SE)	795	-	381280 411385

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
340	Contemporary Trade Directory Entries Name: Carrick Leather Goods Co Ltd Location: 1, Samuel Street, BURY, Lancashire, BL9 6AG Classification: Leather Garments & Products Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (SE)	796	-	381280 411385
341	Contemporary Trade Directory Entries Name: Bury General Hospital Location: Walmersley Road, Bury, Lancashire, BL9 6PG Classification: Hospitals Status: Inactive Positional Accuracy: Automatically positioned to the address	A18NE (NE)	781	-	380824 412473
342	Contemporary Trade Directory Entries Name: Valves & Engineered Products Ltd Location: Kay Buildings, Kay Street, Bury, Lancashire, BL9 6BQ Classification: Engineers - General Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (SE)	782	-	381270 411395
342	Contemporary Trade Directory Entries Name: Today'S Specials Location: 17 Bright St, Bury, Lancashire, BL9 6AQ Classification: Food Products - Manufacturers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A14SE (E)	816	-	381305 411389
343	Contemporary Trade Directory Entries Name: B James Installations Location: 2, Brandlesholme Road, Bury, Lancashire, BL8 1AS Classification: Fascias and Soffits Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SW (W)	783	-	379709 411450
344	Contemporary Trade Directory Entries Name: Clean A Blind Location: 8, Bell Lane, Bury, Lancashire, BL9 6AR Classification: Blinds, Awnings & Canopies Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NW (SE)	784	-	381148 411183
345	Contemporary Trade Directory Entries Name: Heap Bridge Garage Location: Bridge St, Bury, Lancashire, BL9 6HH Classification: Engine Rebuilding & Reconditioning Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9NE (SE)	793	-	381208 411255
346	Contemporary Trade Directory Entries Name: Invest Property Maintenance Location: Unit 24, Bury, Lancashire, BL9 6BU Classification: Commercial Vehicle & Car Cleaning Equipment & Supplies Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A14SE (E)	796	-	381324 411495
346	Contemporary Trade Directory Entries Name: Specialist Switchgear Systems Ltd Location: Unit 9, Kay Street, BURY, Lancashire, BL9 6BU Classification: Distribution Services Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	813	-	381334 411471
346	Contemporary Trade Directory Entries Name: Central Motors Kay Street Bury Location: Unit 7, Kay Street, Bury, BL9 6BU Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	813	-	381334 411471
346	Contemporary Trade Directory Entries Name: Genmar Ltd Location: Unit 4, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Air Purification Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	813	-	381334 411471
346	Contemporary Trade Directory Entries Name: Robert C Scutt Location: Unit 66, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Refrigeration Equipment Manufacturers & Distributors Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	813	-	381334 411471

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
346	Contemporary Trade Directory Entries Name: Selco Location: Unit 5, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Mobile Phone Accessories and Car Kits Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	813	-	381334 411471
346	Contemporary Trade Directory Entries Name: M S C Technologies Location: Unit 1, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Office Equipment Servicing & Maintenance Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	813	-	381334 411471
346	Contemporary Trade Directory Entries Name: Specialist Switch Gear Systems Ltd Location: Unit 9, Kay Street, Bury, Lancashire, BL9 6BU Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	813	-	381334 411471
347	Contemporary Trade Directory Entries Name: Jigsaw Limited Location: Alfred Works, Woodhill Street, Bury, Lancashire, BL8 1AT Classification: Office Furniture & Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SW (W)	802	-	379667 411528
347	Contemporary Trade Directory Entries Name: Naphtha Plastics Ltd Location: Woodhill Works, Woodhill Street, Bury, Lancashire, BL8 1AT Classification: Plastics - Raw Materials Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	802	-	379667 411528
348	Contemporary Trade Directory Entries Name: Profiled Cladding Services Ltd Location: Unit 25, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Cladding Suppliers & Installers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	804	-	381340 411522
348	Contemporary Trade Directory Entries Name: Max & Sid Location: Unit 26/27, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Greeting Card Publishers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A14SE (E)	825	-	381350 411482
348	Contemporary Trade Directory Entries Name: Wembley Supplies Group Location: Unit 29, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	829	-	381370 411534
348	Contemporary Trade Directory Entries Name: Bury Blinds Location: Unit 32, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Blinds, Awnings & Canopies Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	841	-	381378 411520
348	Contemporary Trade Directory Entries Name: Sefar Ltd Location: Unit 51 Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Filter Manufacturers & Suppliers Status: Active Positional Accuracy: Automatically positioned to the address	A14SE (E)	849	-	381376 411484
348	Contemporary Trade Directory Entries Name: Gardiner Technical Services Ltd Location: Unit 33/34, Bury Business Centre, Kay Street, Bury, Lancashire, BL9 6BU Classification: Printing Engineering Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	855	-	381386 411496
349	Contemporary Trade Directory Entries Name: Ace Clean Location: 15, Langdale Mews, Bury, Lancashire, BL9 6WE Classification: Carpet, Curtain & Upholstery Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A19NW (NE)	806	-	380929 412450

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
350	Contemporary Trade Directory Entries Name: B P Service Station Location: 124, Brandleholme Road, Bury, BL8 1AU Classification: Petrol Filling Stations Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	811	-	379644 411613
350	Contemporary Trade Directory Entries Name: Esso Location: Brandleholme Road, Bury, Lancashire, BL8 1AU Classification: Petrol Filling Stations Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	823	-	379631 411615
350	Contemporary Trade Directory Entries Name: Brandleholme Service Station Location: Brandleholme Road, Bury, Lancashire, BL8 1JN Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	824	-	379631 411610
350	Contemporary Trade Directory Entries Name: Bp Location: 126, Brandleholme Road, Bury, Lancashire, BL8 1AU Classification: Petrol Filling Stations Status: Inactive Positional Accuracy: Manually positioned to the address or location	A12SW (W)	825	-	379629 411613
351	Contemporary Trade Directory Entries Name: C Douglas Location: 2, Arley Avenue, Bury, Lancashire, BL9 5HD Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A18NE (N)	816	-	380718 412545
352	Contemporary Trade Directory Entries Name: J Rigg Location: Carlyle St, Bury, Lancashire, BL9 0JJ Classification: Car Painters & Sprayers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A7SE (SW)	820	-	380042 410995
353	Contemporary Trade Directory Entries Name: Almodale (UK) Ltd Location: Unit 15 Bright Street Works, Bright St, Bury, Lancashire, BL9 6AQ Classification: Textile Manufacturing Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9NE (SE)	832	-	381309 411362
353	Contemporary Trade Directory Entries Name: H2o Bathrooms Location: Unit 7, Bright Street Mill, Bright St, Bury, Lancashire, BL9 6AQ Classification: Bathroom Fixtures - Manufacturers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A9NE (SE)	843	-	381320 411358
353	Contemporary Trade Directory Entries Name: Supertech Location: Unit 14 Bright Street Works, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Computer Manufacturers Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A9NE (SE)	844	-	381321 411359
353	Contemporary Trade Directory Entries Name: Piston & Rotor Ltd Location: Unit 17, Bright Street Mill, Bright Street, Bury, BL9 6AQ Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	844	-	381321 411359
353	Contemporary Trade Directory Entries Name: Bright Fabrications Location: Unit 7, Bright Street Mill, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Metal Products - Fabricated Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	844	-	381321 411359
353	Contemporary Trade Directory Entries Name: Arch Point Engineering Ltd Location: Unit 18, Bright Street Works, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	844	-	381321 411359

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
353	Contemporary Trade Directory Entries Name: Chemical & Supplies Direct Location: Unit 9, Bright Street Mill, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Cleaning Materials & Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	844	-	381321 411359
353	Contemporary Trade Directory Entries Name: Uk Chairs Ltd Location: Unit 1, Bright Street Mill, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Furniture Manufacturers - Home & Office Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	850	-	381349 411404
353	Contemporary Trade Directory Entries Name: Golfs-R-Us Location: Unit 6, Bright Street Mill, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	850	-	381349 411404
353	Contemporary Trade Directory Entries Name: Oakfern Ltd Location: Bright Street Mill, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Frozen Food Processors & Distributors Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	850	-	381349 411404
353	Contemporary Trade Directory Entries Name: Increase Decrease Location: Unit 8, Bright Street Mill, Bright Street, Bury, BL9 6AQ Classification: Ironing & Home Laundry Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A14SE (E)	851	-	381349 411404
353	Contemporary Trade Directory Entries Name: Ashgrove Engineering Projects Ltd Location: Unit 4a, Bright Street Mill, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	870	-	381352 411362
353	Contemporary Trade Directory Entries Name: Latem Location: Unit 19, Bright Street Mill, Bright Street, Bury, Lancashire, BL9 6AQ Classification: Sheet Metal Work Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	870	-	381352 411362
353	Contemporary Trade Directory Entries Name: Howarth Timber & Building Supplies Location: Bright Street, Bury, Lancashire, BL9 6AQ Classification: Builders' Merchants Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	877	-	381336 411315
354	Contemporary Trade Directory Entries Name: Portwood Colour Co Ltd Location: 17-19, Rochdale Road, Bury, Lancashire, BL9 0QB Classification: Colour Manufacturers & Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	837	-	380828 410881
354	Contemporary Trade Directory Entries Name: Anglebase Ltd Location: 23, Rochdale Road, Bury, Lancashire, BL9 0QB Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	855	-	380839 410866
354	Contemporary Trade Directory Entries Name: Bury Exhausts & Tyres Location: Unit 7 Kwik Save Shopping Precinct, Rochdale Rd, Bury, Lancashire, BL9 0PR Classification: Tyre Dealers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9SW (SE)	887	-	380870 410844
355	Contemporary Trade Directory Entries Name: Gorebrook Location: Derby St, Bury, Lancashire, BL9 0NW Classification: Pattern Makers - Industrial Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9SW (SE)	839	-	380943 410934

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
356	Contemporary Trade Directory Entries Name: Farnell Land Rover Location: Bell Lane, Bury, Lancashire, BL9 6DJ Classification: Car Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	845	-	381269 411255
356	Contemporary Trade Directory Entries Name: Bell Lane Car Centre Ltd Location: Bell Lane, Bury, Lancashire, BL9 6DJ Classification: Car Dealers - Used Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	845	-	381269 411255
356	Contemporary Trade Directory Entries Name: Mark Anthony Services Ltd Location: 61-65, Bell Lane, Bury, BL9 6BB Classification: Commercial Vehicle Servicing, Repairs, Parts & Accessories Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	884	-	381300 411232
357	Contemporary Trade Directory Entries Name: Lakeside Engineering Co Location: Newton St, Bury, Lancashire, BL9 5HB Classification: Textile Manufacturing Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A18NE (N)	847	-	380683 412584
358	Contemporary Trade Directory Entries Name: B M Auto Bodies Location: Church Street, Bury, BL9 6BN Classification: Car Body Repairs Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	850	-	381204 411147
358	Contemporary Trade Directory Entries Name: Vivid Wheels Location: Star Works, Church Street, Bury, Lancashire, BL9 6BN Classification: Alloys Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	851	-	381204 411147
358	Contemporary Trade Directory Entries Name: Callaghan'S Location: Star Works, Church Street, Bury, BL9 6BN Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	852	-	381210 411152
358	Contemporary Trade Directory Entries Name: Cartime Location: Bell Lane, Bury, Lancashire, BL9 6AR Classification: Car Dealers - Used Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	856	-	381233 411177
358	Contemporary Trade Directory Entries Name: Tdi Location: Star Houes, Bury, Lancashire, BL9 6BN Classification: Digital Printing Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A9NE (SE)	872	-	381245 411166
358	Contemporary Trade Directory Entries Name: J D M Garage Ltd Location: Church St, Bury, Lancashire, BL9 6BN Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A9NE (SE)	872	-	381245 411166
359	Contemporary Trade Directory Entries Name: Paint Tec Location: Revers Street Garage, Revers Street, Bury, BL8 1AQ Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A7NW (SW)	852	-	379711 411280
359	Contemporary Trade Directory Entries Name: A W R Location: Revers Street Garage, Revers Street, Bury, BL8 1AQ Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A7NW (SW)	852	-	379711 411280

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
360	Contemporary Trade Directory Entries Name: Nextrom Location: Derby Chambers, 6, The Rock, Bury, Lancashire, BL9 0NT Classification: Machinery - Industrial & Commercial Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	855	-	380429 410814
360	Contemporary Trade Directory Entries Name: Hunterskil Howard Projects Ltd Location: Derby Chambers, 6, The Rock, Bury, Lancashire, BL9 0NT Classification: Printed Circuit Services Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8SW (S)	855	-	380429 410814
360	Contemporary Trade Directory Entries Name: Mels Cleaning Services Location: Derby Chambers, 6, The Rock, Bury, Lancashire, BL9 0NT Classification: Commercial Cleaning Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	855	-	380429 410814
360	Contemporary Trade Directory Entries Name: W H Winterburn Location: South Back Rock, Off Crompton St, Bury, Lancashire, BL9 0NS Classification: Printers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A8SW (S)	868	-	380462 410797
361	Contemporary Trade Directory Entries Name: K & N Upholstery Location: 50, Bolton Street, Bury, Lancashire, BL9 0LL Classification: Leather Garments & Products Status: Inactive Positional Accuracy: Manually positioned to an adjacent address or location	A8SW (S)	859	-	380222 410861
361	Contemporary Trade Directory Entries Name: Rosehill Printers Ltd Location: A, 50, Bolton Street, Bury, Lancashire, BL9 0LL Classification: Printers Status: Active Positional Accuracy: Automatically positioned to the address	A8SW (S)	859	-	380222 410861
361	Contemporary Trade Directory Entries Name: Prontaprint Location: 40, Bolton Street, Bury, Lancashire, BL9 0LL Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	870	-	380237 410843
361	Contemporary Trade Directory Entries Name: Pearl Car Care Products Ltd Location: 36, Bolton Street, Bury, BL9 0LL Classification: Car Washing & Polishing Equipment & Supplies Status: Active Positional Accuracy: Automatically positioned to the address	A8SW (S)	872	-	380246 410838
361	Contemporary Trade Directory Entries Name: Alenco Location: 44, Bolton Street, Bury, Lancashire, BL9 0LL Classification: Dry Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	875	-	380225 410842
361	Contemporary Trade Directory Entries Name: Allens Location: 44, Bolton Street, Bury, Lancashire, BL9 0LL Classification: Dry Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	875	-	380225 410842
361	Contemporary Trade Directory Entries Name: Alenco Dry Cleaners Location: 44, Bolton Street, Bury, Lancashire, BL9 0LL Classification: Dry Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	875	-	380225 410842
361	Contemporary Trade Directory Entries Name: Printing.Com Location: 56, Bolton Street, Bury, Lancashire, BL9 0LL Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	884	-	380198 410843

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
362	Contemporary Trade Directory Entries Name: R M S Location: 24a, Bolton Street, Bury, Lancashire, BL9 0LQ Classification: Jewellery Manufacturers & Repairers Status: Active Positional Accuracy: Automatically positioned to the address	A8SW (S)	863	-	380282 410836
362	Contemporary Trade Directory Entries Name: East Lancashire Railway Location: Bolton Street Station, Bolton Street, Bury, Lancashire, BL9 0EY Classification: Railways Status: Active Positional Accuracy: Automatically positioned to the address	A8SW (S)	909	-	380259 410794
363	Contemporary Trade Directory Entries Name: C C Motors Location: Bright St, Bury, Lancashire, BL9 6AQ Classification: Garage Services Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9NE (SE)	865	-	381316 411304
364	Contemporary Trade Directory Entries Name: Castlecroft Motors Location: Bury, BL9 0LN Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A7SE (SW)	870	-	380158 410876
365	Contemporary Trade Directory Entries Name: Spotless Cleaning & Removals Location: 135, Brandlesholme Road, Bury, BL8 1BA Classification: Cleaning Services - Domestic Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	875	-	379576 411641
366	Contemporary Trade Directory Entries Name: Perfume Point Location: 4 Union Arcade, Bury, Lancashire, BL9 0QF Classification: Perfume Suppliers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8SE (S)	875	-	380588 410790
367	Contemporary Trade Directory Entries Name: Screwfix Location: Pendle House, Webb Street, Bury, BL8 1AF Classification: Builders' Merchants Status: Active Positional Accuracy: Automatically positioned to the address	A7NW (SW)	879	-	379714 411225
367	Contemporary Trade Directory Entries Name: Domestic Refrigeration Repairs Location: Webb Street, Bury, Lancashire, BL8 1AF Classification: Refrigerators & Freezers - Servicing & Repairs Status: Active Positional Accuracy: Manually positioned within the geographical locality	A7NW (SW)	879	-	379714 411225
367	Contemporary Trade Directory Entries Name: Tygas Ltd Location: Webb Street, Bury, Lancashire, BL8 1AF Classification: Gas Suppliers Status: Active Positional Accuracy: Automatically positioned to the address	A7NW (SW)	891	-	379744 411163
367	Contemporary Trade Directory Entries Name: Millitorr Engineering Location: Webb St, Bury, Lancashire, BL8 1AF Classification: Engineers - General Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A7NW (SW)	894	-	379714 411198
367	Contemporary Trade Directory Entries Name: Millitorr Engineering Location: Webb St, Bury, Lancashire, BL8 1AF Classification: Engineers - General Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A7NW (SW)	894	-	379714 411198
367	Contemporary Trade Directory Entries Name: Elantic Ltd Location: Webb Street, Bury, Lancashire, BL8 1AF Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A7NW (SW)	911	-	379704 411183

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
368	Contemporary Trade Directory Entries Name: D S Commercials Location: Unit 1, Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Classification: Caravans - Servicing & Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: Acethorn Ltd Location: Unit 2, Britannia Warehouse, Ormond Street, Bury, Lancashire, BL9 7AJ Classification: Chemicals - Distributors & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: F 1 M O T Centre Location: Unit 4, Britannia Warehouse, Ormond Street, Bury, Lancashire, BL9 7AJ Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: Bury Renault Centre Location: Unit 1, Britannia Warehouse, Ormond Street, Bury, Lancashire, BL9 7AJ Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: Bury Renault Centre Location: Unit 1, Britannia Warehouse, Ormond Street, Bury, Lancashire, BL9 7AJ Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: D S Commercials Location: Unit 1, Britannia Warehouse, Ormond Street, Bury, Lancashire, BL9 7AJ Classification: Commercial Vehicle Bodybuilders & Repairers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: Tommy'S Location: Britannia Warehouse, Ormond Street, Bury, Lancashire, BL9 7AJ Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: The M O T Centre Location: Unit 4, Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Classification: Mot Testing Centres Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
368	Contemporary Trade Directory Entries Name: F 1 Mot Centre Location: Unit 4, Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Classification: Mot Testing Centres Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	885	-	381203 411090
369	Contemporary Trade Directory Entries Name: G T Motors Location: 2, York Street, Bury, Lancashire, BL9 7AR Classification: Garage Services Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A9SW (SE)	891	-	381137 411013
370	Contemporary Trade Directory Entries Name: Rrg (Bury) Location: 7, Bolton Street, Bury, Lancashire, BL9 0EY Classification: Car Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	895	-	380323 410792
370	Contemporary Trade Directory Entries Name: Dale Fireplaces Location: 23, Bolton Street, Bury, Lancashire, BL9 0EY Classification: Fireplaces & Mantelpieces Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	901	-	380283 410796

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
370	Contemporary Trade Directory Entries Name: B W Cleaning Services Location: 14-16 Silver Street, Bury, Lancashire, BL9 0EX Classification: Commercial Cleaning Services Status: Active Positional Accuracy: Automatically positioned to the address	A8SW (S)	934	-	380318 410753
371	Contemporary Trade Directory Entries Name: One Athletic Location: Inwood House, 5, Castlecroft Road, Bury, BL9 0LN Classification: Textile Manufacturing Status: Active Positional Accuracy: Automatically positioned to the address	A7SE (SW)	898	-	380071 410890
372	Contemporary Trade Directory Entries Name: Apollo Motor Co Location: Lodge Bank Works, Merton Street, Bury, Lancashire, BL8 1AW Classification: Car Body Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SW (W)	903	-	379596 411409
372	Contemporary Trade Directory Entries Name: East Lancashire Vehicles Ltd Location: Lodge Bank Works, Merton Street, Bury, BL8 1AW Classification: Car Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SW (W)	903	-	379596 411409
373	Contemporary Trade Directory Entries Name: Limefield Garage Location: Purdon Street, Bury, Lancashire, BL9 5HA Classification: Garage Services Status: Active Positional Accuracy: Automatically positioned to the address	A18NE (N)	903	-	380702 412638
373	Contemporary Trade Directory Entries Name: Alston Press Location: Purdon Street, Bury, Lancashire, BL9 5HA Classification: Printers Status: Active Positional Accuracy: Automatically positioned to the address	A18NE (N)	910	-	380690 412647
373	Contemporary Trade Directory Entries Name: Alston Press Location: Purdon Street, Bury, Lancashire, BL9 5HA Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A18NE (N)	910	-	380690 412647
373	Contemporary Trade Directory Entries Name: Alston Press Location: Purdon Street, Bury, Lancashire, BL9 5HA Classification: Printers Status: Inactive Positional Accuracy: Automatically positioned to the address	A18NE (N)	910	-	380690 412647
374	Contemporary Trade Directory Entries Name: Hobin Of Bury Location: Bell Lane, Bury, Lancashire, BL9 6HH Classification: Car Dealers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9NE (SE)	904	-	381315 411218
374	Contemporary Trade Directory Entries Name: Swan Finishing Systems Location: Crescent Works, Bell La, Bury, Lancashire, BL9 6BA Classification: Oven Manufacturers Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9NE (SE)	906	-	381316 411215
374	Contemporary Trade Directory Entries Name: Any Old Iron Location: 1, Brick Street, Bury, Lancashire, BL9 6AY Classification: Scrap Metal Merchants Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	921	-	381321 411195
375	Contemporary Trade Directory Entries Name: R R G Toyota Bury Location: 1 Bolton Street, Bury, Lancashire, BL9 0EY Classification: Car Dealers Status: Active Positional Accuracy: Manually positioned to the road within the address or location	A7SE (SW)	907	-	380133 410846

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
375	Contemporary Trade Directory Entries Name: Lgc Standards Proficiency Testing Location: 1, Chamberhall Business Park, Chamberhall Green, Bury, Lancashire, BL9 0AP Classification: Laboratories Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A7SE (SW)	909	-	380109 410856
376	Contemporary Trade Directory Entries Name: Burning Desire (Uk) Ltd Location: 9, Silver Street, Bury, Lancashire, BL9 0EU Classification: Fireplaces & Mantelpieces Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	917	-	380363 410761
377	Contemporary Trade Directory Entries Name: Dixons Location: 21-23, The Haymarket, Bury, Lancashire, BL9 0BX Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	921	-	380559 410742
377	Contemporary Trade Directory Entries Name: Currys Digital Location: 21-23, The Haymarket, Bury, Lancashire, BL9 0BX Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8SE (S)	921	-	380559 410742
378	Contemporary Trade Directory Entries Name: Instore Location: Angouleme Way Retail Park, George Street, Bury, Lancashire, BL9 0BZ Classification: Homefurnishings - Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	921	-	380808 410786
379	Contemporary Trade Directory Entries Name: Be Dazzled Location: 11, Merton Street, Bury, Lancashire, BL8 1AW Classification: Cleaning Services - Domestic Status: Inactive Positional Accuracy: Automatically positioned to the address	A7NW (SW)	923	-	379611 411321
379	Contemporary Trade Directory Entries Name: Pressurelink Contracting Ltd Location: The Workshops, Hulme Street, Bury, Lancashire, BL8 1AN Classification: Cleaning Services - Commercial Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A7NW (SW)	938	-	379606 411296
380	Contemporary Trade Directory Entries Name: Smith Knight Fay Volkswagen Location: Bell Lane, Bury, Lancashire, BL9 6DL Classification: Car Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A9NE (SE)	927	-	381358 411249
381	Contemporary Trade Directory Entries Name: Shopmobility Location: 34, Minden Parade, Bury, Lancashire, BL9 0QG Classification: Disability Equipment - Manufacturers & Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	927	-	380697 410751
382	Contemporary Trade Directory Entries Name: First Manchester Bury Depot Location: 55, Rochdale Road, Bury, Lancashire, BL9 0QZ Classification: Bus & Coach Operators & Stations Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	931	-	380963 410839
383	Contemporary Trade Directory Entries Name: Dent Wizard Location: 30, Greenbrook Close, Bury, Lancashire, BL9 6NS Classification: Car Body Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A14NE (E)	934	-	381485 411892

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
384	Contemporary Trade Directory Entries Name: Choice Fascias Location: 33, Talbot Grove, Bury, Lancashire, BL9 6PH Classification: Cladding Suppliers & Installers Status: Inactive Positional Accuracy: Automatically positioned to the address	A19NW (NE)	937	-	381002 412560
385	Contemporary Trade Directory Entries Name: The Fragrance Shop Location: 2b, The Mall, Bury, Lancashire, BL9 0QQ Classification: Perfume Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	939	-	380512 410724
386	Contemporary Trade Directory Entries Name: Atlantis Traders Uk Ltd Location: Office 2 Acorn Business Centre, Fountain Street North, Bury, Lancashire, BL9 7AN Classification: Car Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A9SE (SE)	941	-	381198 411001
386	Contemporary Trade Directory Entries Name: James Street Motors Location: Unit 3, Fountain St North, Bury, Lancashire, BL9 7AN Classification: Mot Testing Centres Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9SE (SE)	943	-	381187 410988
386	Contemporary Trade Directory Entries Name: Stephen Rigby J S M M O T Centre Location: Unit 3 Britannia Mill, Fountain Street North, Bury, Lancashire, BL9 7AN Classification: Garage Services Status: Active Positional Accuracy: Manually positioned within the geographical locality	A9SE (SE)	949	-	381200 410993
386	Contemporary Trade Directory Entries Name: The Tyre Yard Location: The Tyre Yard, Fountain Street North, Bury, Lancashire, BL9 7AN Classification: Tyre Dealers Status: Active Positional Accuracy: Manually positioned within the geographical locality	A9SE (SE)	949	-	381200 410993
386	Contemporary Trade Directory Entries Name: All Glass & Mirrors Location: Acorn Business Centre, Fountain St North, Bury, Lancashire, BL9 7HL Classification: Mirrors & Decorative Glass Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9SE (SE)	960	-	381182 410960
387	Contemporary Trade Directory Entries Name: Pb Resources Location: 19, Holbeach Close, Bury, Lancashire, BL8 1XA Classification: Caravans - Servicing & Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A17SW (NW)	942	-	379753 412355
388	Contemporary Trade Directory Entries Name: M & N Car Sales Location: Merton Street, Bury, Lancashire, BL8 1AW Classification: Car Dealers - Used Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A7NW (W)	943	-	379580 411340
388	Contemporary Trade Directory Entries Name: North Manchester Stair Company Location: The Workshops, Hulme Street, Bury, BL8 1AN Classification: Joinery Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A7NW (SW)	978	-	379554 411311
389	Contemporary Trade Directory Entries Name: Ashton Photographics Location: 25, Minden Parade, Bury, Lancashire, BL9 0QG Classification: Photographic Processors Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SE (S)	945	-	380608 410722

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
389	Contemporary Trade Directory Entries Name: Dr Herbs Location: Unit 1 Minden Parade, Bury, Lancashire, BL9 0QG Classification: Lighting Manufacturers Status: Inactive Positional Accuracy: Manually positioned within the geographical locality	A8SE (S)	953	-	380621 410714
389	Contemporary Trade Directory Entries Name: T Shirt Printing Location: Unit 2 The Gable, Market Parade, Bury, Lancashire, BL9 0BD Classification: T-Shirts Status: Active Positional Accuracy: Manually positioned to the road within the address or location	A8SE (S)	963	-	380654 410708
389	Contemporary Trade Directory Entries Name: Max Spielmann Location: 29, The Mall, Bury, Lancashire, BL9 0QQ Classification: Photographic Processors Status: Inactive Positional Accuracy: Automatically positioned to the address	A3NE (S)	990	-	380596 410675
390	Contemporary Trade Directory Entries Name: BI9 Location: 44, The Haymarket, Bury, Lancashire, BL9 0BX Classification: Bags, Belts & Accessories - Manufacturers & Suppliers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8SW (S)	946	-	380454 410719
391	Contemporary Trade Directory Entries Name: P C World Location: Angouleme Way Retail Park, George Street, Bury, Lancashire, BL9 0BZ Classification: Electrical Goods Sales, Manufacturers & Wholesalers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (S)	952	-	380885 410781
392	Contemporary Trade Directory Entries Name: Bury Blinds Direct Location: 29, Woodhill Vale, BURY, Lancashire, BL8 1AH Classification: Blinds, Awnings & Canopies Status: Active Positional Accuracy: Automatically positioned to the address	A12SW (W)	957	-	379526 411452
393	Contemporary Trade Directory Entries Name: Dublcheck Cleaning Location: 1, Rollesby Close, Bury, Lancashire, BL8 1EW Classification: Cleaning Services - Commercial Status: Inactive Positional Accuracy: Automatically positioned to the address	A17SW (NW)	958	-	379704 412319
394	Contemporary Trade Directory Entries Name: Bury Vehicle Repair & Tyre Centre Ltd Location: 50, Wash Lane, Bury, Lancashire, BL9 6AS Classification: Mot Testing Centres Status: Active Positional Accuracy: Manually positioned to the address or location	A9NE (SE)	959	-	381255 411038
394	Contemporary Trade Directory Entries Name: Finesse Chemdry Location: 50a, Wash Lane, Bury, Lancashire, BL9 6AS Classification: Carpet, Curtain & Upholstery Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	959	-	381255 411038
394	Contemporary Trade Directory Entries Name: Ck Plastics Location: 50a, Wash Lane, Bury, Lancashire, BL9 6AS Classification: Builders' Merchants Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	959	-	381255 411038
394	Contemporary Trade Directory Entries Name: Wash Lane Car Sales Location: Topley House, 52, Wash Lane, Bury, BL9 6AS Classification: Car Dealers - Used Status: Active Positional Accuracy: Automatically positioned to the address	A9SE (SE)	990	-	381275 411013
395	Contemporary Trade Directory Entries Name: Georgian Gates Location: Lower Woodhill Rd, Bury, Lancashire, BL8 1AA Classification: Wrought Ironwork Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A7SW (SW)	959	-	379773 411026

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
395	Contemporary Trade Directory Entries Name: G Bennett (Transport) Ltd Location: Lower Woodhill Road, Bury, Lancashire, BL8 1AA Classification: Road Haulage Services Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A7SW (SW)	974	-	379751 411028
395	Contemporary Trade Directory Entries Name: Excelsior Case & Container Ltd Location: Unit 1/2, Irwell Works, Lower Woodhill Road, Bury, Lancashire, BL8 1AA Classification: Materials Handling Equipment Status: Inactive Positional Accuracy: Automatically positioned in the proximity of the address	A7SW (SW)	974	-	379751 411028
395	Contemporary Trade Directory Entries Name: Apollo Pharma Ltd Location: Unit 1 Irwell Works, Lower Woodhill Road, Bury, Lancashire, BL8 1AA Classification: Pharmaceutical Manufacturers & Distributors Status: Active Positional Accuracy: Automatically positioned to the address	A7SW (SW)	974	-	379751 411028
395	Contemporary Trade Directory Entries Name: Georgian Gates Location: Unit 2, Irwell Works, Lower Woodhill Road, Bury, BL8 1AA Classification: Wrought Ironwork Status: Active Positional Accuracy: Automatically positioned to the address	A7SW (SW)	974	-	379751 411028
395	Contemporary Trade Directory Entries Name: Fortis Mouldings Ltd Location: Unit 2 Irwell Works, Lower Woodhill Rd, Bury, Lancashire, BL8 1AA Classification: Plastics - Injection Moulding Status: Inactive Positional Accuracy: Manually positioned to the address or location	A7SW (SW)	974	-	379750 411028
395	Contemporary Trade Directory Entries Name: Lati Uk Ltd Location: Unit 2 Irwell Works, Lower Woodhill Rd, Bury, Lancashire, BL8 1AA Classification: Plastics - Raw Materials Status: Inactive Positional Accuracy: Manually positioned to the address or location	A7SW (SW)	974	-	379750 411028
395	Contemporary Trade Directory Entries Name: Eden Fashions Ltd Location: Irwell Bridge Mills, Lower Woodhill Rd, Bury, Lancashire, BL8 1AA Classification: Clothing & Fabrics - Manufacturers Status: Inactive Positional Accuracy: Manually positioned to the address or location	A7SW (SW)	975	-	379750 411027
395	Contemporary Trade Directory Entries Name: Evans Halshaw Ford Location: Evans Halshaw, Crostons Road, Bury, BL8 1AA Classification: Car Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A7SW (SW)	991	-	379737 411017
396	Contemporary Trade Directory Entries Name: Fishpool Gas & Bathroom Centre Location: Unit 2, York Street Mill, York Street, Bury, BL9 7AR Classification: Boilers - Servicing, Replacements & Repairs Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	961	-	381132 410916
396	Contemporary Trade Directory Entries Name: Swinnerton Bros Ltd Location: York Street Mill, York Street, Bury, Lancashire, BL9 7AR Classification: Recycling Centres Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	961	-	381132 410916
396	Contemporary Trade Directory Entries Name: Swinnerton Environmental Ltd Location: York Street Mill, York Street, BURY, Lancashire, BL9 7AR Classification: Recycling Centres Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	961	-	381132 410916
397	Contemporary Trade Directory Entries Name: Geldard'S Location: 17, Broad Street, Bury, Lancashire, BL9 0DA Classification: Dry Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	961	-	380385 410712

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
397	Contemporary Trade Directory Entries Name: Supasnaps Location: 36, Market Street, Bury, Lancashire, BL9 0AJ Classification: Photographic Processors Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	964	-	380408 410706
398	Contemporary Trade Directory Entries Name: Blinds By Spectrum Location: 17, Woodhill Vale, BURY, Lancashire, BL8 1AH Classification: Blinds, Awnings & Canopies Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SW (W)	971	-	379527 411400
398	Contemporary Trade Directory Entries Name: Spectrum 4 Blinds Location: 17, Woodhill Vale, Bury, Lancashire, BL8 1AH Classification: Blinds, Awnings & Canopies Status: Inactive Positional Accuracy: Automatically positioned to the address	A12SW (W)	971	-	379527 411400
399	Contemporary Trade Directory Entries Name: Chadwicks Of Bury Ltd Location: Villiers Street, Bury, Lancashire, BL9 6BS Classification: Seal & Joint Manufacturers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9NE (SE)	973	-	381424 411277
400	Contemporary Trade Directory Entries Name: T Yates & Co Location: 2, Fletcher Street, Bury, Lancashire, BL9 7AT Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	980	-	381053 410835
400	Contemporary Trade Directory Entries Name: Horizon Window Blinds Location: 69b Rochdale Road, Bury, Lancashire, BL9 7AX Classification: Blinds, Awnings & Canopies Status: Active Positional Accuracy: Automatically positioned to the address	A9SW (SE)	994	-	381030 410805
401	Contemporary Trade Directory Entries Name: Vega Machinery (Uk) Ltd Location: 8, Bank Street, Bury, Lancashire, BL9 0DL Classification: Packaging & Wrapping Equipment & Supplies Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	982	-	380259 410718
401	Contemporary Trade Directory Entries Name: Transit Plus Location: 8, Bank Street, Bury, Lancashire, BL9 0DL Classification: Freight Forwarders Status: Inactive Positional Accuracy: Manually positioned to the address or location	A8SW (S)	982	-	380259 410718
401	Contemporary Trade Directory Entries Name: Cleaners Bury Location: 2-6, Bank Street, Bury, BL9 0DL Classification: Carpet, Curtain & Upholstery Cleaners Status: Inactive Positional Accuracy: Automatically positioned to the address	A8SW (S)	993	-	380278 410702
402	Contemporary Trade Directory Entries Name: Shell (Uk) Ltd Location: Rochdale Rd, Bury, Lancashire, BL9 7AX Classification: Petrol Filling Stations - 24 Hour Status: Inactive Positional Accuracy: Manually positioned to the road within the address or location	A9SW (SE)	987	-	381012 410802
403	Contemporary Trade Directory Entries Name: Perrys Of Bury Location: Crostons Road, Bury, Lancashire, BL8 1AJ Classification: Car Dealers Status: Active Positional Accuracy: Automatically positioned to the address	A7NW (SW)	990	-	379702 411058
404	Contemporary Trade Directory Entries Name: Euro Location: 4a, Fletcher Street, Bury, Lancashire, BL9 7AT Classification: Tyre Dealers Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	993	-	381072 410832

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
404	Contemporary Trade Directory Entries Name: Bury Gas Showrooms & Spares Centre Location: 33, Fletcher Street, Bury, Lancashire, BL9 7AT Classification: Gas Appliances - Sales & Service Status: Inactive Positional Accuracy: Automatically positioned to the address	A9SW (SE)	995	-	381102 410850
405	Fuel Station Entries Name: Tesco Bury Location: Peel Way , Woodfield Retail Park, Bury, Greater Manchester, BL9 5BY Brand: TESCO Premises Type: Hypermarket Status: Open Positional Accuracy: Manually positioned to the address or location	A8NE (S)	596	-	380525 411067
406	Fuel Station Entries Name: Castlecroft Garage Location: Castlecroft Road , , Bury, Greater Manchester, BL9 0LN Brand: OBSOLETE Premises Type: Not Applicable Status: Obsolete Positional Accuracy: Located by supplier to within 100m	A8SW (SW)	746	-	380182 411002
407	Fuel Station Entries Name: Prospect Filling Station Location: 24, Brandlesholme Road , , Bury, Greater Manchester, BL8 1AU Brand: Esso Premises Type: Petrol Station Status: Open Positional Accuracy: Manually positioned to the address or location	A12SW (W)	811	-	379643 411611
408	Fuel Station Entries Name: Shell Bury Rock Location: Rochdale Road Derby Street, , Bury, Greater Manchester, BL9 7AX Brand: Shell Premises Type: Not Applicable Status: Obsolete Positional Accuracy: Manually positioned to the address or location	A9SW (SE)	882	-	380894 410860
409	Fuel Station Entries Name: Angouleme Way Service Station Location: Angouleme Way , , Bury, Greater Manchester, BL9 0BZ Brand: Obsolete Premises Type: Not Applicable Status: Obsolete Positional Accuracy: Automatically positioned to the address	A8SE (S)	933	-	380722 410751
409	Fuel Station Entries Name: Save Bury Location: Angouleme Way , , Bury, Greater Manchester, BL9 0BZ Brand: Save Premises Type: Not Applicable Status: Obsolete Positional Accuracy: Automatically positioned to the address	A8SE (S)	933	-	380722 410751
410	Points of Interest - Commercial Services Name: Prep Tec Systems Ltd Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A13SE (SE)	46	10	380554 411625
410	Points of Interest - Commercial Services Name: Prep-tec Systems Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A13SE (SE)	91	10	380618 411639
410	Points of Interest - Commercial Services Name: Asbestos Assessment Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A13SE (SE)	91	10	380618 411639
410	Points of Interest - Commercial Services Name: Esg Services Location: Every Street Garage, Every Street, Bury, BL9 5BE Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	120	10	380620 411585

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
410	Points of Interest - Commercial Services Name: Every Street Garage Ltd Location: Every Street, Bury, BL9 5BE Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	120	10	380620 411585
410	Points of Interest - Commercial Services Name: Lj Motors Location: Town Gate, Every Street, Bury, BL9 5BE Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	121	10	380610 411573
410	Points of Interest - Commercial Services Name: Lj Motors Location: Town Gate, Every Street, Bury, BL9 5BE Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	121	10	380610 411573
410	Points of Interest - Commercial Services Name: Bury M O T Centre Ltd Location: Unit 1 Fernhill Mills Hornby Street, Bury, BL9 5BL Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (E)	133	10	380673 411652
410	Points of Interest - Commercial Services Name: Hornby Street Motors Ltd Location: Unit 2 Jf Business Centre, Hornby Street, Bury, BL9 5EG Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	137	10	380670 411639
410	Points of Interest - Commercial Services Name: Manchester Diagnostics Location: Fernhill Mills, Hornby St, Bury, Lancashire, BL9 5BL Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	157	10	380670 411595
410	Points of Interest - Commercial Services Name: Hmr Auto Solutions Location: Unit 2-5, Hornby Street, Bury, BL9 5EF Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	157	10	380670 411596
410	Points of Interest - Commercial Services Name: Manchester Diagnostics Location: Fernhill Mills, Hornby Street, Bury, BL9 5BL Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	157	10	380670 411596
410	Points of Interest - Commercial Services Name: Bury Autobodies Location: Unit 8 Fernhill Mill, Hornby Street, Bury, BL9 5EF Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	157	10	380670 411596
411	Points of Interest - Commercial Services Name: T & C Transport Ltd Location: Unit A Fernhill Industrial Estate, Every Street, Bury, BL9 5BE Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A13SE (E)	53	10	380596 411679
412	Points of Interest - Commercial Services Name: Whitefield Accident Repair Centre Location: Unit 3, Park Road, Bury, BL9 5BQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (S)	116	10	380507 411548
412	Points of Interest - Commercial Services Name: Whitefield Accident Repairs Location: Unit 3, Park Road, Bury, BL9 5BQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SW (S)	117	10	380506 411548

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
413	Points of Interest - Commercial Services Name: Scrap Your Car Bury Location: 4 Fernhill Street, Bury, BL9 5BG Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A13SE (S)	171	10	380557 411494
413	Points of Interest - Commercial Services Name: A1 Independant Landrover Specialists Location: 1 Fernhill Street, Bury, BL9 5BG Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (S)	185	10	380545 411478
413	Points of Interest - Commercial Services Name: A1 British 4x4 Specialists Location: 1 Fernhill Street, Bury, BL9 5BG Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (S)	185	10	380544 411478
413	Points of Interest - Commercial Services Name: Peel Garage Location: Woodfield Mill 2, Tile Street, Bury, BL9 5BR Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (S)	250	10	380575 411417
413	Points of Interest - Commercial Services Name: Peel Garage Location: Unit 1 Woodfield Mill, 2 Tile Street, Bury, BL9 5BR Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (S)	250	10	380574 411417
413	Points of Interest - Commercial Services Name: Peel Garage Location: Woodfield Mill 2, Tile Street, Bury, BL9 5BR Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (S)	250	10	380575 411417
413	Points of Interest - Commercial Services Name: Ian Smith a 1 Vans Location: Woodfield Mill 2, Tile Street, Bury, BL9 5BR Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A13SE (S)	251	10	380574 411416
413	Points of Interest - Commercial Services Name: Recycle Motor Spares Ltd Location: Unit 2, Tile Street, Bury, BL9 5BR Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A13SE (S)	259	10	380567 411407
413	Points of Interest - Commercial Services Name: Scrap Yard Location: Not Supplied Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	284	10	380529 411379
414	Points of Interest - Commercial Services Name: Direct Drinks & Snacks Ltd Location: Unit 32 Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A13SW (W)	189	10	380276 411631
414	Points of Interest - Commercial Services Name: Chipsaway Location: Unit 28 Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SW (SW)	208	10	380294 411568
415	Points of Interest - Commercial Services Name: Ace High Customs Location: 154 Hornby Street, Bury, BL9 5BB Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SE (SE)	215	10	380710 411548

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
416	Points of Interest - Commercial Services Name: Apex Auto Repairs Location: Unit 5 New Bury Saw Mill, Park Road, Bury, BL9 5BQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13SW (S)	236	10	380451 411440
416	Points of Interest - Commercial Services Name: Scrap Yard Location: BL9 Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A8NW (S)	299	10	380496 411365
417	Points of Interest - Commercial Services Name: Mayfield Garage Location: Eldon Street, Bury, BL9 5AZ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13NE (E)	269	10	380833 411729
417	Points of Interest - Commercial Services Name: Mayfield Garage Location: Eldon Street, Bury, BL9 5AZ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13NE (E)	270	10	380834 411730
418	Points of Interest - Commercial Services Name: Punctureseal Manchester Location: 15 Argyle Street, Bury, BL9 5DX Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A13NE (NE)	283	10	380696 411982
419	Points of Interest - Commercial Services Name: Simarco International Location: 79-81 Hornby Street, Bury, BL9 5BN Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A13SE (SE)	317	10	380656 411373
419	Points of Interest - Commercial Services Name: United Global Services Ltd Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A8NE (S)	362	10	380616 411311
419	Points of Interest - Commercial Services Name: United Global Services Ltd Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A8NE (S)	362	10	380616 411311
419	Points of Interest - Commercial Services Name: D2D Xpress Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A8NE (S)	363	10	380616 411311
420	Points of Interest - Commercial Services Name: L & D Mortimer Location: 40 Birch Street, Bury, BL9 5AL Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A13SE (SE)	333	10	380752 411416
420	Points of Interest - Commercial Services Name: Washington Garage Location: Hornby Street, Bury, BL9 5AB Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8NE (SE)	357	10	380722 411363
420	Points of Interest - Commercial Services Name: Washington Garage Location: Hornby Street, Bury, BL9 5AB Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8NE (SE)	357	10	380721 411362

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
420	Points of Interest - Commercial Services Name: Recycling Lives Location: Birch Street, Bury, BL9 5AL Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A13SE (SE)	363	10	380773 411395
420	Points of Interest - Commercial Services Name: Scrap Metal Yard Location: BL9 Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A13SE (SE)	374	10	380771 411378
420	Points of Interest - Commercial Services Name: Robs Autos Location: Hornby Street, Bury, BL9 5AB Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8NE (SE)	395	10	380733 411325
420	Points of Interest - Commercial Services Name: D W Fabrications Ltd Location: Charles Street, Bury, BL9 5AJ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A8NE (SE)	400	10	380777 411349
420	Points of Interest - Commercial Services Name: D W Fabrications Ltd Location: Charles Street, Bury, BL9 5AJ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A8NE (SE)	400	10	380777 411349
421	Points of Interest - Commercial Services Name: Chipsaway Location: Unit 8 Peel Industrial Estate, Chamberhall Street, Bury, BL9 0LU Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8NW (S)	338	10	380379 411359
422	Points of Interest - Commercial Services Name: Qualisure Location: 10 Birch Street, Bury, BL9 5AL Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (SE)	409	10	380859 411423
423	Points of Interest - Commercial Services Name: Burgaflex Location: Block C Chamberhall Business Park, Harvard Road, Bury, BL9 0FU Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A12SE (SW)	440	10	380131 411403
424	Points of Interest - Commercial Services Name: Motolec Auto Electricians Location: 29a Chesham Road, Bury, BL9 6LY Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NW (E)	511	10	381064 411839
424	Points of Interest - Commercial Services Name: Motolec Auto Electrical Specialists Location: 29a Chesham Road, Bury, BL9 6LY Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NW (E)	512	10	381064 411840
424	Points of Interest - Commercial Services Name: Hi Tech Diesel Location: Unit 29a Chesham Road, Bury, BL9 6LY Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NW (E)	512	10	381064 411840
425	Points of Interest - Commercial Services Name: Automobile Auto Shop Bury Location: 64 Walmersley Road, Bury, BL9 6DP Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NW (SE)	517	10	380938 411349

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
426	Points of Interest - Commercial Services Name: Tesco Hand Car Wash Location: Hand Car Wash Woodfields Retail Park, Peel Way, Bury, BL9 5BY Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A8NE (S)	521	10	380612 411149
427	Points of Interest - Commercial Services Name: Hi Way Motors Location: Taylor Street, Bury, BL9 6DT Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (SE)	538	10	381045 411491
427	Points of Interest - Commercial Services Name: J S T Fabrications Ltd Location: Taylor Street, Bury, BL9 6DT Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A14SW (SE)	538	10	381045 411491
427	Points of Interest - Commercial Services Name: Hi Way Motors Location: Taylor Street, Bury, BL9 6DT Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (SE)	571	10	381061 411449
428	Points of Interest - Commercial Services Name: North West Clutch & Transmission Location: Unit 6 Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	545	10	381107 411691
428	Points of Interest - Commercial Services Name: Northwest Clutch & Transmission Location: Unit 6 Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	545	10	381107 411692
428	Points of Interest - Commercial Services Name: V S F Location: Gail House, Hudcar Lane, Bury, BL9 6EX Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A14SW (E)	556	10	381117 411676
428	Points of Interest - Commercial Services Name: D & E Motors Location: Unit 7/A Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	556	10	381117 411676
428	Points of Interest - Commercial Services Name: Davesgable Ltd Location: Unit 5 Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	556	10	381118 411677
428	Points of Interest - Commercial Services Name: North West Transits Location: Unit 4 Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	556	10	381118 411677
428	Points of Interest - Commercial Services Name: Seedfield Autos Location: Unit 5 Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	556	10	381118 411677
428	Points of Interest - Commercial Services Name: J & S M O T Centre Ltd Location: Unit 7/A Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	556	10	381118 411677

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
429	Points of Interest - Commercial Services Name: Tesco Bury Location: Peel Way, Woodfield Retail Park, Bury, BL9 5BY Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A8NE (S)	589	10	380519 411074
429	Points of Interest - Commercial Services Name: Car Wash Location: Peel Way, Woodfield Retail Park, Bury, Lancashire, BL9 5BY Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A8NE (S)	596	10	380525 411067
430	Points of Interest - Commercial Services Name: Webuyscrapcars Location: Unit 9 Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A14NW (E)	599	10	381163 411753
430	Points of Interest - Commercial Services Name: Van Parts UK Ltd Location: Unit 9 Freetown Business Park, Hudcar Lane, Bury, BL9 6HD Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NW (E)	599	10	381163 411753
430	Points of Interest - Commercial Services Name: J B M Location: Unit 1, Portland Street, Bury, BL9 6EY Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	657	10	381221 411736
430	Points of Interest - Commercial Services Name: Hi-Tech Diesel Ltd Location: Unit 1, Portland Street, Bury, BL9 6EY Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	657	10	381221 411736
430	Points of Interest - Commercial Services Name: Japan Direct Service Centre Ltd Location: 1-3 Haslam Street, Bury, BL9 6EQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	666	10	381224 411819
431	Points of Interest - Commercial Services Name: R E Performance Centre Location: Power House, Bridge Street, Bury, BL9 6HH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	603	10	381136 411539
431	Points of Interest - Commercial Services Name: R E Performance Centre Location: Power House, Bridge Street, Bury, BL9 6HH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	604	10	381136 411539
431	Points of Interest - Commercial Services Name: Rally Equipe Location: Power House, Bridge Street, Bury, BL9 6HH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	604	10	381136 411539
431	Points of Interest - Commercial Services Name: Heap Bridge Garage Location: Power House, Bridge Street, Bury, BL9 6HH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SW (E)	604	10	381136 411539
432	Points of Interest - Commercial Services Name: Kwik-Fit (GB) Limited Location: John Street, Bury, BL9 0NH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8NE (S)	617	10	380739 411083

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
432	Points of Interest - Commercial Services Name: Kwik-Fit (GB) Limited Location: John Street, Bury, BL9 0NH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8NE (S)	617	10	380739 411083
433	Points of Interest - Commercial Services Name: Scrap Yard Location: BL9 Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A14SW (SE)	666	10	381154 411423
433	Points of Interest - Commercial Services Name: Scrap Yard Location: Not Supplied Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to an adjacent address or location	A14SW (SE)	674	10	381163 411423
433	Points of Interest - Commercial Services Name: Marsh & Jeffrey Ltd Location: 44 Bridge Street, Bury, BL9 6HH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	693	10	381203 411463
433	Points of Interest - Commercial Services Name: R E Performance Centre Location: 36a Bridge Street, Bury, BL9 6HH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	707	10	381207 411438
434	Points of Interest - Commercial Services Name: James Cage Location: Castlecroft Ironworks, Bury Ground, Bury, BL9 0HU Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A7NE (SW)	695	10	379985 411188
435	Points of Interest - Commercial Services Name: Mr Valet Location: Unit 10 Albert Works, Brook Street, Bury, BL9 6AH Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A9NW (SE)	705	10	381098 411249
435	Points of Interest - Commercial Services Name: Krupa Bros & Son Location: 14 Brook Street, Bury, BL9 6AH Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A9NW (SE)	706	10	381120 411278
435	Points of Interest - Commercial Services Name: Brook Street Motors Location: Unit 1-2 Albert Works, Brook Street, Bury, BL9 6AH Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NW (SE)	713	10	381110 411251
436	Points of Interest - Commercial Services Name: Auto Electrical Repairs Location: 1 Littlewood Avenue, Bury, BL9 6PE Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NE (N)	718	10	380719 412443
436	Points of Interest - Commercial Services Name: A Warner Location: 1 Littlewood Avenue, Bury, BL9 6PE Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NE (N)	719	10	380719 412444
436	Points of Interest - Commercial Services Name: Auto Electrical Repairs Location: 1 Littlewood Avenue, Bury, BL9 6PE Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NE (N)	719	10	380719 412444

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
437	Points of Interest - Commercial Services Name: Georgian Gates Location: Unit 2 Irwell Works, Lower Woodhill Road, Bury, BL8 1AA Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A7NE (SW)	724	10	379885 411252
438	Points of Interest - Commercial Services Name: Oram Street Motors Location: 28 Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	754	10	381296 411914
439	Points of Interest - Commercial Services Name: P G A Fabrications Location: Unit 13-14 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A14NE (E)	769	10	381333 411740
439	Points of Interest - Commercial Services Name: J T Autos Location: Unit 12 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	789	10	381351 411778
439	Points of Interest - Commercial Services Name: Car Care Location: Unit 25/26 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	812	10	381376 411748
439	Points of Interest - Commercial Services Name: Car Care Location: Unit 25-26 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	812	10	381376 411748
439	Points of Interest - Commercial Services Name: Chesham Motor Company Location: Unit 27 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	824	10	381388 411750
439	Points of Interest - Commercial Services Name: Bury Lpg Location: Unit 27, Chesham Ind Est, Oram St, Bury, Lancashire, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	824	10	381388 411750
439	Points of Interest - Commercial Services Name: Artys Auto Engineers Location: Unit 31 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	848	10	381411 411755
439	Points of Interest - Commercial Services Name: Shaftesbury Motor Company Location: Unit 32 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	851	10	381415 411754
439	Points of Interest - Commercial Services Name: Shaftesbury Motor Company Motor Vehicle Repairs Location: Unit 32 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	852	10	381415 411755
439	Points of Interest - Commercial Services Name: Shaftesbury Motor Co Location: Unit 32 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	852	10	381415 411755

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
439	Points of Interest - Commercial Services Name: Shaftesbury Motor Co Location: Unit 32 Chesham Industrial Estate, Oram Street, Bury, BL9 6EN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	852	10	381415 411755
440	Points of Interest - Commercial Services Name: Central Motors Location: Unit 7, Kay Street, Bury, BL9 6BU Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	770	10	381281 411452
440	Points of Interest - Commercial Services Name: Specialist Switchgear Systems Ltd Location: Unit 9, Kay Street, Bury, BL9 6BU Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A14SE (E)	813	10	381334 411471
440	Points of Interest - Commercial Services Name: Central Motors Kay Street Bury Location: Unit 7, Kay Street, Bury, BL9 6BU Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	813	10	381334 411471
440	Points of Interest - Commercial Services Name: Central Motors Location: Unit 7, Kay Street, Bury, BL9 6BU Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	813	10	381334 411471
440	Points of Interest - Commercial Services Name: Armco Asbestos Consultants Location: Unit 29 Bury Business Centre, Kay Street, Bury, BL9 6BU Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A14SE (E)	830	10	381370 411533
440	Points of Interest - Commercial Services Name: D J Nabb Location: Unit 6 Bright Street Mill, Bright Street, Bury, BL9 6AQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	850	10	381349 411404
440	Points of Interest - Commercial Services Name: Golfs R Us Location: Unit 6 Bright Street Mill, Bright Street, Bury, BL9 6AQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14SE (E)	850	10	381349 411404
440	Points of Interest - Commercial Services Name: Asbestos Consultancy Location: Unit 45 Bury Business Centre, Kay Street, Bury, BL9 6BU Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A14SE (E)	852	10	381379 411484
440	Points of Interest - Commercial Services Name: Armco Asbestos Consultants Ltd Location: Unit 45 Bury Business Centre, Kay Street, Bury, BL9 6BU Category: Recycling Services Class Code: Recycling, Reclamation and Disposal Positional Accuracy: Positioned to address or location	A14SE (E)	852	10	381379 411484
441	Points of Interest - Commercial Services Name: Motor Restore Ltd Location: 4a Samuel Street, Bury, BL9 6AG Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	773	10	381248 411371
441	Points of Interest - Commercial Services Name: D A S Bury Ltd Location: Unit 1 Britannia Mill, Samuel Street, Bury, BL9 6AG Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	792	10	381254 411342

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
442	Points of Interest - Commercial Services Name: Castlecroft Motors Location: Castlecroft Road, Bury, BL9 0LN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A7SE (SW)	808	10	380167 410940
443	Points of Interest - Commercial Services Name: Prospect Filling Station Location: 24 Brandlesholme Road, Bury, BL8 1AU Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A12SW (W)	811	10	379643 411611
443	Points of Interest - Commercial Services Name: B P Car Wash Location: 124 Brandlesholme Road, Bury, BL8 1AU Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A12SW (W)	811	10	379643 411612
443	Points of Interest - Commercial Services Name: Brandlesholme Service Station Location: Brandlesholme Road, Bury, BL8 1JN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A12SW (W)	815	10	379639 411615
443	Points of Interest - Commercial Services Name: Brandlesholme Service Station Location: Brandlesholme Road, Bury, BL8 1JN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A12SW (W)	824	10	379631 411610
443	Points of Interest - Commercial Services Name: Spick 'n' Span Hand Wash & Valeting Service Location: Brandlesholme Filling Station, Brandlesholme Road, Bury, BL8 1JN Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A12SW (W)	824	10	379631 411610
443	Points of Interest - Commercial Services Name: Car Wash Location: 24 Brandlesholme Road, Bury, Lancashire, BL8 1AU Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A12SW (W)	831	10	379623 411613
444	Points of Interest - Commercial Services Name: The Valet Bay Location: Unit 9 Bright Street Mill, Bright Street, Bury, BL9 6AQ Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A9NE (SE)	844	10	381321 411359
444	Points of Interest - Commercial Services Name: Piston & Rotor Ltd Location: Unit 17 Bright Street Mill, Bright Street, Bury, BL9 6AQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	844	10	381321 411359
444	Points of Interest - Commercial Services Name: Latem Sheet Metal Work Location: Unit 19 Bright Street Mill, Bright Street, Bury, BL9 6AQ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A9NE (SE)	844	10	381321 411359
444	Points of Interest - Commercial Services Name: Latem Location: Unit 19 Bright Street Mill, Bright Street, Bury, BL9 6AQ Category: Construction Services Class Code: Metalworkers Including Blacksmiths Positional Accuracy: Positioned to address or location	A9NE (SE)	870	10	381352 411362
444	Points of Interest - Commercial Services Name: Chemical & Supplies Direct Location: Unit 8 Bright Street Mill, Bright Street, Bury, BL9 6AQ Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A9NE (SE)	870	10	381352 411362

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
445	Points of Interest - Commercial Services Name: B M Auto Bodies Location: Star Works, Church Street, Bury, BL9 6BN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	850	10	381203 411146
445	Points of Interest - Commercial Services Name: Bm Autobodies Location: Church Street, Bury, BL9 6BN Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	851	10	381204 411147
445	Points of Interest - Commercial Services Name: F 1 MOT Centre Location: Unit 4 Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	885	10	381203 411090
445	Points of Interest - Commercial Services Name: F 1 MOT Centre Location: Unit 4 Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	885	10	381203 411090
445	Points of Interest - Commercial Services Name: The M O T Centre Location: Unit 4 Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	885	10	381191 411076
445	Points of Interest - Commercial Services Name: Tommy's Location: Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	885	10	381203 411090
445	Points of Interest - Commercial Services Name: Formula 1 Car Wash Location: Unit 3 Britannia Warehouse, Ormond Street, Bury, BL9 7AJ Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A9NE (SE)	885	10	381203 411090
445	Points of Interest - Commercial Services Name: Bury Vehicle Repair & Tyre Centre Ltd Location: 50a Wash Lane, Bury, BL9 6AS Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	959	10	381255 411037
446	Points of Interest - Commercial Services Name: Paint Tec Location: Revers Street Garage, Revers Street, Bury, BL8 1AQ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A7NW (SW)	854	10	379710 411279
447	Points of Interest - Commercial Services Name: Mark Anthony Services Ltd Location: 61-65 Bell Lane, Bury, BL9 6BB Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9NE (SE)	884	10	381300 411232
448	Points of Interest - Commercial Services Name: Apollo Motor Co Location: Lodge Bank Works, Merton Street, Bury, BL8 1AW Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A12SW (W)	903	10	379596 411409
449	Points of Interest - Commercial Services Name: Limefield Garage Location: Purdon Street, Bury, BL9 5HA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NE (N)	903	10	380702 412638

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
449	Points of Interest - Commercial Services Name: Limefield Garage Location: Purdon Street, Bury, BL9 5HA Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A18NE (N)	903	10	380702 412637
450	Points of Interest - Commercial Services Name: Auto Base at Rrg Bury Location: Bolton Street, Bury, Lancashire, BL9 0EY Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A8SW (S)	909	10	380259 410794
450	Points of Interest - Commercial Services Name: Transit Plus UK Location: 8 Bank Street, Bury, BL9 0DL Category: Transport, Storage and Delivery Class Code: Distribution and Haulage Positional Accuracy: Positioned to address or location	A8SW (S)	982	10	380259 410718
451	Points of Interest - Commercial Services Name: Bubbles Hand Car Wash Location: Angouleme Way, Bury, BL9 0BB Category: Personal, Consumer and other Services Class Code: Vehicle Cleaning Services Positional Accuracy: Positioned to address or location	A8SE (S)	928	10	380722 410755
452	Points of Interest - Commercial Services Name: Dent Wizard Location: 30 Greenbrook Close, Bury, BL9 6NS Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	934	10	381485 411892
452	Points of Interest - Commercial Services Name: Dent Wizard Location: 30 Greenbrook Close, Bury, BL9 6NS Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A14NE (E)	934	10	381485 411892
453	Points of Interest - Commercial Services Name: Scrap Yard Location: BL9 Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A9SW (SE)	936	10	381156 410968
454	Points of Interest - Commercial Services Name: Ital Sport Location: 1-3 Yarwood Street, Bury, BL9 7AU Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9SW (SE)	946	10	381013 410851
455	Points of Interest - Commercial Services Name: National Windscreens Location: Foundry Street, Bury, BL9 7AZ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9SW (SE)	981	10	380942 410774
455	Points of Interest - Commercial Services Name: Northwest Motor Glass Ltd Location: Foundry Street, Bury, BL9 7AZ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9SW (SE)	981	10	380942 410774
455	Points of Interest - Commercial Services Name: Motor Glass Location: Foundry Street, Bury, BL9 7AZ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9SW (SE)	981	10	380942 410774
455	Points of Interest - Commercial Services Name: National Windscreens Location: Foundry Street, Bury, BL9 7AZ Category: Repair and Servicing Class Code: Vehicle Repair, Testing and Servicing Positional Accuracy: Positioned to address or location	A9SW (SE)	981	10	380941 410773

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
456	Points of Interest - Commercial Services Name: Scrap Yard Location: BL9 Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to address or location	A9SW (SE)	991	10	381139 410882
456	Points of Interest - Commercial Services Name: Scrap Yard Location: Not Supplied Category: Recycling Services Class Code: Scrap Metal Merchants Positional Accuracy: Positioned to an adjacent address or location	A9SW (SE)	997	10	381141 410877
457	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	78	10	380591 411616
457	Points of Interest - Manufacturing and Production Name: Business Centre Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	81	10	380580 411601
457	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	81	10	380595 411617
457	Points of Interest - Manufacturing and Production Name: Fern Hill Business Centre Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to address or location	A13SE (SE)	91	10	380618 411639
457	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (E)	135	10	380673 411649
457	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (E)	135	10	380673 411649
458	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to address or location	A13SE (SE)	165	10	380613 411521
458	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A13SE (S)	174	10	380578 411496
458	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	179	10	380573 411489
458	Points of Interest - Manufacturing and Production Name: Lupton Marble & Granite Specialists Location: 1 Fernhill Street, Bury, BL9 5BG Category: Extractive Industries Class Code: Stone Quarrying and Preparation Positional Accuracy: Positioned to address or location	A13SE (S)	185	10	380545 411478

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
458	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	190	10	380544 411473
458	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A13SE (S)	192	10	380544 411471
458	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	193	10	380564 411473
458	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	193	10	380564 411473
458	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A13SE (SE)	195	10	380629 411496
458	Points of Interest - Manufacturing and Production Name: Lupton Marble & Granite Location: 1 FERNHILL STREET, Bury, BL9 5BG Category: Extractive Industries Class Code: Stone Quarrying and Preparation Positional Accuracy: Positioned to address or location	A13SE (S)	196	10	380544 411467
458	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (S)	240	10	380579 411428
458	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A13SE (S)	249	10	380575 411418
459	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13NW (W)	166	10	380287 411745
460	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to an adjacent address or location	A13SW (SW)	187	10	380311 411581
460	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SW (SW)	188	10	380328 411563
460	Points of Interest - Manufacturing and Production Name: Peel Industrial Estate Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A13SW (SW)	250	10	380239 411570

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
460	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to an adjacent address or location	A13SW (SW)	252	10	380254 411547
461	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	191	10	380656 411521
461	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A13SE (SE)	199	10	380637 411496
461	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	250	10	380634 411436
462	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (E)	214	10	380766 411662
462	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A13SE (E)	218	10	380771 411663
462	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	298	10	380851 411652
462	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SW (E)	299	10	380852 411653
463	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	251	10	380634 411435
463	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	273	10	380673 411431
463	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A13SE (SE)	275	10	380677 411432
464	Points of Interest - Manufacturing and Production Name: Power Station Location: BL9 Category: Industrial Features Class Code: Energy Production Positional Accuracy: Positioned to an adjacent address or location	A13SW (SW)	304	10	380235 411491

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
464	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to an adjacent address or location	A13SW (SW)	309	10	380290 411442
465	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	324	10	380668 411370
465	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	328	10	380673 411369
465	Points of Interest - Manufacturing and Production Name: Businesslodge Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to address or location	A8NE (S)	362	10	380616 411311
465	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (S)	362	10	380613 411311
465	Points of Interest - Manufacturing and Production Name: M W B Business Exchange Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to address or location	A8NE (S)	362	10	380616 411311
465	Points of Interest - Manufacturing and Production Name: Businesslodge Business Centres Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to address or location	A8NE (S)	362	10	380616 411311
465	Points of Interest - Manufacturing and Production Name: Berry Business Lodge Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to address or location	A8NE (S)	363	10	380616 411311
465	Points of Interest - Manufacturing and Production Name: Berry Business Lodge Location: Europa House, Barcroft Street, Bury, BL9 5BT Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to address or location	A8NE (S)	363	10	380616 411311
466	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A8NE (SE)	404	10	380779 411346
466	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	406	10	380778 411343
467	Points of Interest - Manufacturing and Production Name: Business Park Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A12SE (SW)	409	10	380117 411468

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
468	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	412	10	380039 411747
468	Points of Interest - Manufacturing and Production Name: Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	412	10	380039 411747
468	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12NE (W)	459	10	379994 411767
469	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	487	10	381048 411681
469	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SW (E)	487	10	381049 411683
469	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	522	10	381080 411655
469	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	522	10	381080 411655
469	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	526	10	381079 411624
469	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SW (E)	529	10	381082 411622
469	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	551	10	381095 411585
469	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SW (E)	557	10	381101 411584
469	Points of Interest - Manufacturing and Production Name: Business Park Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	581	10	381143 411684

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
470	Points of Interest - Manufacturing and Production Name: J Entwhistle Location: Woodhill Road, Bury, BL8 1BS Category: Farming Class Code: Poultry Farming, Equipment and Supplies Positional Accuracy: Positioned to address or location	A17SE (NW)	509	10	380083 412074
471	Points of Interest - Manufacturing and Production Name: Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SE (W)	523	10	379927 411666
471	Points of Interest - Manufacturing and Production Name: Riverside Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SE (W)	524	10	379926 411667
472	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9NW (SE)	541	10	380959 411335
472	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	542	10	380958 411332
472	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9NW (SE)	586	10	380960 411267
472	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	589	10	380962 411265
473	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SW (E)	550	10	381077 411532
473	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	554	10	381078 411526
473	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SW (E)	580	10	381113 411543
473	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14SW (E)	582	10	381113 411538
474	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	559	10	380990 411348

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
474	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9NW (SE)	563	10	380996 411350
474	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	617	10	381067 411362
474	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	618	10	381067 411361
474	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	621	10	381048 411323
474	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	621	10	381048 411324
474	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	659	10	381065 411280
474	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	660	10	381065 411279
475	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	601	10	380788 411121
475	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NE (SE)	631	10	380794 411091
476	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	621	10	380409 411053
476	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	621	10	380409 411053
476	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to address or location	A8SW (S)	673	10	380427 410997

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
476	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to address or location	A8SW (S)	674	10	380424 410997
476	Points of Interest - Manufacturing and Production Name: Tanks Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to an adjacent address or location	A8SW (S)	674	10	380435 410995
476	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8SW (S)	676	10	380411 410997
477	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14NW (E)	630	10	381178 411874
477	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A14NW (E)	630	10	381178 411874
478	Points of Interest - Manufacturing and Production Name: California Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	647	10	380277 411067
478	Points of Interest - Manufacturing and Production Name: California Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8NW (S)	648	10	380277 411066
479	Points of Interest - Manufacturing and Production Name: Portland Industrial Estate Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A14NE (E)	668	10	381232 411722
479	Points of Interest - Manufacturing and Production Name: Portland Industrial Estate Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A14NE (E)	669	10	381233 411722
480	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	690	10	380005 411178
480	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	710	10	380005 411153
480	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	725	10	380003 411135

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
480	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	739	10	379961 411152
480	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	763	10	379929 411148
481	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to address or location	A14SE (E)	702	10	381247 411568
481	Points of Interest - Manufacturing and Production Name: Tank Location: BL9 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to address or location	A14SE (E)	716	10	381264 411579
482	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	703	10	381114 411274
482	Points of Interest - Manufacturing and Production Name: Albert Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	718	10	381111 411244
482	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	718	10	381111 411244
482	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9NW (SE)	725	10	381155 411298
482	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	729	10	381156 411292
482	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	733	10	381153 411279
482	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	733	10	381153 411279
483	Points of Interest - Manufacturing and Production Name: Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	704	10	379917 411246

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
483	Points of Interest - Manufacturing and Production Name: Ingemar Group UK Ltd Location: Unit 1 Irwell Works, Lower Woodhill Road, Bury, BL8 1AA Category: Extractive Industries Class Code: Stone Quarrying and Preparation Positional Accuracy: Positioned to address or location	A7NE (SW)	724	10	379886 411252
483	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	731	10	379872 411258
483	Points of Interest - Manufacturing and Production Name: Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NE (SW)	731	10	379872 411258
483	Points of Interest - Manufacturing and Production Name: Tank Location: BL8 Category: Industrial Features Class Code: Tanks (Generic) Positional Accuracy: Positioned to address or location	A7NE (SW)	746	10	379868 411238
484	Points of Interest - Manufacturing and Production Name: Woodhill Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	730	10	379730 411578
484	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	745	10	379713 411590
484	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	771	10	379684 411611
484	Points of Interest - Manufacturing and Production Name: Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	776	10	379679 411610
484	Points of Interest - Manufacturing and Production Name: Alfred Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	804	10	379662 411539
484	Points of Interest - Manufacturing and Production Name: Alfred Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	804	10	379662 411539
485	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SE (E)	750	10	381271 411482
485	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A14SE (E)	753	10	381275 411484

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
485	Points of Interest - Manufacturing and Production Name: Bury Business Centre Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A14SE (E)	819	10	381346 411487
485	Points of Interest - Manufacturing and Production Name: Bury Business Centre Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A14SE (E)	819	10	381346 411487
486	Points of Interest - Manufacturing and Production Name: Chesham Industrial Estate Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A14NE (E)	785	10	381348 411760
486	Points of Interest - Manufacturing and Production Name: Chesham Industrial Estate Location: BL9 Category: Industrial Features Class Code: Business Parks and Industrial Estates Positional Accuracy: Positioned to an adjacent address or location	A14NE (E)	785	10	381348 411762
487	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9NW (SE)	803	10	381120 411120
487	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NW (SE)	807	10	381120 411115
488	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9SW (SE)	883	10	380982 410905
488	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9SW (SE)	888	10	380987 410903
489	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9SW (SE)	901	10	381167 411028
489	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9SW (SE)	906	10	381165 411019
489	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9SW (SE)	919	10	381160 410995
489	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NE (SE)	926	10	381219 411046

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
489	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NE (SE)	926	10	381219 411046
489	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9SE (SE)	936	10	381207 411019
489	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9SE (SE)	936	10	381207 411019
489	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9SE (SE)	974	10	381207 410964
489	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9SE (SE)	974	10	381207 410964
490	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NW (SW)	920	10	379695 411180
490	Points of Interest - Manufacturing and Production Name: Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NW (SW)	920	10	379695 411180
490	Points of Interest - Manufacturing and Production Name: Works Location: BL8 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NW (SW)	942	10	379695 411142
490	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NW (SW)	943	10	379695 411141
490	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A7NW (SW)	949	10	379633 411221
491	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8SW (S)	926	10	380287 410769
491	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A8SW (S)	927	10	380287 410768

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
492	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	930	10	379570 411402
493	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NE (E)	935	10	381418 411351
493	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to address or location	A9NE (E)	939	10	381424 411354
493	Points of Interest - Manufacturing and Production Name: Works Location: Not Supplied Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NE (SE)	964	10	381417 411283
493	Points of Interest - Manufacturing and Production Name: Works Location: BL9 Category: Industrial Features Class Code: Unspecified Works Or Factories Positional Accuracy: Positioned to an adjacent address or location	A9NE (SE)	965	10	381418 411283
494	Points of Interest - Public Infrastructure Name: Waste Transfer Station Location: BL9 Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to an adjacent address or location	A13NW (W)	79	10	380376 411738
495	Points of Interest - Public Infrastructure Name: Re Trac Services Location: Fern Hill Business Centre, Todd Street, Bury, BL9 5BJ Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to address or location	A13SE (SE)	91	10	380618 411639
496	Points of Interest - Public Infrastructure Name: J & M Location: Fernhill Works, Park Road, Bury, BL9 5BQ Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to address or location	A13SE (S)	190	10	380580 411480
497	Points of Interest - Public Infrastructure Name: Recycling Business Location: BL9 Category: Infrastructure and Facilities Class Code: Recycling Centres Positional Accuracy: Positioned to an adjacent address or location	A13SW (SW)	229	10	380387 411479
498	Points of Interest - Public Infrastructure Name: Sluices Location: BL9 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A13SW (W)	264	10	380185 411687
498	Points of Interest - Public Infrastructure Name: Sluices Location: BL9 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A13SW (W)	264	10	380185 411688
498	Points of Interest - Public Infrastructure Name: Outfall Location: BL9 Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to an adjacent address or location	A12SE (W)	328	10	380126 411648

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
498	Points of Interest - Public Infrastructure Name: Outfall Location: BL9 Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to an adjacent address or location	A12SE (W)	328	10	380126 411649
498	Points of Interest - Public Infrastructure Name: Weir Location: BL9 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SE (W)	333	10	380119 411663
498	Points of Interest - Public Infrastructure Name: Weir Location: BL9 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SE (W)	337	10	380115 411662
499	Points of Interest - Public Infrastructure Name: Re-Trac Services Location: 40 Birch Street, Bury, BL9 5AL Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to address or location	A13SE (SE)	333	10	380752 411416
500	Points of Interest - Public Infrastructure Name: Tesco Petrol Filling Station Location: Woodfields Retail Park, Peel Way, Bury, BL9 5BY Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A8NE (S)	409	10	380570 411256
501	Points of Interest - Public Infrastructure Name: Bury Community Fire Station Location: Magdalene Road, Bury, BL9 Category: Central and Local Government Class Code: Fire Brigade Stations Positional Accuracy: Positioned to address or location	A8NW (SW)	437	10	380221 411334
502	Points of Interest - Public Infrastructure Name: Garden of Remembrance Location: BL9 Category: Infrastructure and Facilities Class Code: Cemeteries and Crematoria Positional Accuracy: Positioned to an adjacent address or location	A8NE (S)	512	10	380620 411159
502	Points of Interest - Public Infrastructure Name: Garden of Remembrance Location: Not Supplied Category: Infrastructure and Facilities Class Code: Cemeteries and Crematoria Positional Accuracy: Positioned to an adjacent address or location	A8NE (S)	514	10	380636 411160
503	Points of Interest - Public Infrastructure Name: Weir Location: BL9 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SE (SW)	536	10	380012 411397
503	Points of Interest - Public Infrastructure Name: Weir Location: BL8 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SE (SW)	552	10	379995 411392
504	Points of Interest - Public Infrastructure Name: Tesco Petrol Station Location: Petrol Station Woodfields Retail Park, Peel Way, Bury, BL9 5BY Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A8NE (S)	596	10	380525 411067
504	Points of Interest - Public Infrastructure Name: Tesco Bury Location: Peel Way, Woodfield Retail Park, Bury, BL9 5BY Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A8NE (S)	596	10	380525 411067

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
505	Points of Interest - Public Infrastructure Name: W H Tracey Location: Paradise Mill, John Street, Bury, BL9 0NH Category: Infrastructure and Facilities Class Code: Recycling Centres Positional Accuracy: Positioned to address or location	A8NE (SE)	596	10	380804 411134
505	Points of Interest - Public Infrastructure Name: Greater Manchester Fire 7 Rescue Services Location: Bury Fire Station, The Rock, Bury, BL9 5AH Category: Central and Local Government Class Code: Fire Brigade Stations Positional Accuracy: Positioned to address or location	A9NW (SE)	607	10	380872 411162
505	Points of Interest - Public Infrastructure Name: The Contingency Planning Unit Location: Fire Station, The Rock, Bury, BL9 5AH Category: Central and Local Government Class Code: Fire Brigade Stations Positional Accuracy: Positioned to address or location	A9NW (SE)	607	10	380872 411162
506	Points of Interest - Public Infrastructure Name: Cheaper Than A Skip Location: 12 Oakham Close, Bury, BL8 1XJ Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to address or location	A17SE (NW)	611	10	379995 412128
507	Points of Interest - Public Infrastructure Name: Sluice Location: BL9 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A14NE (E)	619	10	381182 411760
508	Points of Interest - Public Infrastructure Name: Greater Manchester Police - Bury Divisional HQ Location: Bury Divisional Headquarters, Dunster Road, Bury, BL9 0RD Category: Central and Local Government Class Code: Police Stations Positional Accuracy: Positioned to address or location	A7NE (SW)	712	10	380091 411092
508	Points of Interest - Public Infrastructure Name: Bury Police Station Location: Dunster Road, Bury, BL9 0RD Category: Central and Local Government Class Code: Police Stations Positional Accuracy: Positioned to address or location	A7NE (SW)	720	10	380098 411078
509	Points of Interest - Public Infrastructure Name: BP Service Station Location: 124 Brandlesholme Road, Bury, BL8 1AU Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A12SW (W)	811	10	379643 411612
509	Points of Interest - Public Infrastructure Name: Prospect Filling Station Location: 24 Brandlesholme Road, Bury, BL8 1AU Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A12SW (W)	811	10	379643 411611
509	Points of Interest - Public Infrastructure Name: BP Service Station Prospect Filling Station Location: 124 Brandlesholme Road, Bury, BL8 1AU Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A12SW (W)	812	10	379642 411611
509	Points of Interest - Public Infrastructure Name: Prospect Filling Station Location: Filling Station, Brandlesholme Road, Bury, Lancashire, BL8 1A Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A12SW (W)	824	10	379630 411610
509	Points of Interest - Public Infrastructure Name: Sluice Location: BL8 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	825	10	379640 411544

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
509	Points of Interest - Public Infrastructure Name: Sluice Location: BL8 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	825	10	379639 411547
509	Points of Interest - Public Infrastructure Name: BP Prospect Service Station Location: 126 Brandlesholme Road, Bury, BL8 1AU Category: Road And Rail Class Code: Petrol and Fuel Stations Positional Accuracy: Positioned to address or location	A12SW (W)	834	10	379618 411631
510	Points of Interest - Public Infrastructure Name: Weir Location: BL9 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A14SE (E)	825	10	381387 411681
511	Points of Interest - Public Infrastructure Name: Weir Location: BL8 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	861	10	379654 411376
511	Points of Interest - Public Infrastructure Name: Weir Location: BL8 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	864	10	379651 411376
512	Points of Interest - Public Infrastructure Name: Bus Depot Location: BL9 Category: Public Transport, Stations and Infrastructure Class Code: Bus and Coach Stations, Depots and Companies Positional Accuracy: Positioned to an adjacent address or location	A9SW (SE)	896	10	381074 410952
512	Points of Interest - Public Infrastructure Name: Bus Depot Location: BL9 Category: Public Transport, Stations and Infrastructure Class Code: Bus and Coach Stations, Depots and Companies Positional Accuracy: Positioned to an adjacent address or location	A9SW (SE)	896	10	381074 410952
512	Points of Interest - Public Infrastructure Name: Swinnerton Environmental Ltd Location: York Street Mill, York Street, Bury, BL9 7AR Category: Infrastructure and Facilities Class Code: Recycling Centres Positional Accuracy: Positioned to address or location	A9SW (SE)	961	10	381132 410916
513	Points of Interest - Public Infrastructure Name: First Manchester Bury Depot Location: 55 Rochdale Road, Bury, BL9 Category: Public Transport, Stations and Infrastructure Class Code: Bus and Coach Stations, Depots and Companies Positional Accuracy: Positioned to address or location	A9SW (SE)	931	10	380963 410839
514	Points of Interest - Public Infrastructure Name: Weir Location: BL8 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A7SW (SW)	959	10	379788 411012
514	Points of Interest - Public Infrastructure Name: Weir Location: BL8 Category: Water Class Code: Weirs, Sluices and Dams Positional Accuracy: Positioned to an adjacent address or location	A7SW (SW)	962	10	379784 411011
515	Points of Interest - Public Infrastructure Name: Outfall Location: BL8 Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	966	10	379509 411481

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
515	Points of Interest - Public Infrastructure Name: Outfall Location: BL8 Category: Infrastructure and Facilities Class Code: Waste Storage, Processing and Disposal Positional Accuracy: Positioned to an adjacent address or location	A12SW (W)	973	10	379503 411480
515	Points of Interest - Public Infrastructure Name: Refuse Location: BL8 Category: Infrastructure and Facilities Class Code: Refuse Disposal Facilities Positional Accuracy: Positioned to an adjacent address or location	A11SE (W)	983	10	379490 411488
515	Points of Interest - Public Infrastructure Name: Refuse Tip Location: BL8 Category: Infrastructure and Facilities Class Code: Refuse Disposal Facilities Positional Accuracy: Positioned to an adjacent address or location	A11SE (W)	983	10	379491 411486
515	Points of Interest - Public Infrastructure Name: Tip Location: BL8 Category: Infrastructure and Facilities Class Code: Refuse Disposal Facilities Positional Accuracy: Positioned to an adjacent address or location	A11SE (W)	984	10	379490 411486
516	Points of Interest - Public Infrastructure Name: Bolton Street Station Location: Lower Bank Street, Bury Road, Rail Interchange, Bury, BL9 0LD Category: Public Transport, Stations and Infrastructure Class Code: Railway Stations, Junctions and Halts Positional Accuracy: Positioned to address or location	A8SW (S)	967	10	380216 410748
517	Points of Interest - Recreational and Environmental Name: Play Area Location: BL9 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A13NE (N)	166	10	380518 411921
518	Points of Interest - Recreational and Environmental Name: Playground Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	479	10	380858 412109
518	Points of Interest - Recreational and Environmental Name: Playground Location: Royal Avenue, BL9 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	479	10	380858 412109
519	Points of Interest - Recreational and Environmental Name: Play Area Location: Not Supplied Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A17SE (NW)	591	10	380140 412238
519	Points of Interest - Recreational and Environmental Name: Play Area Location: Woodhill Road, BL8 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A17SE (NW)	591	10	380140 412238
520	Points of Interest - Recreational and Environmental Name: Skatepark Location: BL9 Category: Recreational Class Code: Playgrounds Positional Accuracy: Positioned to an adjacent address or location	A19SW (NE)	797	10	381137 412285

Map ID	Details	Quadrant Reference (Compass Direction)	Estimated Distance From Site	Contact	NGR
521	Areas of Adopted Green Belt Authority: Bury Metropolitan Borough Council Plan Name: Bury Unitary Development Plan Status: Adopted Plan Date: 29th August 1997	A13NW (NW)	186	6	380328 411865
522	Local Nature Reserves Name: Chesham Woods Multiple Area: N Area (m2): 154806.17 Source: Natural England Designation Date: 15th December 2000	A19SW (NE)	713	13	381123 412173

Agency & Hydrological	Version	Update Cycle
Contaminated Land Register Entries and Notices Bolton Metropolitan Borough Council - Environmental Health Department Environment Agency - Head Office Rossendale Borough Council - Environmental Health Department Bury Metropolitan Borough Council - Environmental Health Department Rochdale Metropolitan Borough Council - Environmental Health Department	January 2015 June 2020 November 2015 October 2013 October 2017	Annual Rolling Update Annually Annual Rolling Update Annual Rolling Update Annually
Discharge Consents Environment Agency - North West Region	October 2020	Quarterly
Enforcement and Prohibition Notices Environment Agency - North West Region	March 2013	Annual Rolling Update
Integrated Pollution Controls Environment Agency - North West Region	October 2008	Variable
Integrated Pollution Prevention And Control Environment Agency - North West Region	October 2020	Quarterly
Local Authority Integrated Pollution Prevention And Control Bury Metropolitan Borough Council - Environmental Health Department Bolton Metropolitan Borough Council - Environmental Health Department Rochdale Metropolitan Borough Council - Environmental Health Department Rossendale Borough Council - Environmental Health Department	February 2015 July 2014 July 2014 May 2016	Variable Variable Variable Variable
Local Authority Pollution Prevention and Controls Bury Metropolitan Borough Council - Environmental Health Department Rochdale Metropolitan Borough Council - Environmental Health Department Bolton Metropolitan Borough Council - Environmental Health Department Rossendale Borough Council - Environmental Health Department	February 2015 July 2014 July 2014 May 2016	Not Applicable Annual Rolling Update Not Applicable Annual Rolling Update
Local Authority Pollution Prevention and Control Enforcements Bury Metropolitan Borough Council - Environmental Health Department Bolton Metropolitan Borough Council - Environmental Health Department Rochdale Metropolitan Borough Council - Environmental Health Department Rossendale Borough Council - Environmental Health Department	February 2015 July 2014 July 2014 May 2016	Variable Variable Variable Variable
Nearest Surface Water Feature Ordnance Survey	September 2020	
Pollution Incidents to Controlled Waters Environment Agency - North West Region	January 2000	Not Applicable
Prosecutions Relating to Authorised Processes Environment Agency - North West Region	March 2013	Annual Rolling Update
Prosecutions Relating to Controlled Waters Environment Agency - North West Region	March 2013	Annual Rolling Update
Registered Radioactive Substances Environment Agency - North West Region	June 2016	
River Quality Environment Agency - Head Office	November 2001	Not Applicable
River Quality Biology Sampling Points Environment Agency - Head Office	July 2012	Annually
River Quality Chemistry Sampling Points Environment Agency - Head Office	July 2012	Annually
Substantiated Pollution Incident Register Environment Agency - North West Region - Central Area Environment Agency - North West Region - North Area Environment Agency - North West Region - South Area	October 2020 October 2020 October 2020	Quarterly Quarterly Quarterly
Water Abstractions Environment Agency - North West Region	October 2020	Quarterly

Agency & Hydrological	Version	Update Cycle
Water Industry Act Referrals Environment Agency - North West Region	October 2017	Quarterly
Groundwater Vulnerability Map Environment Agency - Head Office	June 2018	As notified
Bedrock Aquifer Designations Environment Agency - Head Office	January 2018	Annually
Superficial Aquifer Designations Environment Agency - Head Office	January 2018	Annually
Source Protection Zones Environment Agency - Head Office	October 2019	Quarterly
Extreme Flooding from Rivers or Sea without Defences Environment Agency - Head Office	September 2020	Quarterly
Flooding from Rivers or Sea without Defences Environment Agency - Head Office	September 2020	Quarterly
Areas Benefiting from Flood Defences Environment Agency - Head Office	September 2020	Quarterly
Flood Water Storage Areas Environment Agency - Head Office	September 2020	Quarterly
Flood Defences Environment Agency - Head Office	September 2020	Quarterly
OS Water Network Lines Ordnance Survey	September 2020	Quarterly
Surface Water 1 in 30 year Flood Extent Environment Agency - Head Office	October 2013	Annually
Surface Water 1 in 100 year Flood Extent Environment Agency - Head Office	October 2013	Annually
Surface Water 1 in 1000 year Flood Extent Environment Agency - Head Office	October 2013	Annually
Surface Water Suitability Environment Agency - Head Office	October 2013	Annually
BGS Groundwater Flooding Susceptibility British Geological Survey - National Geoscience Information Service	May 2013	Annually

Waste	Version	Update Cycle
BGS Recorded Landfill Sites British Geological Survey - National Geoscience Information Service	June 1996	Not Applicable
Historical Landfill Sites Environment Agency - Head Office	October 2019	Quarterly
Integrated Pollution Control Registered Waste Sites Environment Agency - North West Region	October 2008	Not Applicable
Licensed Waste Management Facilities (Landfill Boundaries) Environment Agency - North West Region - Central Area Environment Agency - North West Region - North Area Environment Agency - North West Region - South Area	October 2020 October 2020 October 2020	Quarterly Quarterly Quarterly
Licensed Waste Management Facilities (Locations) Environment Agency - North West Region - Central Area Environment Agency - North West Region - North Area Environment Agency - North West Region - South Area	October 2020 October 2020 October 2020	Quarterly Quarterly Quarterly
Local Authority Landfill Coverage Bolton Metropolitan Borough Council Bury Metropolitan Borough Council Lancashire County Council - Waste Management Group Rochdale Metropolitan Borough Council - Environmental Health Department Rossendale Borough Council - Environmental Health Department	May 2000 May 2000 May 2000 May 2000 May 2000	Not Applicable Not Applicable Not Applicable Not Applicable Not Applicable
Local Authority Recorded Landfill Sites Bolton Metropolitan Borough Council Bury Metropolitan Borough Council Lancashire County Council - Waste Management Group Rochdale Metropolitan Borough Council - Environmental Health Department Rossendale Borough Council - Environmental Health Department	May 2000 May 2000 May 2000 May 2000 May 2000	Not Applicable Not Applicable Not Applicable Not Applicable Not Applicable
Potentially Infilled Land (Non-Water) Landmark Information Group Limited	December 1999	Not Applicable
Potentially Infilled Land (Water) Landmark Information Group Limited	December 1999	Not Applicable
Registered Landfill Sites Environment Agency - North West Region - Central Area Environment Agency - North West Region - North Area Environment Agency - North West Region - South Area	March 2003 March 2003 March 2003	Not Applicable Not Applicable Not Applicable
Registered Waste Transfer Sites Environment Agency - North West Region - Central Area Environment Agency - North West Region - North Area Environment Agency - North West Region - South Area	March 2003 March 2003 March 2003	Not Applicable Not Applicable Not Applicable
Registered Waste Treatment or Disposal Sites Environment Agency - North West Region - Central Area Environment Agency - North West Region - North Area Environment Agency - North West Region - South Area	March 2003 March 2003 March 2003	Not Applicable Not Applicable Not Applicable

Hazardous Substances	Version	Update Cycle
Control of Major Accident Hazards Sites (COMAH) Health and Safety Executive	April 2018	Bi-Annually
Explosive Sites Health and Safety Executive	March 2017	Annually
Notification of Installations Handling Hazardous Substances (NIHHS) Health and Safety Executive	November 2000	Not Applicable
Planning Hazardous Substance Enforcements Bolton Metropolitan Borough Council - Planning Department Bury Metropolitan Borough Council Lancashire County Council Rochdale Metropolitan Borough Council Rossendale Borough Council - Planning Department	February 2016 February 2016 February 2016 February 2016 February 2016	Variable Variable Variable Variable Variable
Planning Hazardous Substance Consents Bolton Metropolitan Borough Council - Planning Department Bury Metropolitan Borough Council Lancashire County Council Rochdale Metropolitan Borough Council Rossendale Borough Council - Planning Department	February 2016 February 2016 February 2016 February 2016 February 2016	Variable Variable Variable Variable Variable
Geological	Version	Update Cycle
BGS 1:625,000 Solid Geology British Geological Survey - National Geoscience Information Service	January 2009	Not Applicable
BGS Estimated Soil Chemistry British Geological Survey - National Geoscience Information Service	October 2015	Annually
BGS Recorded Mineral Sites British Geological Survey - National Geoscience Information Service	November 2020	Bi-Annually
CBSCB Compensation District Cheshire Brine Subsidence Compensation Board (CBSCB)	August 2011	Not Applicable
Coal Mining Affected Areas The Coal Authority - Property Searches	March 2014	Annual Rolling Update
Mining Instability Ove Arup & Partners	October 2000	Not Applicable
Non Coal Mining Areas of Great Britain British Geological Survey - National Geoscience Information Service	May 2015	Not Applicable
Potential for Collapsible Ground Stability Hazards British Geological Survey - National Geoscience Information Service	April 2020	Annually
Potential for Compressible Ground Stability Hazards British Geological Survey - National Geoscience Information Service	January 2019	Annually
Potential for Ground Dissolution Stability Hazards British Geological Survey - National Geoscience Information Service	January 2019	Annually
Potential for Landslide Ground Stability Hazards British Geological Survey - National Geoscience Information Service	January 2019	Annually
Potential for Running Sand Ground Stability Hazards British Geological Survey - National Geoscience Information Service	January 2019	Annually
Potential for Shrinking or Swelling Clay Ground Stability Hazards British Geological Survey - National Geoscience Information Service	January 2019	Annually
Radon Potential - Radon Affected Areas British Geological Survey - National Geoscience Information Service	July 2011	Annually
Radon Potential - Radon Protection Measures British Geological Survey - National Geoscience Information Service	July 2011	Annually

Industrial Land Use	Version	Update Cycle
Contemporary Trade Directory Entries Thomson Directories	October 2020	Quarterly
Fuel Station Entries Catalist Ltd - Experian	September 2020	Quarterly
Gas Pipelines National Grid	September 2020	
Points of Interest - Commercial Services PointX	December 2020	Quarterly
Points of Interest - Education and Health PointX	December 2020	Quarterly
Points of Interest - Manufacturing and Production PointX	December 2020	Quarterly
Points of Interest - Public Infrastructure PointX	December 2020	Quarterly
Points of Interest - Recreational and Environmental PointX	December 2020	Quarterly
Underground Electrical Cables National Grid	August 2020	

Sensitive Land Use	Version	Update Cycle
Ancient Woodland Natural England	April 2020	Bi-Annually
Areas of Adopted Green Belt Bolton Metropolitan Borough Council Bury Metropolitan Borough Council Rochdale Metropolitan Borough Council Rossendale Borough Council - Planning Department	June 2020 June 2020 June 2020 June 2020	As notified As notified As notified As notified
Areas of Unadopted Green Belt Bolton Metropolitan Borough Council Bury Metropolitan Borough Council Rochdale Metropolitan Borough Council Rossendale Borough Council - Planning Department	June 2020 June 2020 June 2020 June 2020	As notified As notified As notified As notified
Areas of Outstanding Natural Beauty Natural England	June 2019	Bi-Annually
Environmentally Sensitive Areas Natural England	January 2017	
Forest Parks Forestry Commission	April 1997	Not Applicable
Local Nature Reserves Natural England	April 2020	Bi-Annually
Marine Nature Reserves Natural England	July 2019	Bi-Annually
National Nature Reserves Natural England	July 2019	Bi-Annually
National Parks Natural England	April 2017	Bi-Annually
Nitrate Sensitive Areas Natural England	April 2016	Not Applicable
Nitrate Vulnerable Zones Environment Agency - Head Office Department for Environment, Food and Rural Affairs (DEFRA - formerly FRCA)	December 2017 October 2015	Bi-Annually
Ramsar Sites Natural England	August 2020	Bi-Annually
Sites of Special Scientific Interest Natural England	May 2020	Bi-Annually
Special Areas of Conservation Natural England	July 2020	Bi-Annually
Special Protection Areas Natural England	September 2020	Bi-Annually

A selection of organisations who provide data within this report

Data Supplier	Data Supplier Logo
Ordnance Survey	
Environment Agency	
Scottish Environment Protection Agency	
The Coal Authority	
British Geological Survey	 British Geological Survey NATURAL ENVIRONMENT RESEARCH COUNCIL
Centre for Ecology and Hydrology	 Centre for Ecology & Hydrology NATURAL ENVIRONMENT RESEARCH COUNCIL
Natural Resources Wales	
Scottish Natural Heritage	
Natural England	
Public Health England	
Ove Arup	
Stantec UK Ltd	

Contact	Name and Address	Contact Details
1	British Geological Survey - Enquiry Service British Geological Survey, Environmental Science Centre, Keyworth, Nottingham, Nottinghamshire, NG12 5GG	Telephone: 0115 936 3143 Fax: 0115 936 3276 Email: enquiries@bgs.ac.uk Website: www.bgs.ac.uk
2	Environment Agency - National Customer Contact Centre (NCCC) PO Box 544, Templeborough, Rotherham, S60 1BY	Telephone: 03708 506 506 Email: enquiries@environment-agency.gov.uk
3	Bury Metropolitan Borough Council - Environmental Health Department 3 Knowsley Place, Duke Street, Bury, Lancashire, BL9 0EJ	Telephone: 0161 253 5000 Fax: 0161 253 5563 Website: www.bury.gov.uk
4	Environment Agency - Head Office Rio House, Waterside Drive, Aztec West, Almondsbury, Bristol, Avon, BS32 4UD	Telephone: 01454 624400 Fax: 01454 624409
5	Ordnance Survey Adanac Drive, Southampton, Hampshire, SO16 0AS	Telephone: 03456 05 05 05 Email: customerservices@ordnancesurvey.co.uk Website: www.ordnancesurvey.gov.uk
6	Bury Metropolitan Borough Council Craig House, Bank Street, Bury, Lancashire, BL9 0DN	Telephone: 0161 253 5000 Fax: 0161 705 5290 Website: www.bury.gov.uk
7	Health and Safety Executive 5S.2 Redgrave Court, Merton Road, Bootle, L20 7HS	Website: www.hse.gov.uk
8	Bury Metropolitan Borough Council Maple House, 8 Haymarket Street, Bury, BL9 0PD	Telephone: 0161 253 5000 Fax: 0161 705 5290 Website: www.bury.gov.uk
9	The Coal Authority - Property Searches 200 Lichfield Lane, Mansfield, Nottinghamshire, NG18 4RG	Telephone: 0345 762 6848 Fax: 01623 637 338 Email: groundstability@coal.gov.uk Website: www2.groundstability.com
10	PointX 7 Abbey Court, Eagle Way, Sowton, Exeter, Devon, EX2 7HY	Website: www.pointx.co.uk
11	Rochdale Metropolitan Borough Council PO Box 15, Town Hall, Rochdale, Greater Manchester, OL16 1AB	Telephone: 01706 647474 Fax: 01706 59475 Website: www.rochdale.gov.uk
12	Rossendale Borough Council - Planning Department Town Hall, Rawtenstall, Lancashire, BB4 7LZ	Telephone: 01706 217777 Fax: 01706 224958 Website: www.rossendale.gov.uk
13	Natural England County Hall, Spetchley Road, Worcester, WR5 2NP	Telephone: 0300 060 3900 Email: enquiries@naturalengland.org.uk Website: www.naturalengland.org.uk
-	Public Health England - Radon Survey, Centre for Radiation, Chemical and Environmental Hazards Chilton, Didcot, Oxfordshire, OX11 0RQ	Telephone: 01235 822622 Fax: 01235 833891 Email: radon@phe.gov.uk Website: www.ukradon.org
-	Landmark Information Group Limited Imperium, Imperial Way, Reading, Berkshire, RG2 0TD	Telephone: 0844 844 9952 Fax: 0844 844 9951 Email: customerservices@landmarkinfo.co.uk Website: www.landmarkinfo.co.uk

Please note that the Environment Agency / Natural Resources Wales / SEPA have a charging policy in place for enquiries.

Historical Mapping Legends

Ordnance Survey County Series 1:10,560

	Gravel Pit		Sand Pit		Other Pits
	Quarry		Shingle		Orchard
	Osiers		Reeds		Marsh
	Mixed Wood		Deciduous		Brushwood
	Fir		Furze		Rough Pasture
	Arrow denotes flow of water		Trigonometrical Station		
	Site of Antiquities		Bench Mark		
	Pump, Guide Post, Signal Post		Well, Spring, Boundary Post		
	•285 Surface Level				
	Sketched Contour		Instrumental Contour		
	Main Roads		Minor Roads		
	Sunken Road		Raised Road		
	Road over Railway		Railway over River		
	Railway over Road		Level Crossing		
	Road over River or Canal		Road over Stream		
	Road over Stream				
	County Boundary (Geographical)				
	County & Civil Parish Boundary				
	Administrative County & Civil Parish Boundary				
	County Borough Boundary (England)				
	County Burgh Boundary (Scotland)				
	Rural District Boundary				
	Civil Parish Boundary				

Ordnance Survey Plan 1:10,000

	Chalk Pit, Clay Pit or Quarry		Gravel Pit
	Sand Pit		Disused Pit or Quarry
	Refuse or Slag Heap		Lake, Loch or Pond
	Dunes		Boulders
	Coniferous Trees		Non-Coniferous Trees
	Orchard		Scrub
	Bracken		Heath
	Marsh		Reeds
	Building		Glasshouse
	Sloping Masonry		Pylon
	Cutting		Embankment
	Road Under		Road Over
	Level Crossing		Foot Bridge
	Standard Gauge Multiple Track		Standard Gauge Single Track
	Siding, Tramway or Mineral Line		Narrow Gauge
	Geographical County		Administrative County, County Borough or County of City
	Municipal Borough, Urban or Rural District, Burgh or District Council		Borough, Burgh or County Constituency
	Civil Parish		
	BP, BS Boundary Post or Stone		Police Station
	Church		Post Office
	Club House		Public Convenience
	Fire Engine Station		Public House
	Foot Bridge		Signal Box
	Fountain		Spring
	Guide Post		Telephone Call Box
	Mile Post		Telephone Call Post
	Mile Stone		Well

1:10,000 Raster Mapping


	Gravel Pit		Refuse tip or slag heap
	Rock		Rock (scattered)
	Boulders		Boulders (scattered)
	Shingle		Mud
	Sand		Sand Pit
	Slopes		Top of cliff
	General detail		Underground detail
	Overhead detail		Narrow gauge railway
	Multi-track railway		Single track railway
	County boundary (England only)		Civil, parish or community boundary
	District, Unitary, Metropolitan, London Borough boundary		Constituency boundary
	Area of wooded vegetation		Non-coniferous trees
	Non-coniferous trees (scattered)		Coniferous trees
	Coniferous trees (scattered)		Positioned tree
	Orchard		Coppice or Osiers
	Rough Grassland		Heath
	Scrub		Marsh, Salt Marsh or Reeds
	Water feature		Flow arrows
	Mean high water (springs)		Mean low water (springs)
	Telephone line (where shown)		Electricity transmission line (with poles)
	Bench mark (where shown)		Triangulation station
	Point feature (e.g. Guide Post or Mile Stone)		Pylon, flare stack or lighting tower
	Site of (antiquity)		Glasshouse
	General Building		Important Building



Historical Mapping & Photography included:

Mapping Type	Scale	Date	Pg
Lancashire And Furness	1:10,560	1850 - 1851	3
Lancashire And Furness	1:10,560	1894	4
Lancashire And Furness	1:10,560	1910 - 1911	5
Lancashire And Furness	1:10,560	1931	6
Lancashire And Furness	1:10,560	1938 - 1939	7
Ordnance Survey Plan	1:10,000	1956	8
Ordnance Survey Plan	1:10,000	1967 - 1969	9
Ordnance Survey Plan	1:10,000	1974	10
Manchester	1:25,000	1975	11
Ordnance Survey Plan	1:10,000	1982 - 1984	12
10K Raster Mapping	1:10,000	1999	13
10K Raster Mapping	1:10,000	2006	14
VectorMap Local	1:10,000	2020	15

Historical Map - Slice A

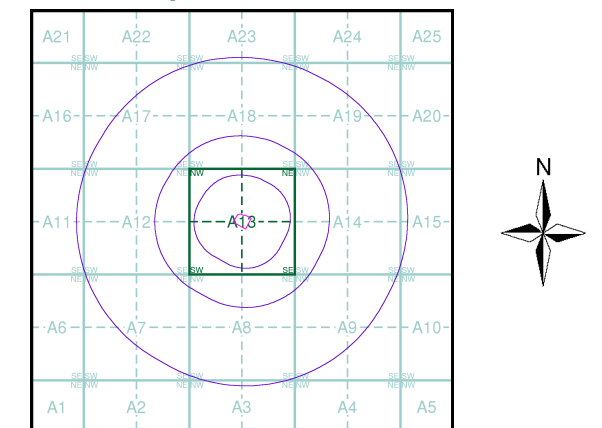

Order Details

Order Number: 269841542_1_1
Customer Ref: 11542
National Grid Reference: 380510, 411710
Slice: A
Site Area (Ha): 0.65
Search Buffer (m): 1000

Site Details

Site at 380490, 411720

Landmark
INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

Russian Military Mapping Legends

1:5,000 and 1:10,000 mapping

a. Not drawn to scale b. Drawn to scale

Government and Administrative Buildings

Military and Industrial Buildings

Military and Communication Areas

Subway Entrance

Fireproof Building

Prominent Fireproof Building

Non-fireproof Building

Non-fireproof Building (non-dwelling)

Factory, mill, and flour mill, with chimneys

Factory, mill, and flour mill, without chimneys

Power Station, drawn to scale

Hydroelectric Power Station

Radio Station, drawn to scale

Telephone Station, drawn to scale

Abandoned Open-pit Mine or Quarry

Open-pit Salt Mine

Pit

Oil Deposit or Well

Oil Seepage

Tailings Pile

Fuel Storage Tanks

Natural Gas Tank

Bench Mark

Drill Hole

Burial Mound

Triangulation Point on Burial Mound

Single-track Railroad

Double-track Railroad

Railroad and Station Building

Coniferous Forest

Deciduous Forest

Mixed Forest

Lawns

Citrus Orchard

Wet Ground

Scattered Vegetation

243.8 Values for prominent elevations
186.0 Numbers for spot elevations, depth soundings, contour lines, etc.
0.2 Velocity of the current, width of river bed, depth of river
180/12 Fractional terms: length and capacity of bridges; depth of fords and condition of the river bottom; height of forest and the diameter of trees

Russian Alphabet (For reference and phonetic interpretation of map text)

А а (A)	З з (Z)	П п (P)	Ч ч (CH)
Б б (B)	И и (I)	Р р (R)	Ш ш (SH)
В в (V)	Й й (Y)	С с (S)	Щ щ (SHCH)
Г г (G)	К к (K)	Т т (T)	Ъ (-)
Д д (D)	Л л (L)	У у (U)	Ы (Y)
Е е (E)	М м (M)	Ф ф (F)	Ь (')
Ё ё (YO)	Н н (N)	Х х (KH)	Э э (E)
Ж ж (ZH)	О о (O)	Ц ц (TS)	Ю ю (YU or IU)
			Я я (YA or IA)

1:25,000 mapping

a. Not drawn to scale b. Drawn to scale

Government and Administrative Buildings

Military and Industrial Buildings

Military and Communication Areas

Subway Entrance

Partly Demolished Buildings

Demolished Buildings

Built-Up Area with Fireproof Buildings Predominant

Built-Up Area with Non-Fireproof Buildings Predominant

Individual Fireproof Building

Prominent Industrial Building

Individual Dwelling, Fireproof

Ruins of an Individual Dwelling

Factory or Mill Chimney

Factory or Mill with Chimney

Factory or Mill without Chimney

Mine or Open Pit Mine

Operating Shaft or Mine

Non-Operating Shaft or Mine

Salt Mine

Tailings Pile

Pit

Stone Quarry

Gas Pump or Service Station

Fuel Storage or Natural Gas Tank

Oil or Natural Gas Derrick

Small Hydroelectric Power Station

Power Station

Transformer Station

Cemetery

Burial Mound (height in metres)

Triangulation Point on Burial Mound

Triangulation Point

Bench Mark

Bench Mark (monumented)

Telegraph Office

Telephone Station

Radio Station

Radio Tower

Airfield or Seaplane Base

Landing Strip

Cut, Fill, Km Post, Plantings

Telegraph/Telephone Lines

Main Highway

Highway under Construction

Improved Dirt Road (former truck road)

Small Bridge, Pipe (Culvert), Tunnel

Double-track Railroad with First Class Station

Railroad Under Construction

Shore Embankment

River or Ditch with Embankment

Direction and velocity of current

Water Gauge

Water Level Mark

Well

Water Reservoir or Rain Water Pit

Spring

Isobath with value

Heavy (Index) Contour Line

Contour Line and Value

Half Contour Line

Spot Elevation Value

Coniferous

Deciduous

Mixed

Scrub

Key to Numbers on Mapping

SD81_Manchester


No.	Description
126	Chemical Plant



Historical Mapping & Photography included:

Mapping Type	Scale	Date	Pg
Lancashire And Furness	1:10,560	1850 - 1851	3
Lancashire And Furness	1:10,560	1894	4
Lancashire And Furness	1:10,560	1910 - 1911	5
Lancashire And Furness	1:10,560	1931	6
Lancashire And Furness	1:10,560	1938 - 1939	7
Ordnance Survey Plan	1:10,000	1956	8
Ordnance Survey Plan	1:10,000	1967 - 1969	9
Ordnance Survey Plan	1:10,000	1974	10
Manchester	1:25,000	1975	11
Ordnance Survey Plan	1:10,000	1982 - 1984	12
10K Raster Mapping	1:10,000	1999	13
10K Raster Mapping	1:10,000	2006	14
VectorMap Local	1:10,000	2020	15

Russian Map - Slice A

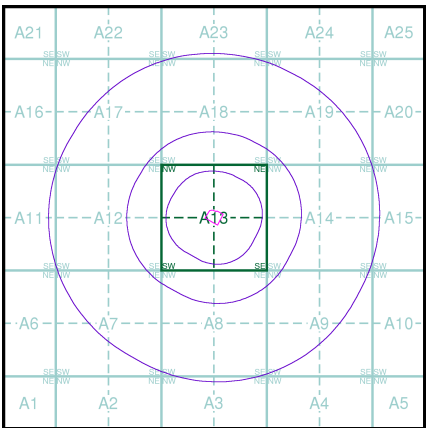

Order Details


Order Number: 269841542_1_1
Customer Ref: 11542
National Grid Reference: 380510, 411710
Slice: A
Site Area (Ha): 0.65
Search Buffer (m): 1000

Site Details

Site at 380490, 411720



Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

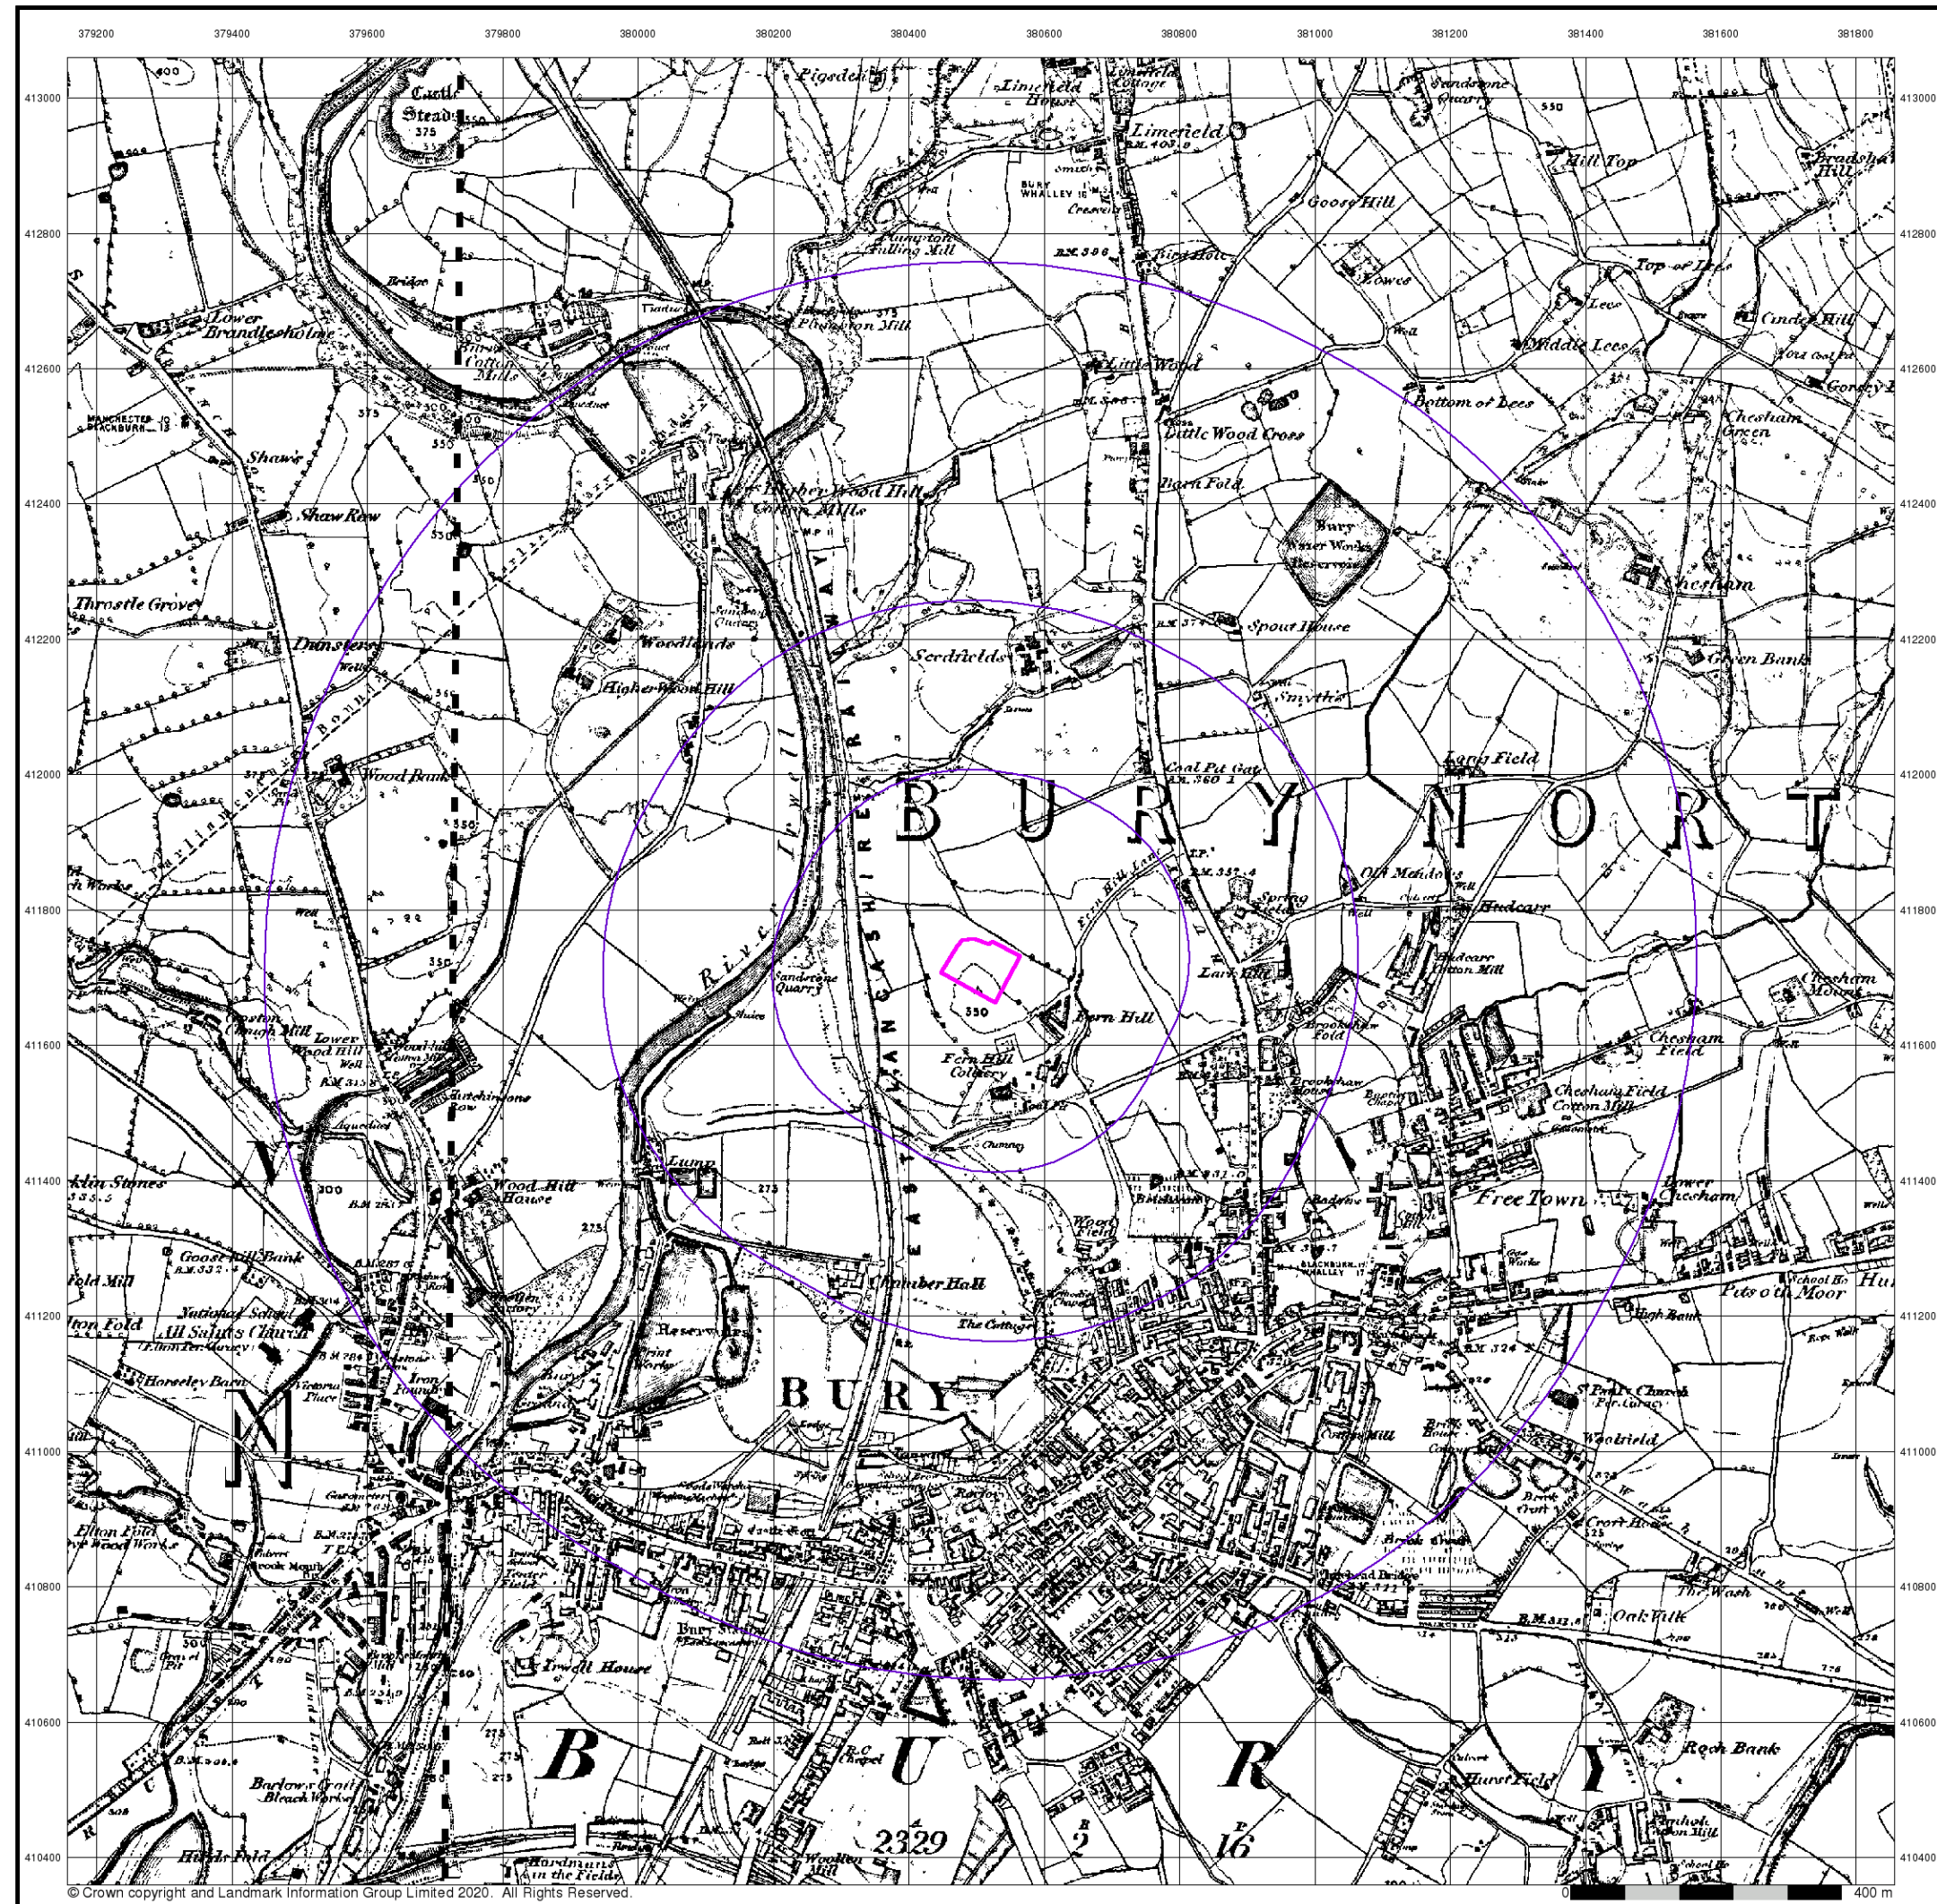


Lancashire And Furness

Published 1850 - 1851


Source map scale - 1:10,560

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas; these maps were used to update the 1:10,560 maps. The published date given therefore is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas. In the late 1940's, a Provisional Edition was produced, which updated the 1:10,560 mapping from a number of sources. The maps appear unfinished - with all military camps and other strategic sites removed. These maps were initially overprinted with the National Grid. In 1970, the first 1:10,000 maps were produced using the Transverse Mercator Projection. The revision process continued until recently, with new editions appearing every 10 years or so for urban areas.

Map Name(s) and Date(s)

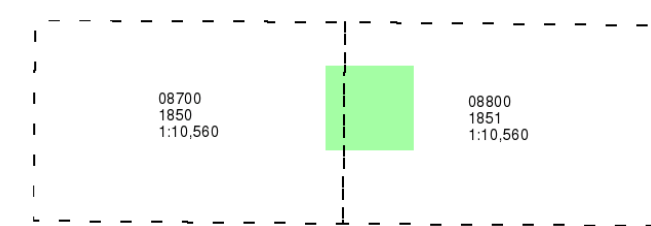

Historical Map - Slice A

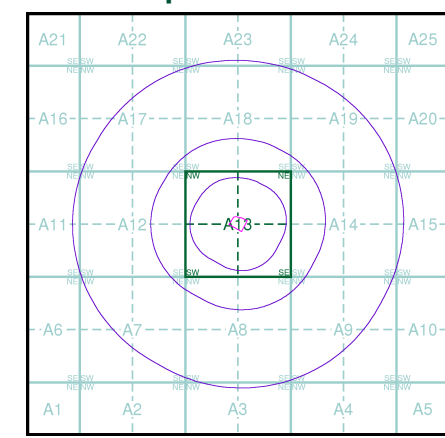

Order Details

Order Number: 269841542_1_1
Customer Ref: 11542
National Grid Reference: 380510, 411710
Slice: A
Site Area (Ha): 0.65
Search Buffer (m): 1000

Site Details

Site at 380490, 411720



Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk